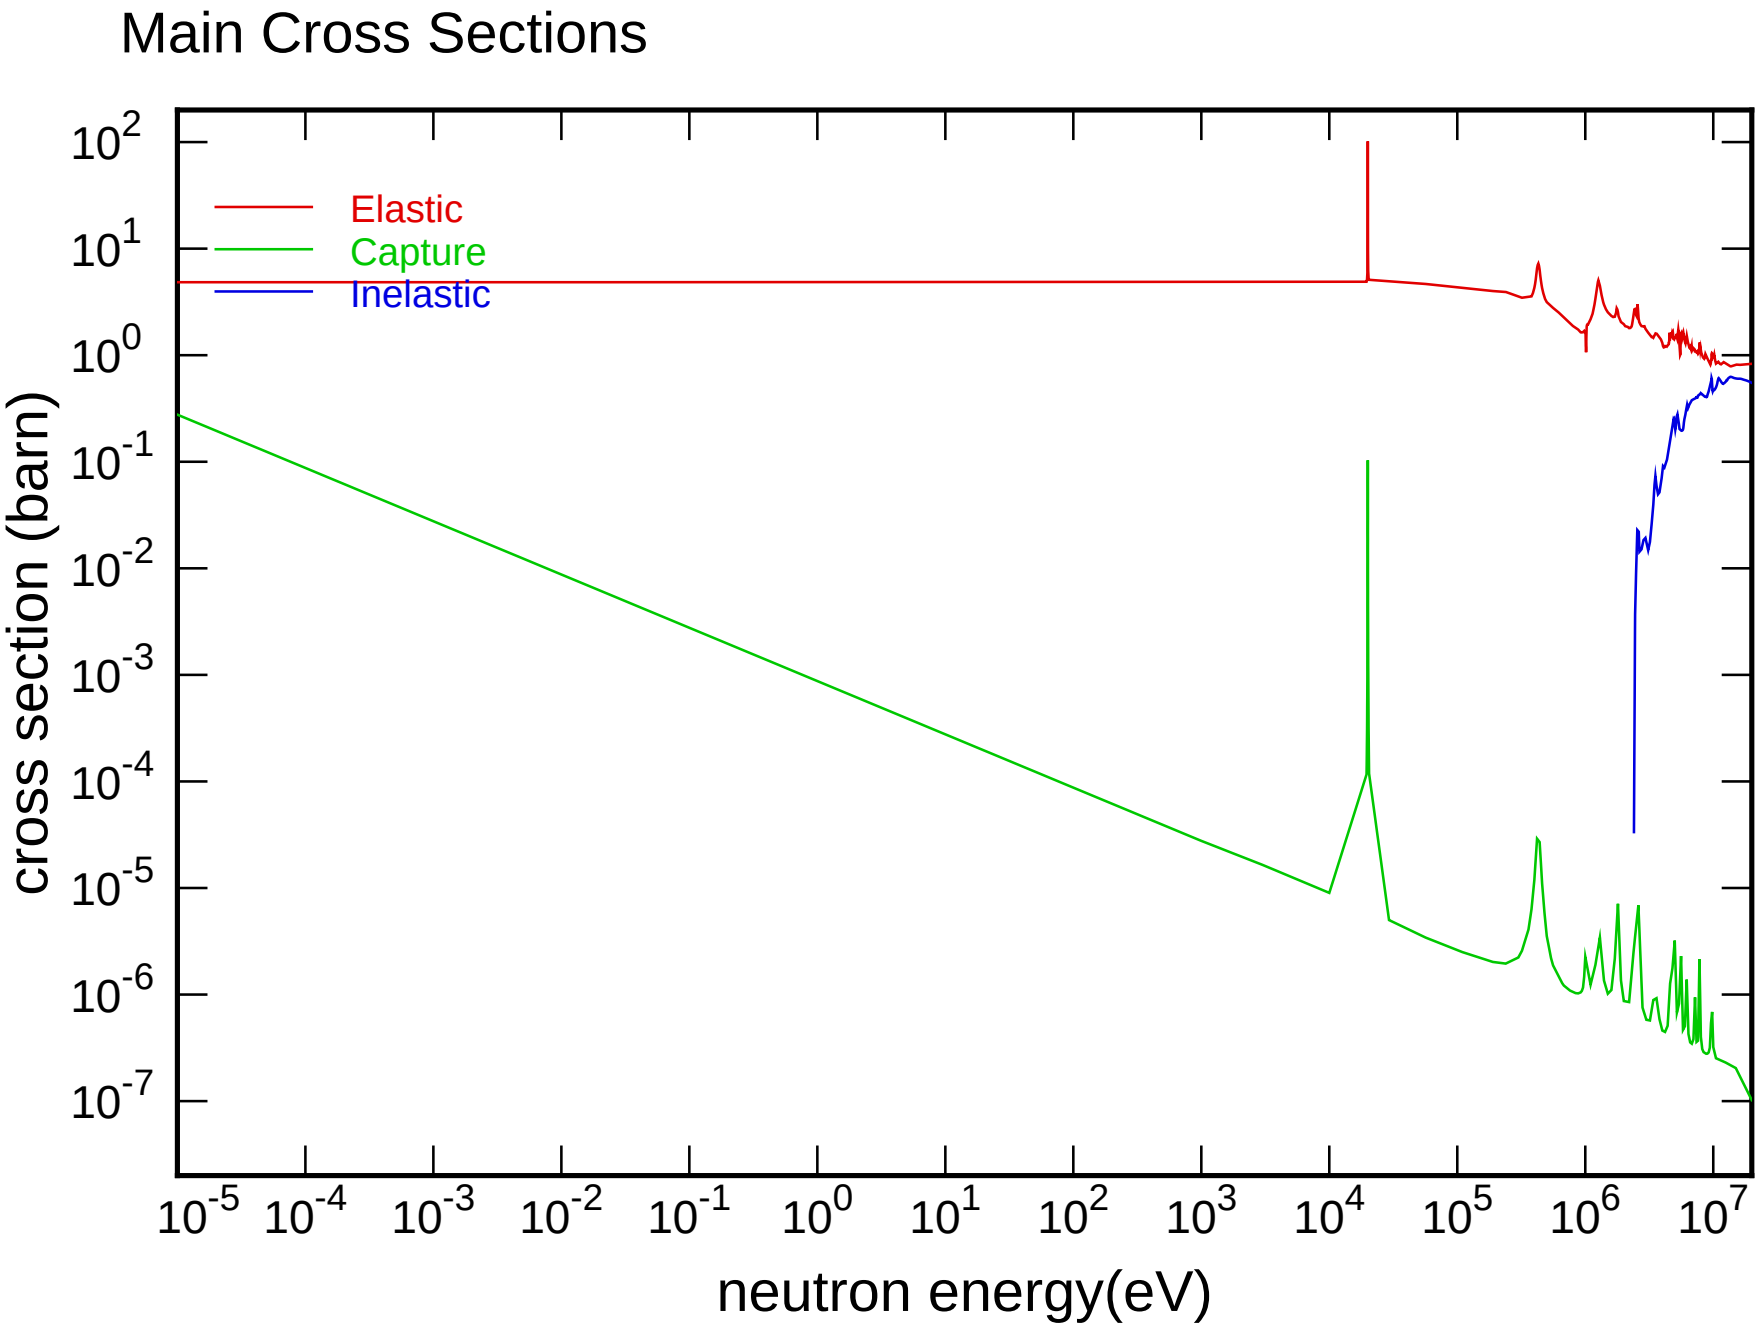
Main Cross Sections
Elastic
Capture
Inelastic
cross section (barn)
neutron energy(eV)
10^2
10^1
10^0
10^-1
10^-2
10^-3
10^-4
10^-5
10^-6
10^-7
10^-5 10^-4 10^-3 10^-2 10^-1 10^0 10^1 10^2 10^3 10^4 10^5 10^6 10^7

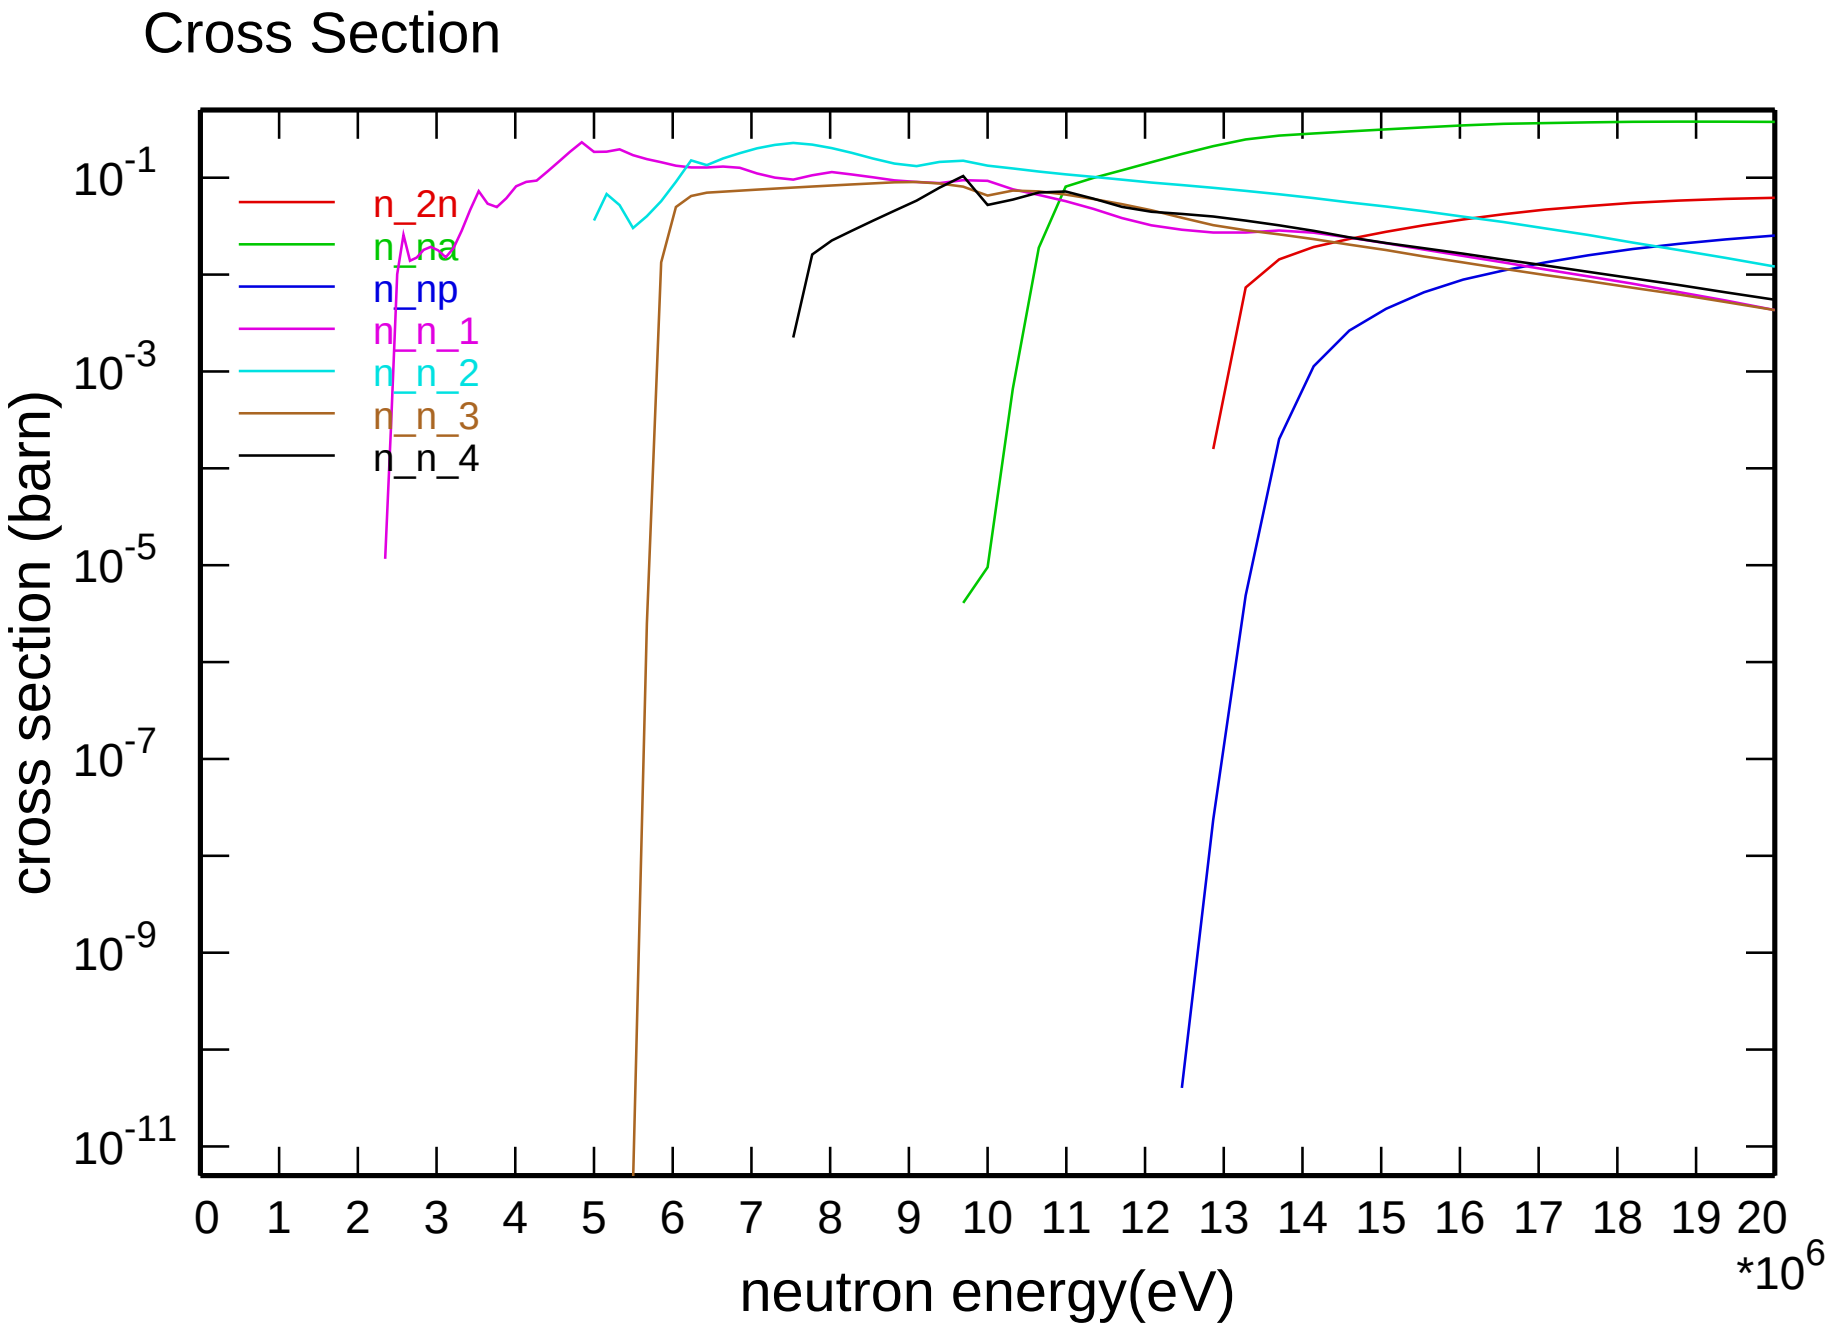
Cross Section
cross section (barn)
10-1
10-3
10-5
10-7
10-9
10-11
n_2n
n_na
n_np
n_n_1
n_n_2
n_n_3
n_n_4
0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20
*10^6
neutron energy(eV)

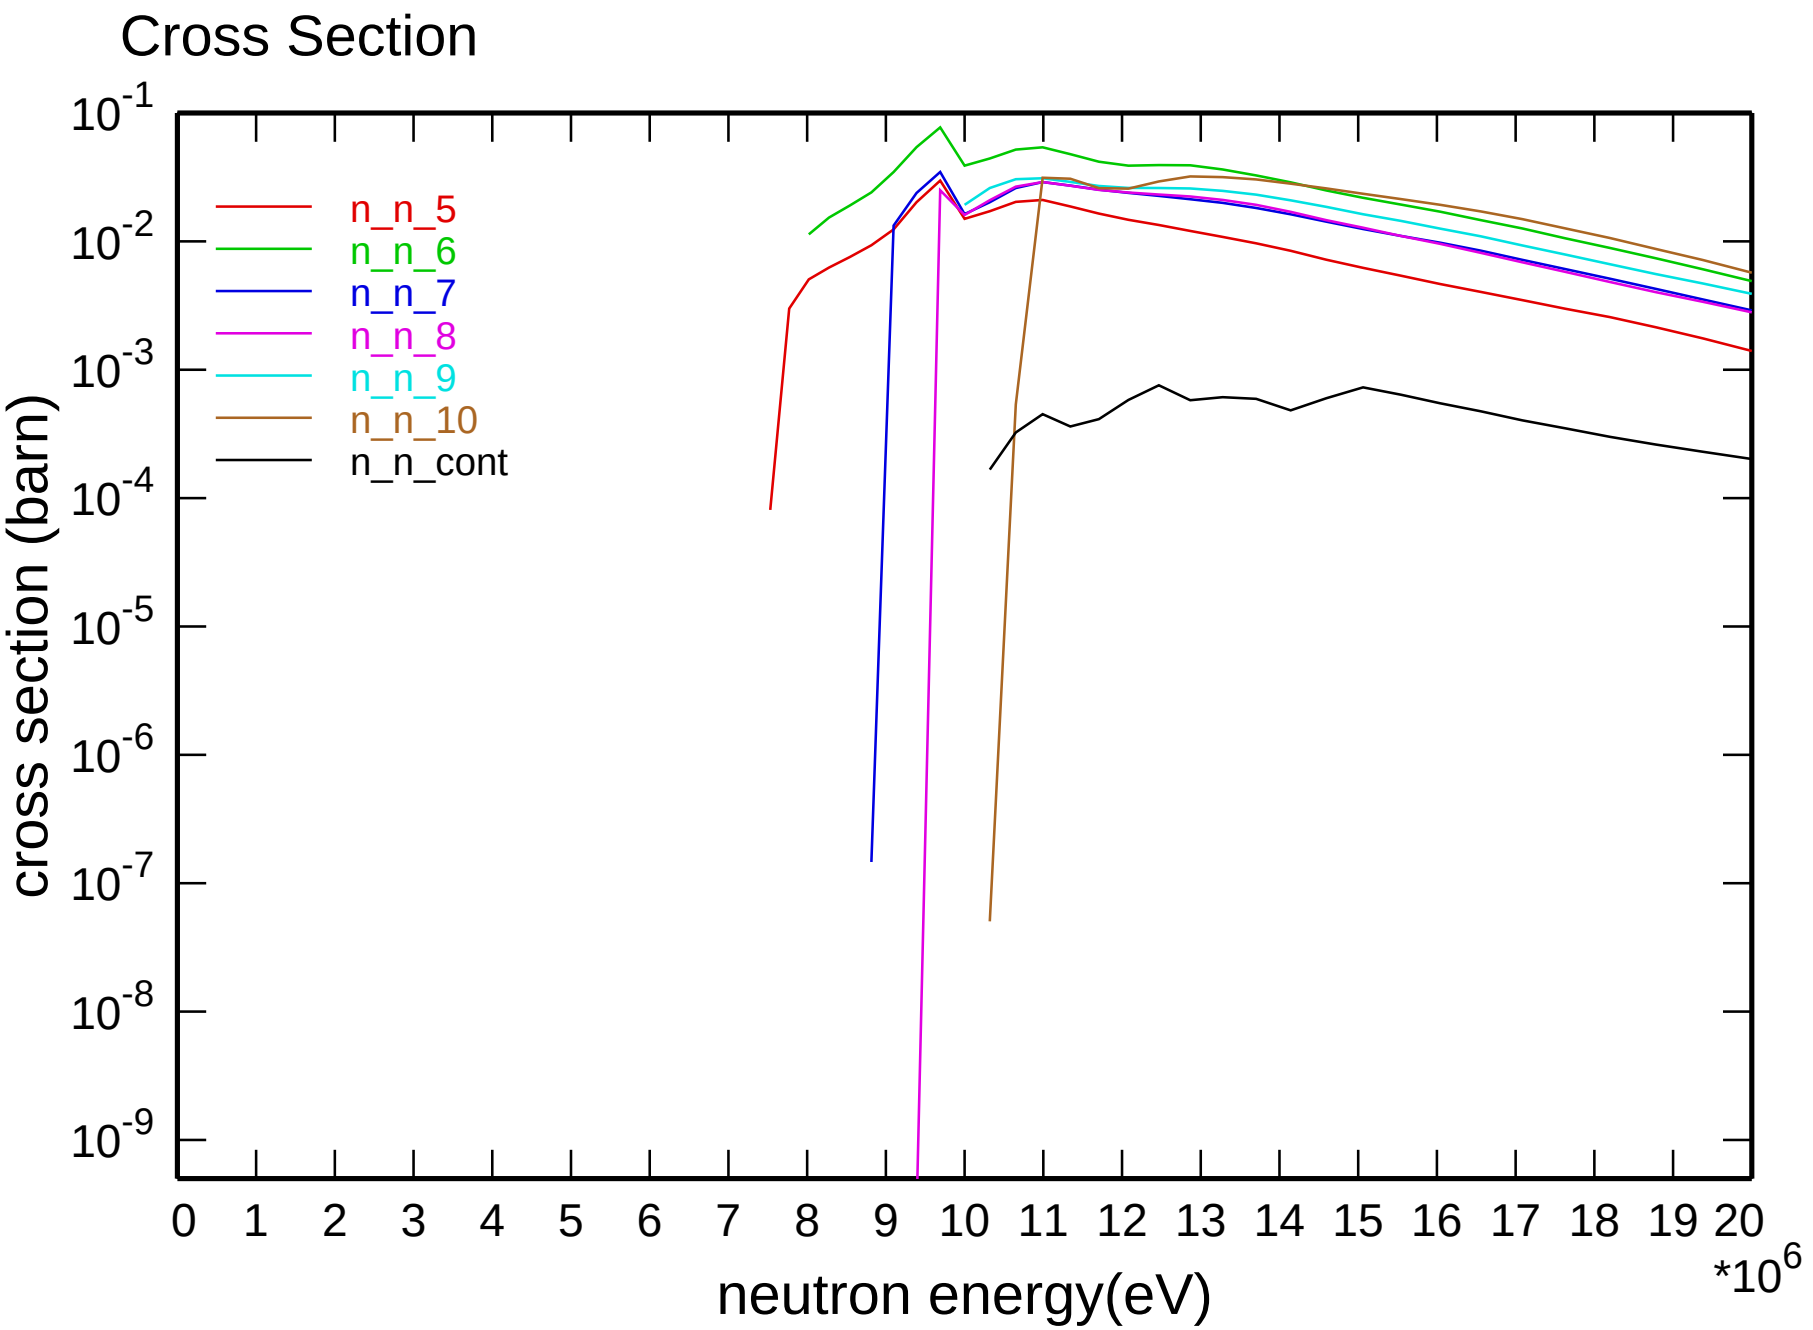
Cross Section
cross section (barn)
neutron energy(eV)
*10^6
n_n_5
n_n_6
n_n_7
n_n_8
n_n_9
n_n_10
n_n_cont

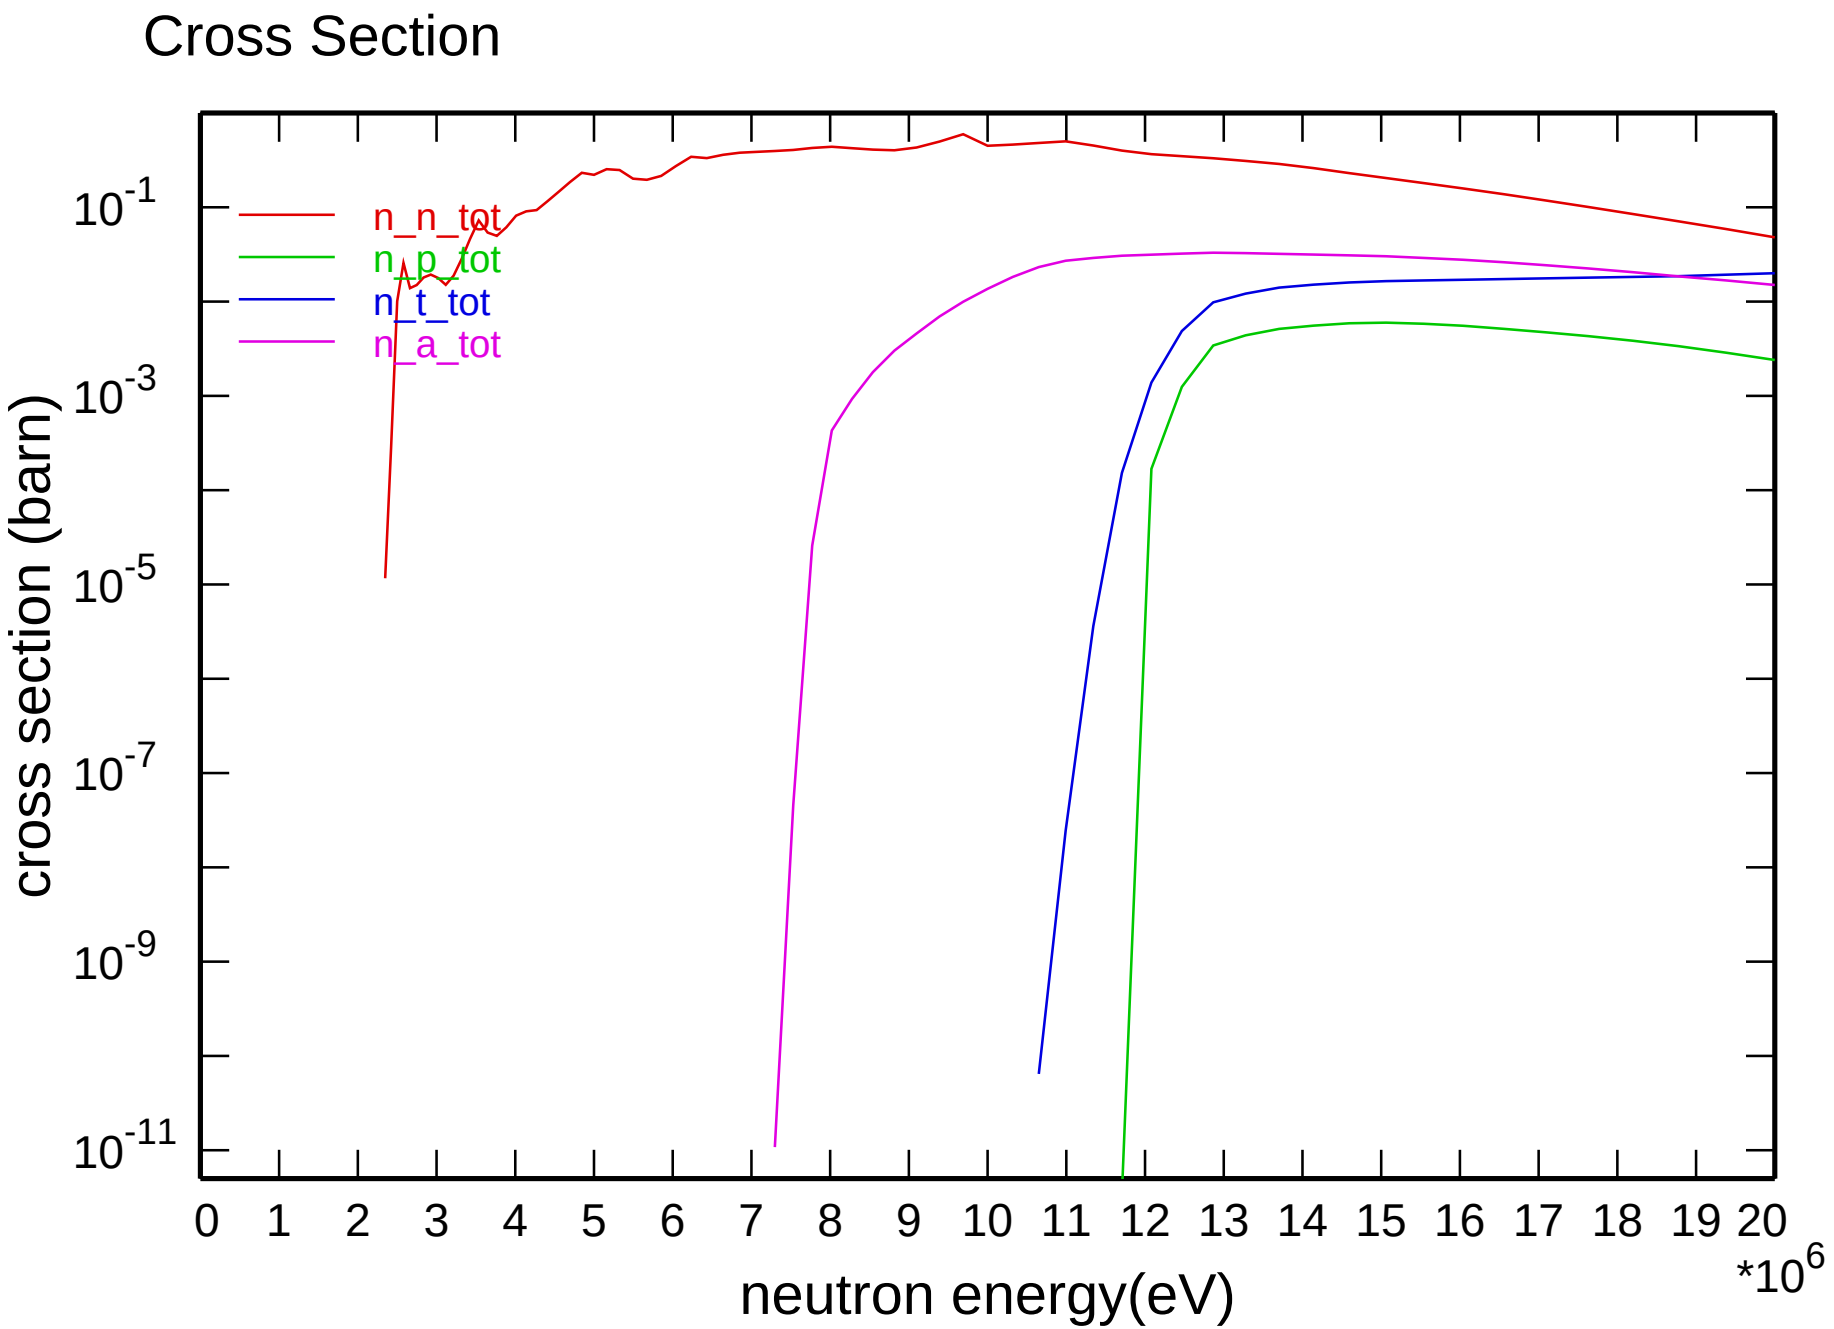
Cross Section
n_n_tot
n_p_tot
n_t_tot
n_a_tot
cross section (barn)
10-1
10-3
10-5
10-7
10-9
10-11
0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20
*10^6
neutron energy(eV)

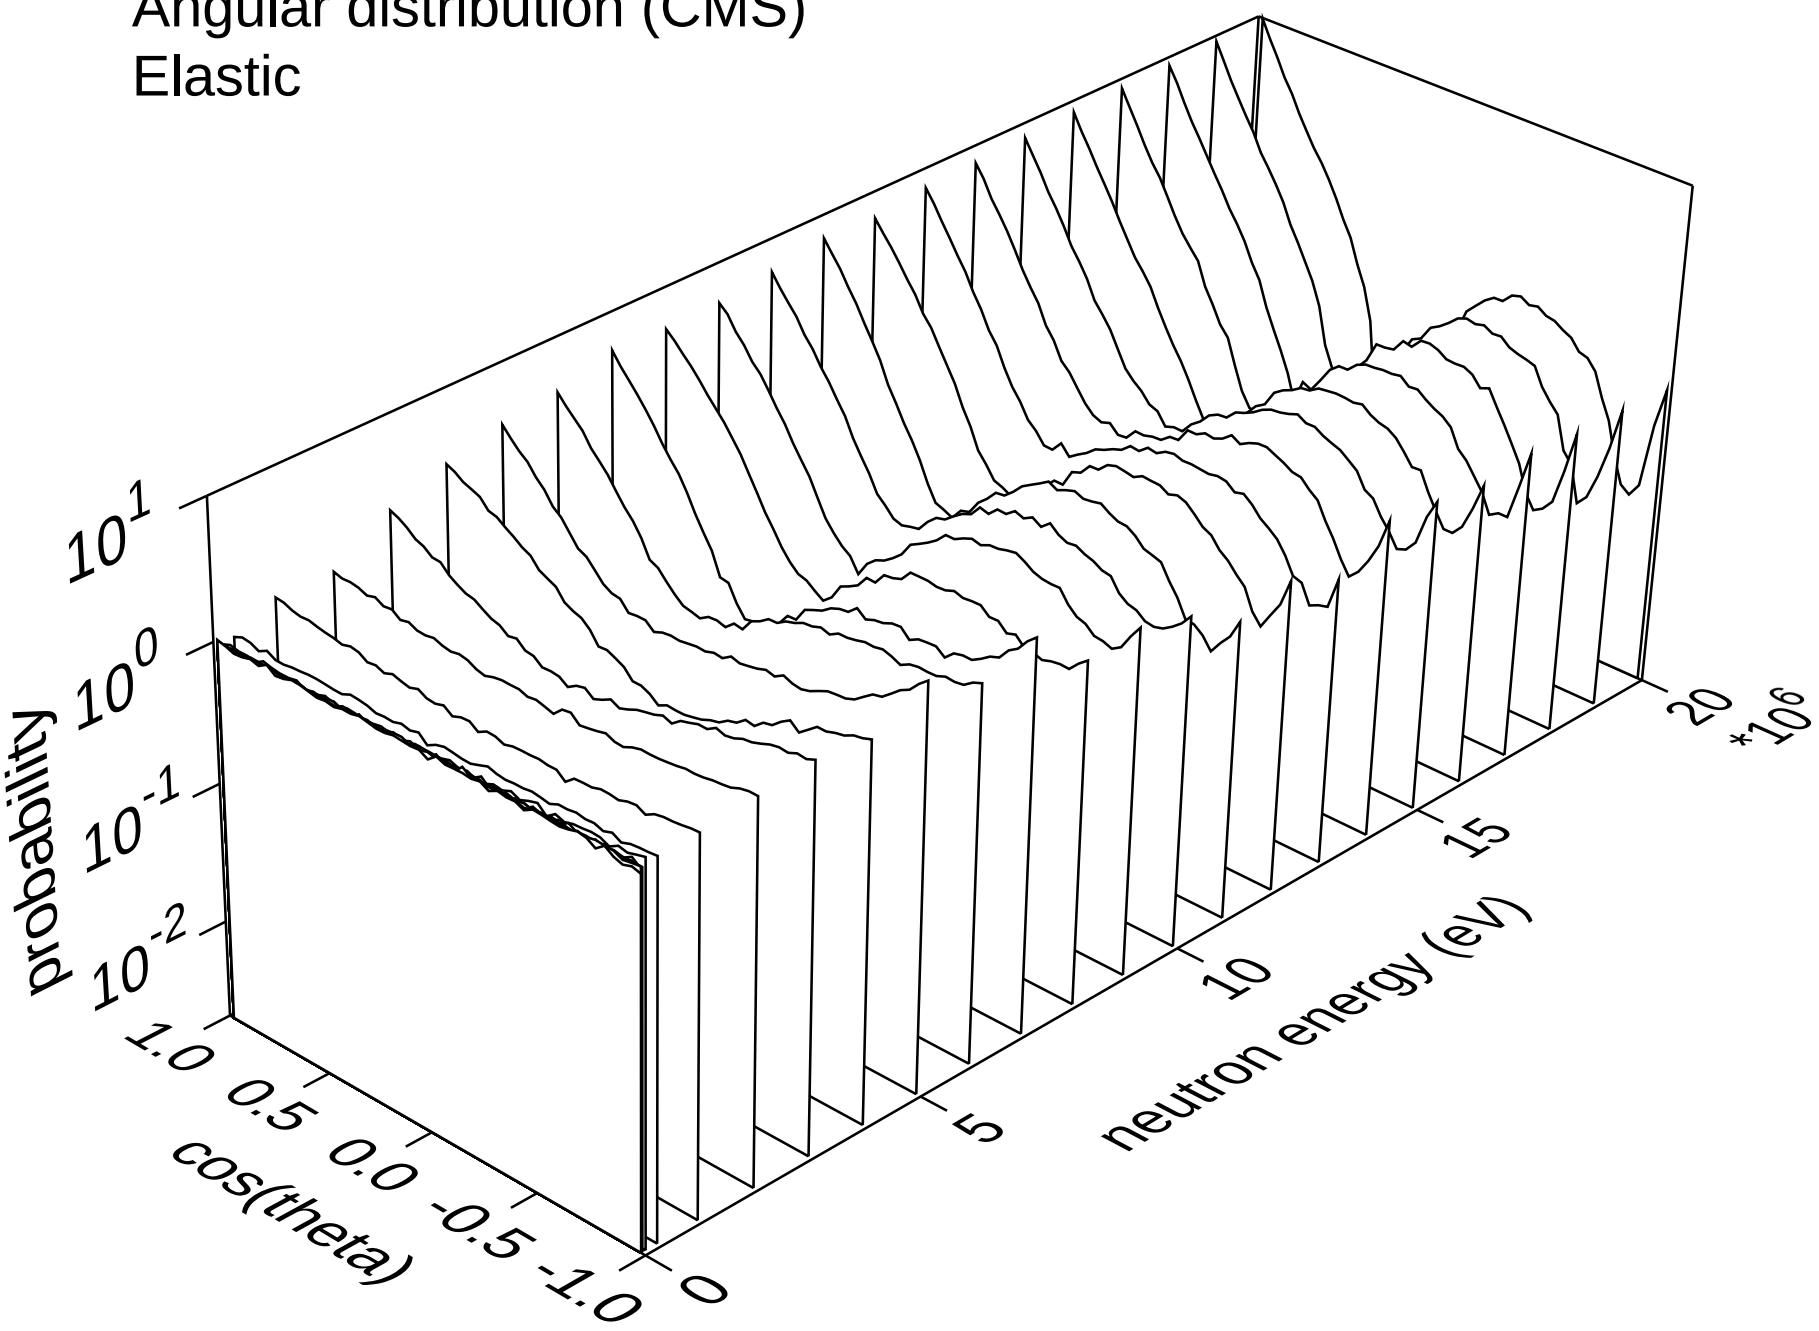
Angular distribution (CMS)
Elastic
probability
10^{1}
10^{0}
10^{-1}
10^{-2}
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
0
5
10
15
20
*10^6
neutron energy (eV)

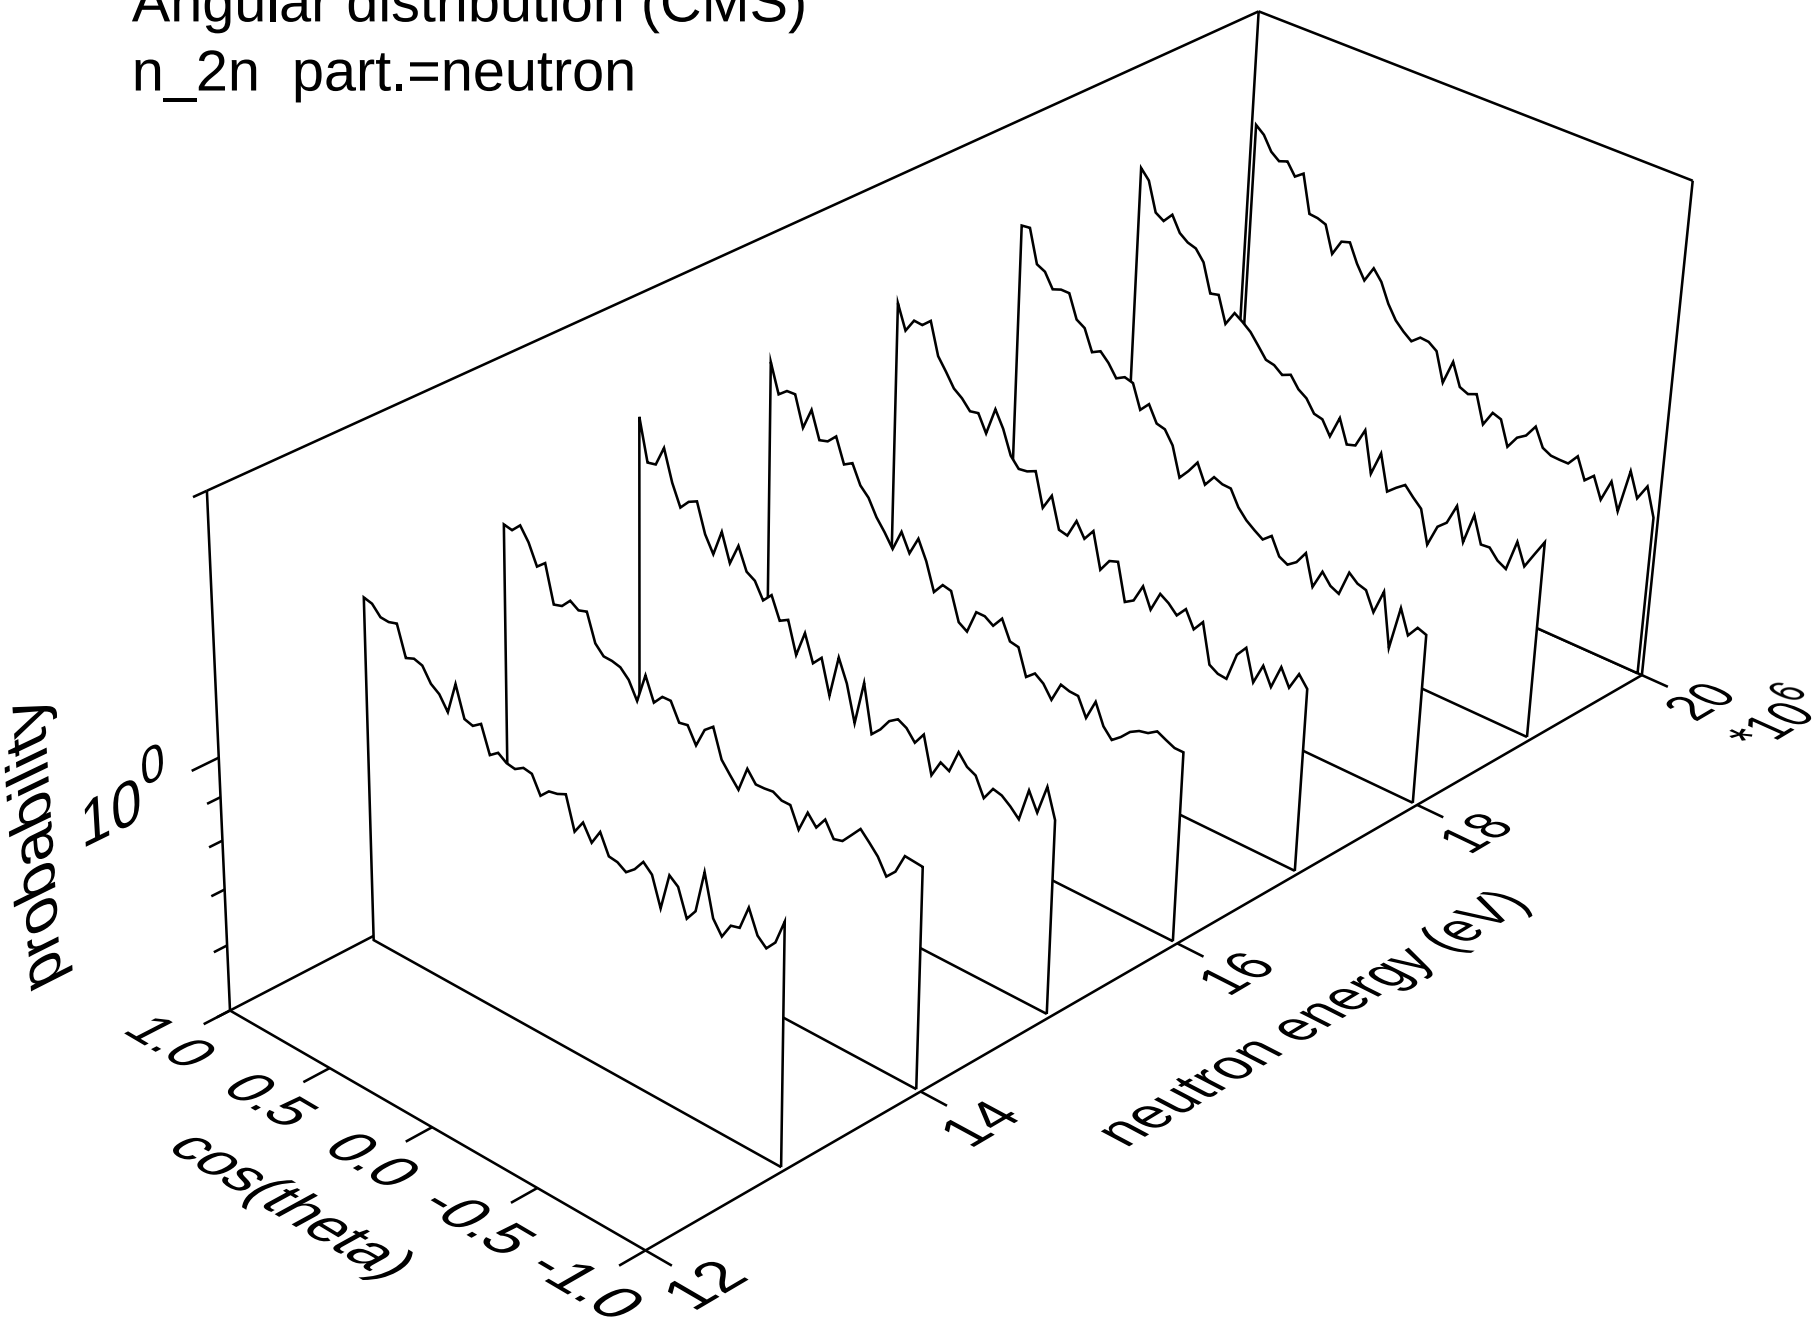
Angular distribution (CMS)
n_2n part.=neutron
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
12
14
16
18
20
*10^6
neutron energy (eV)

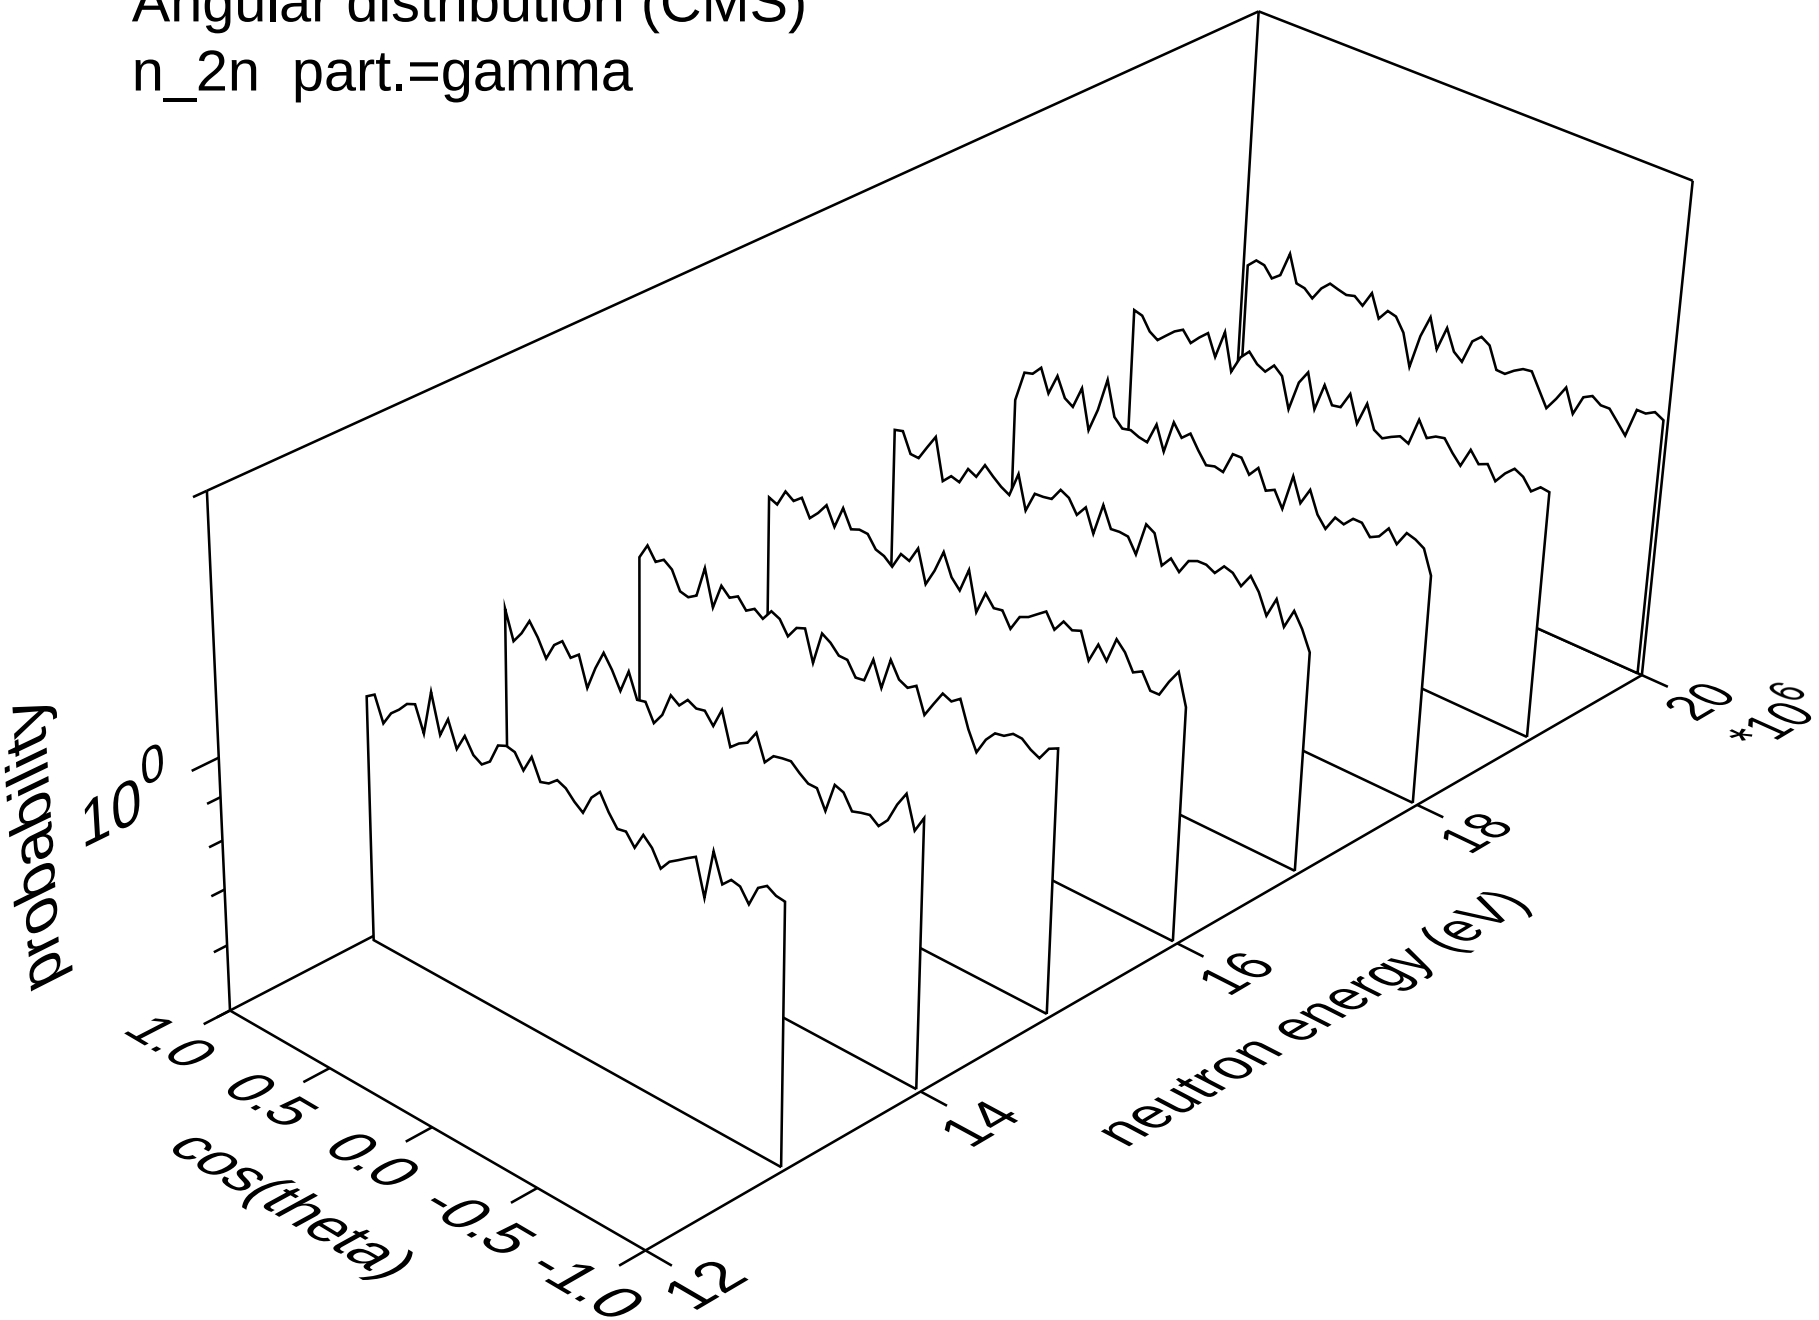
Angular distribution (CMS)
n_2n part.=gamma
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
12
14
16
18
20
*10^6
neutron energy (eV)

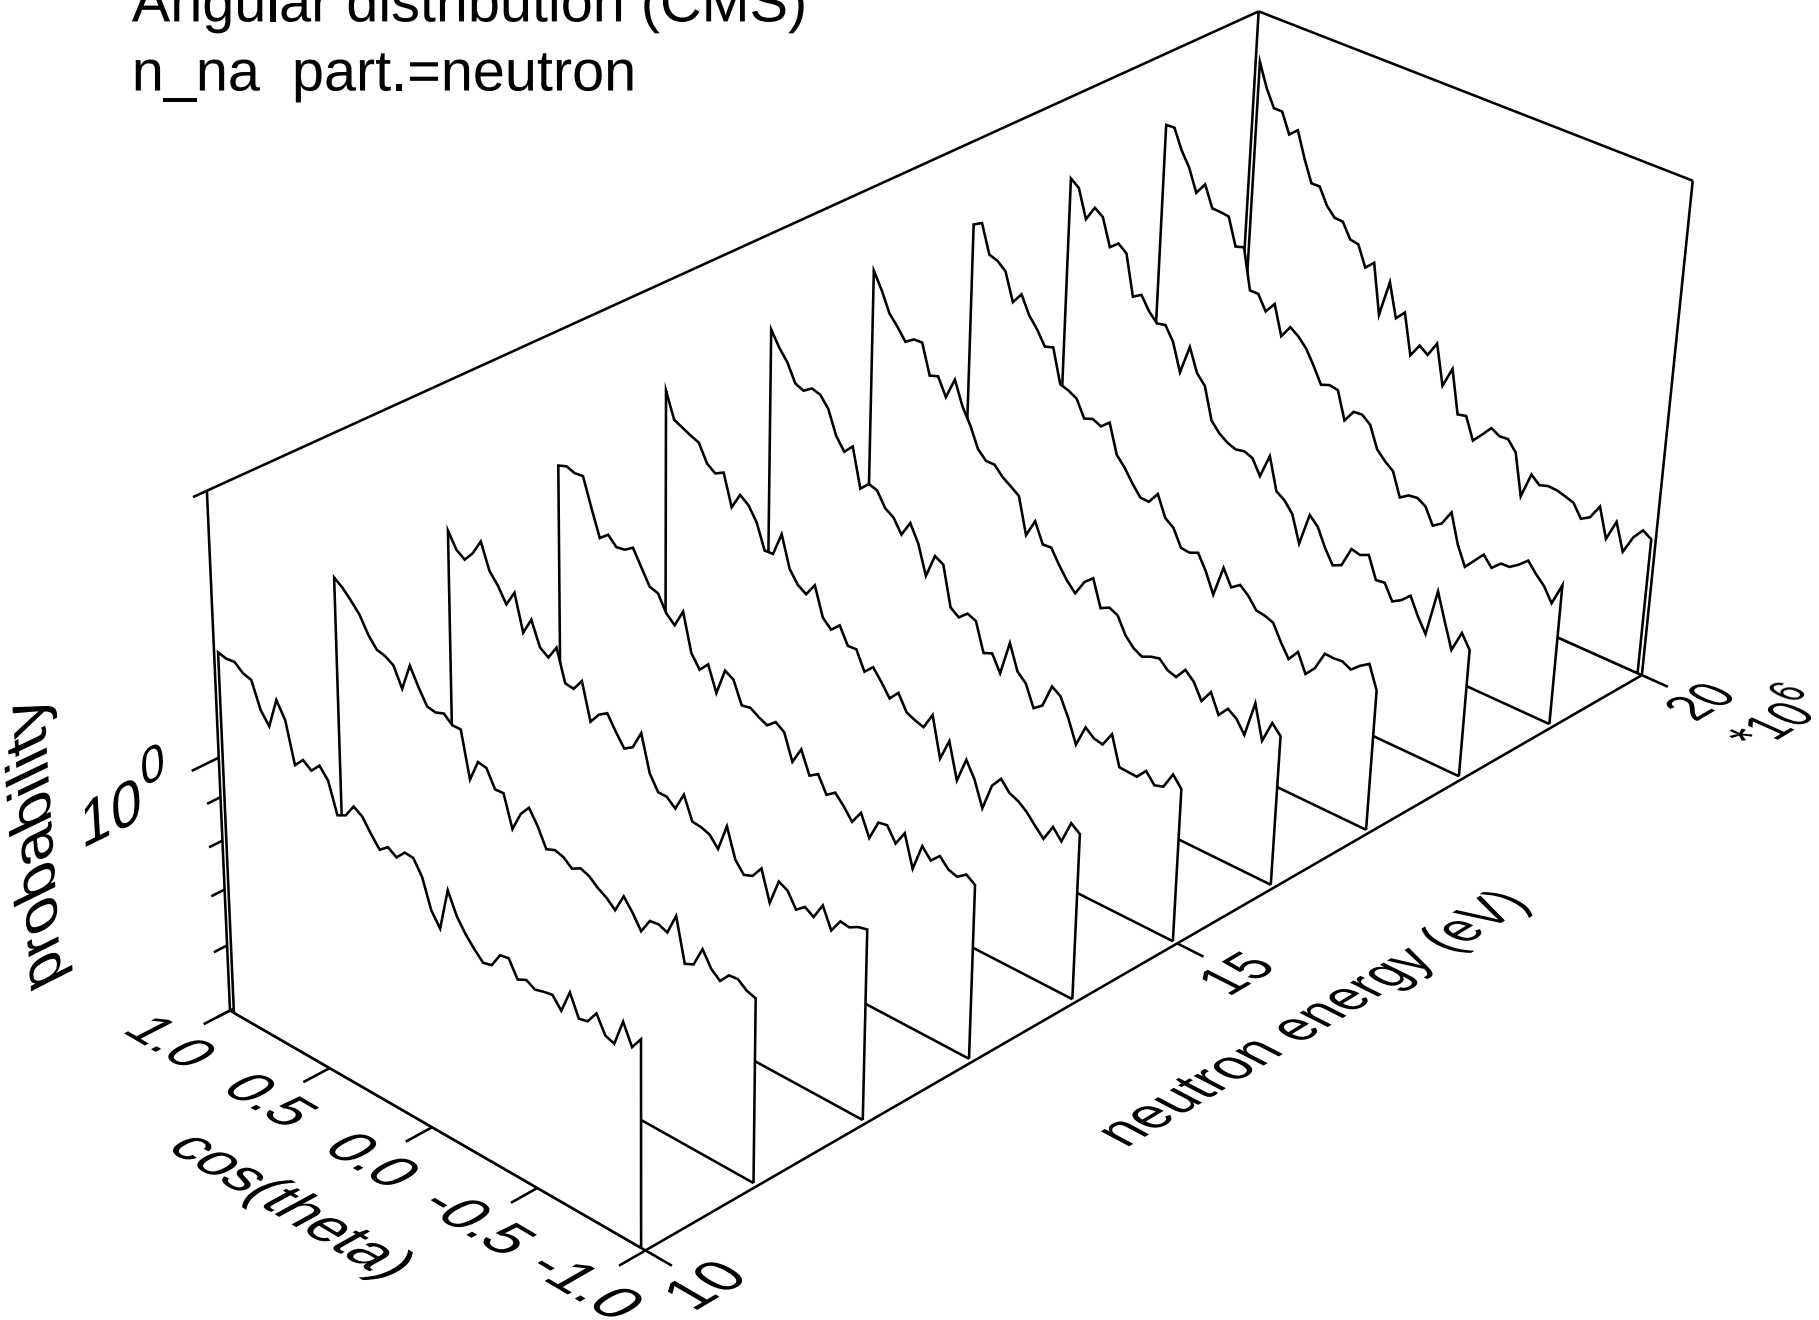
Angular distribution (CMS)
n_na part.=neutron
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
10
15
20
*10^6
neutron energy (eV)

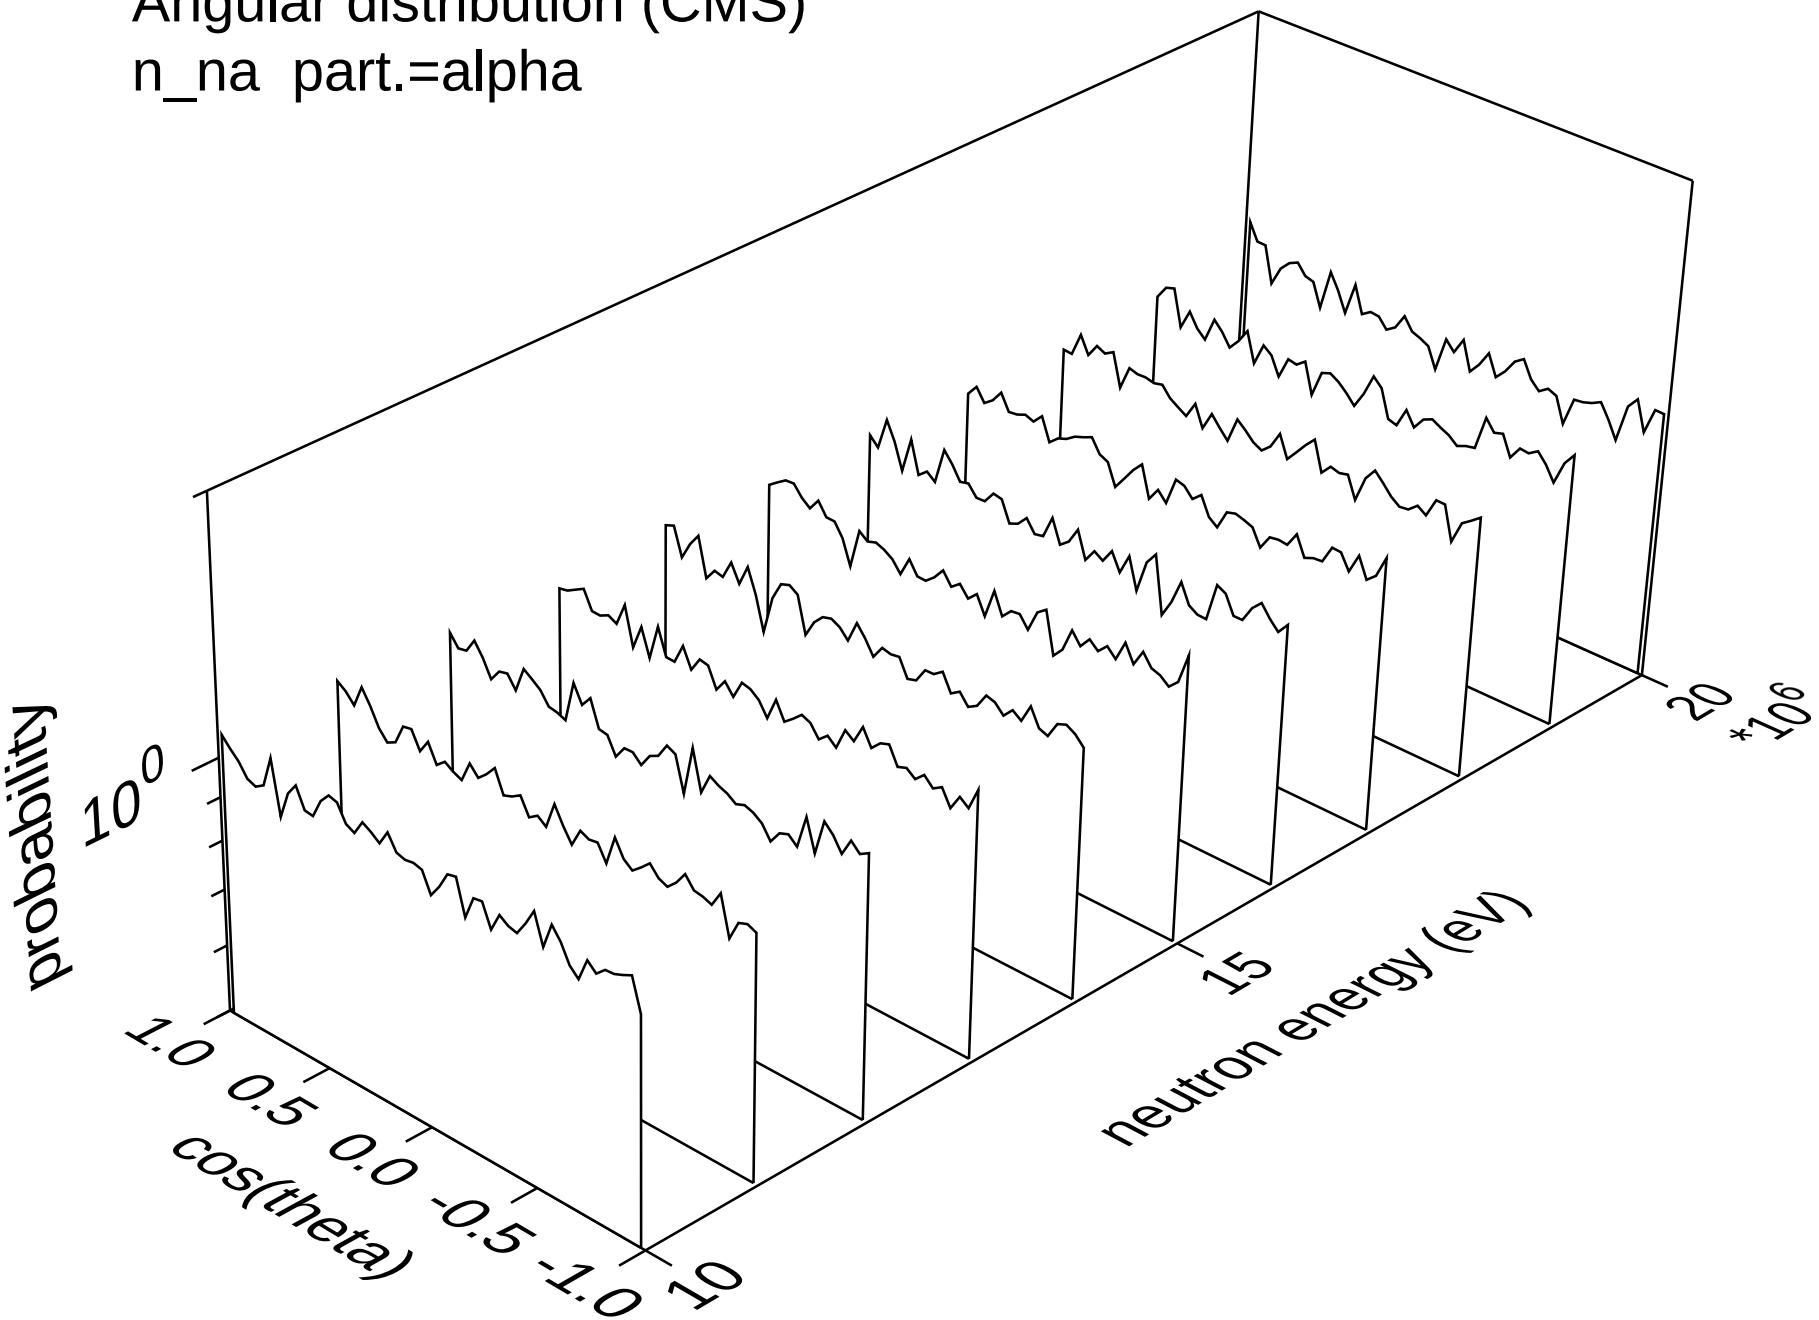
Angular distribution (CMS)
n_na part.=alpha
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
10
15
20
*10^6
neutron energy (eV)

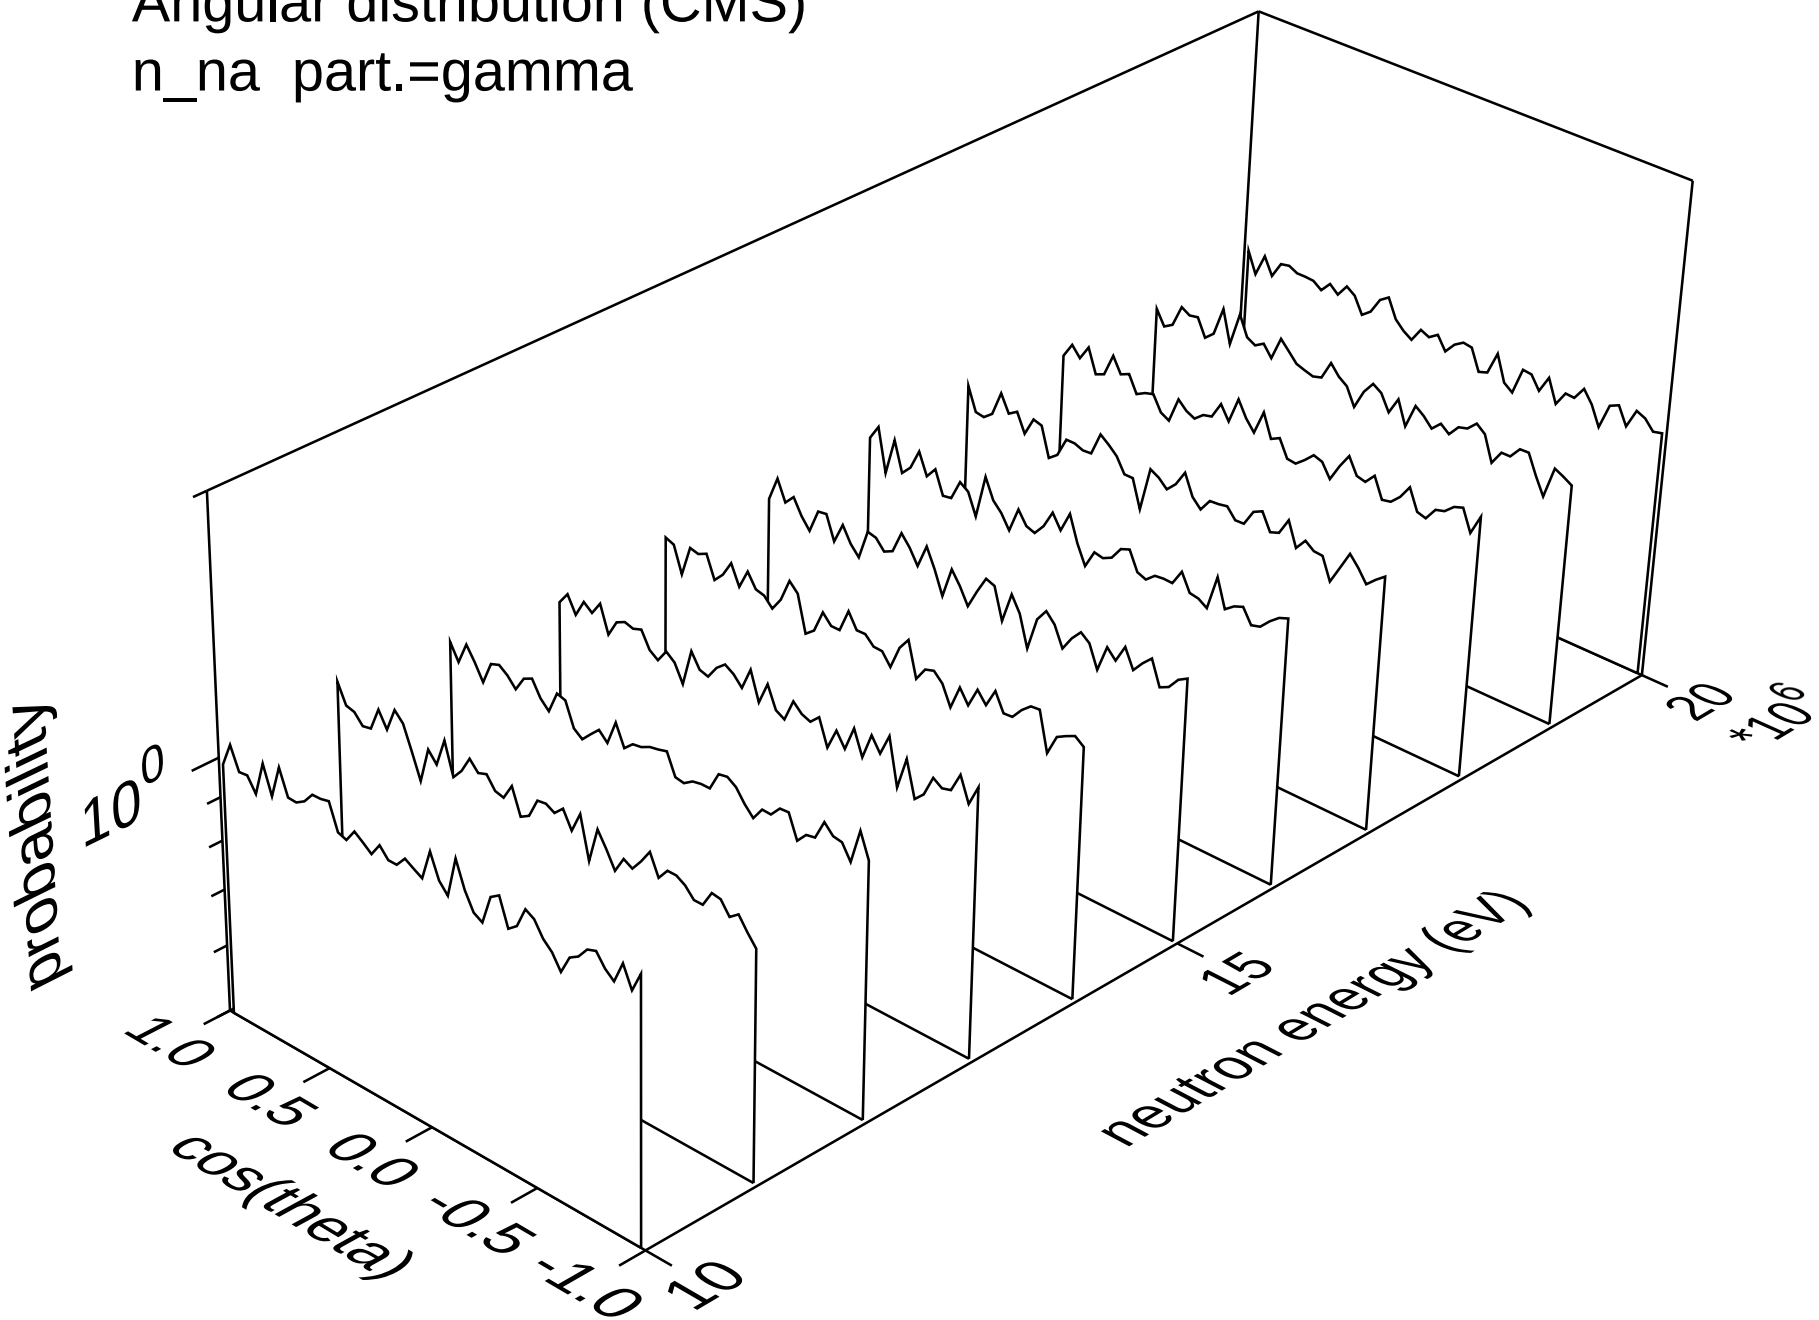
Angular distribution (CMS)
n_na part.=gamma
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
10
15
20
*10^6
neutron energy (eV)

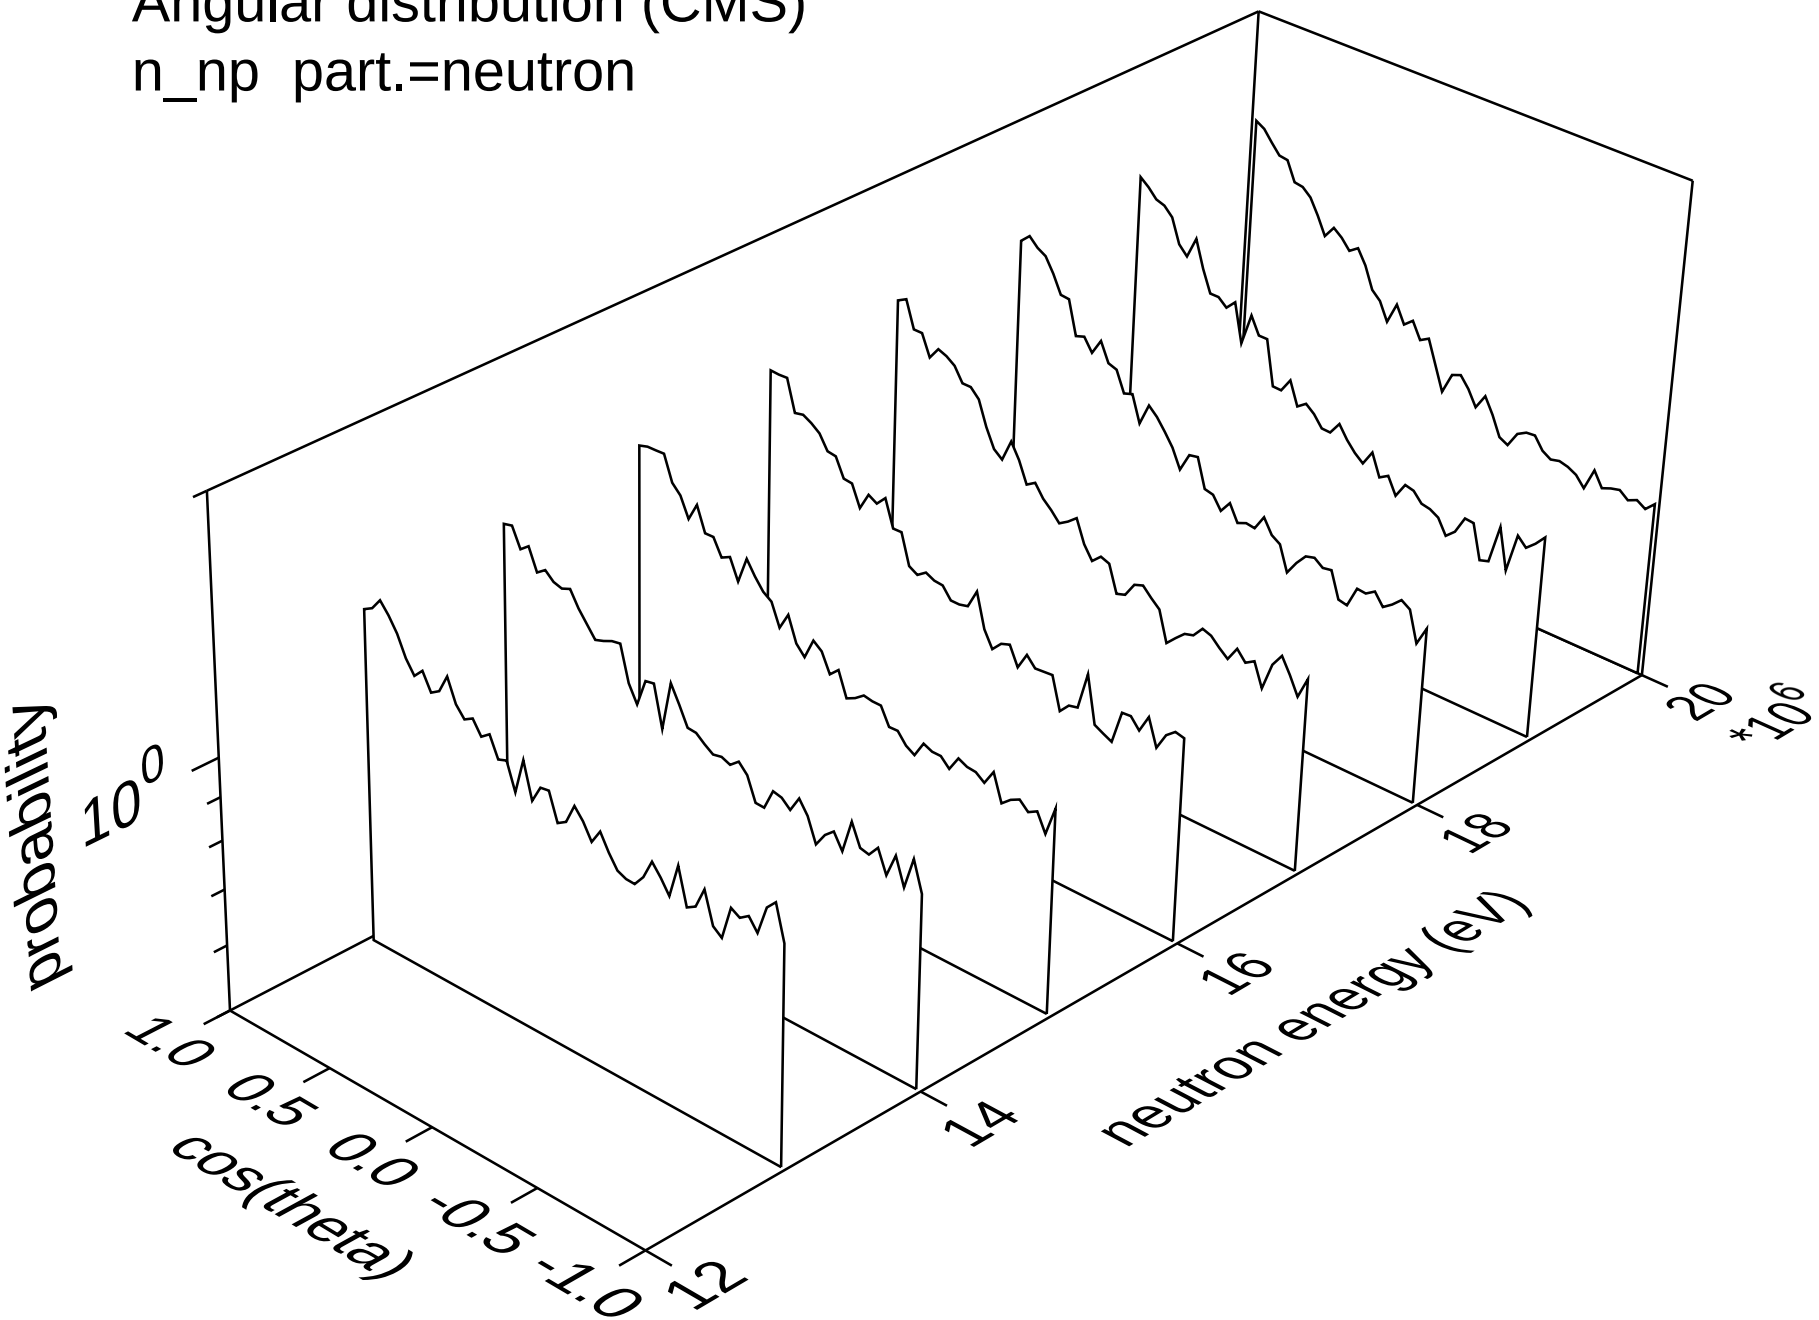
Angular distribution (CMS)
n_np part.=neutron
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
12
14
16
18
20
*10^6
neutron energy (eV)

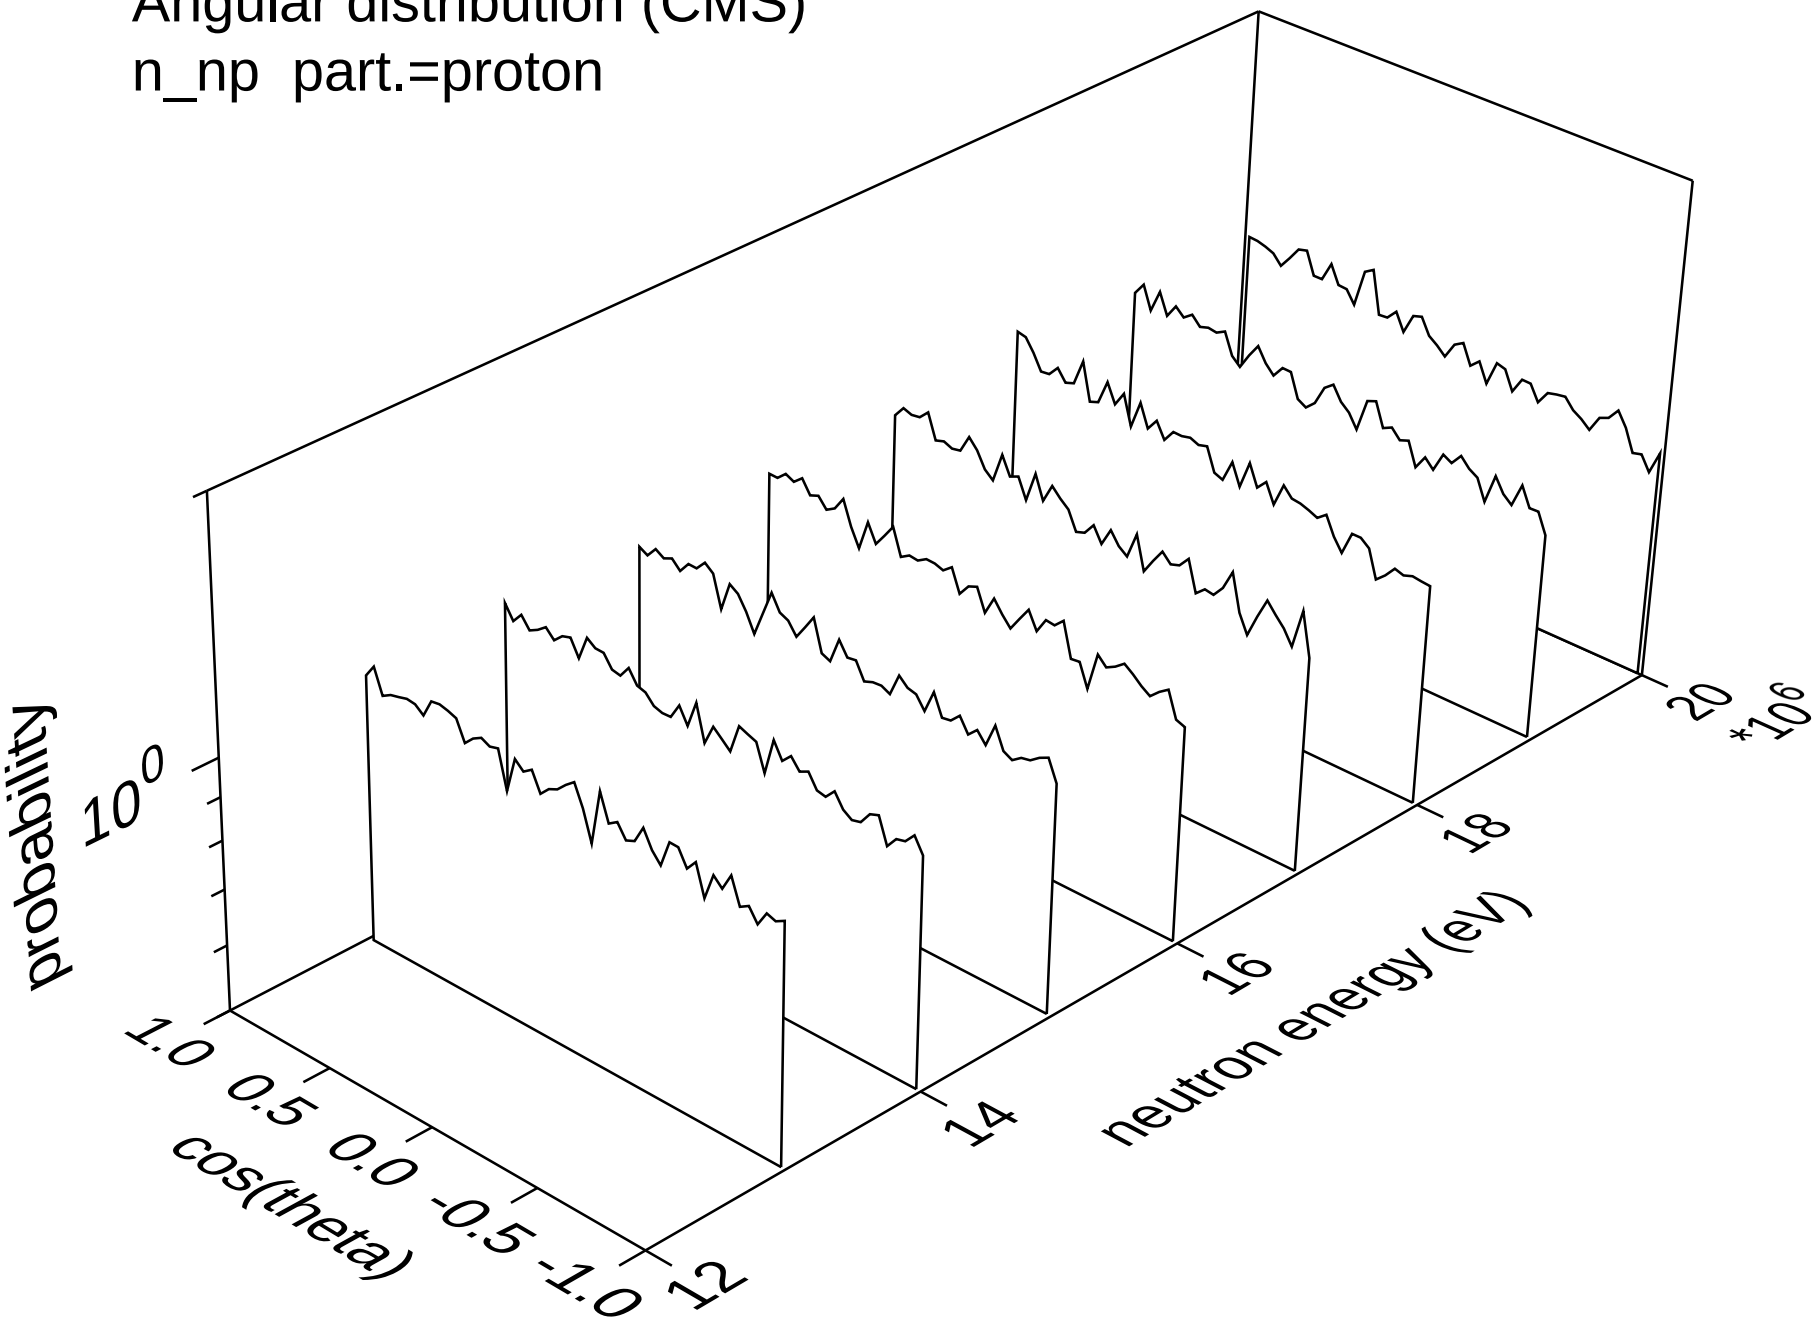
Angular distribution (CMS)
n_np part.=proton
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
12
14
16
18
20
*10^6
neutron energy (eV)

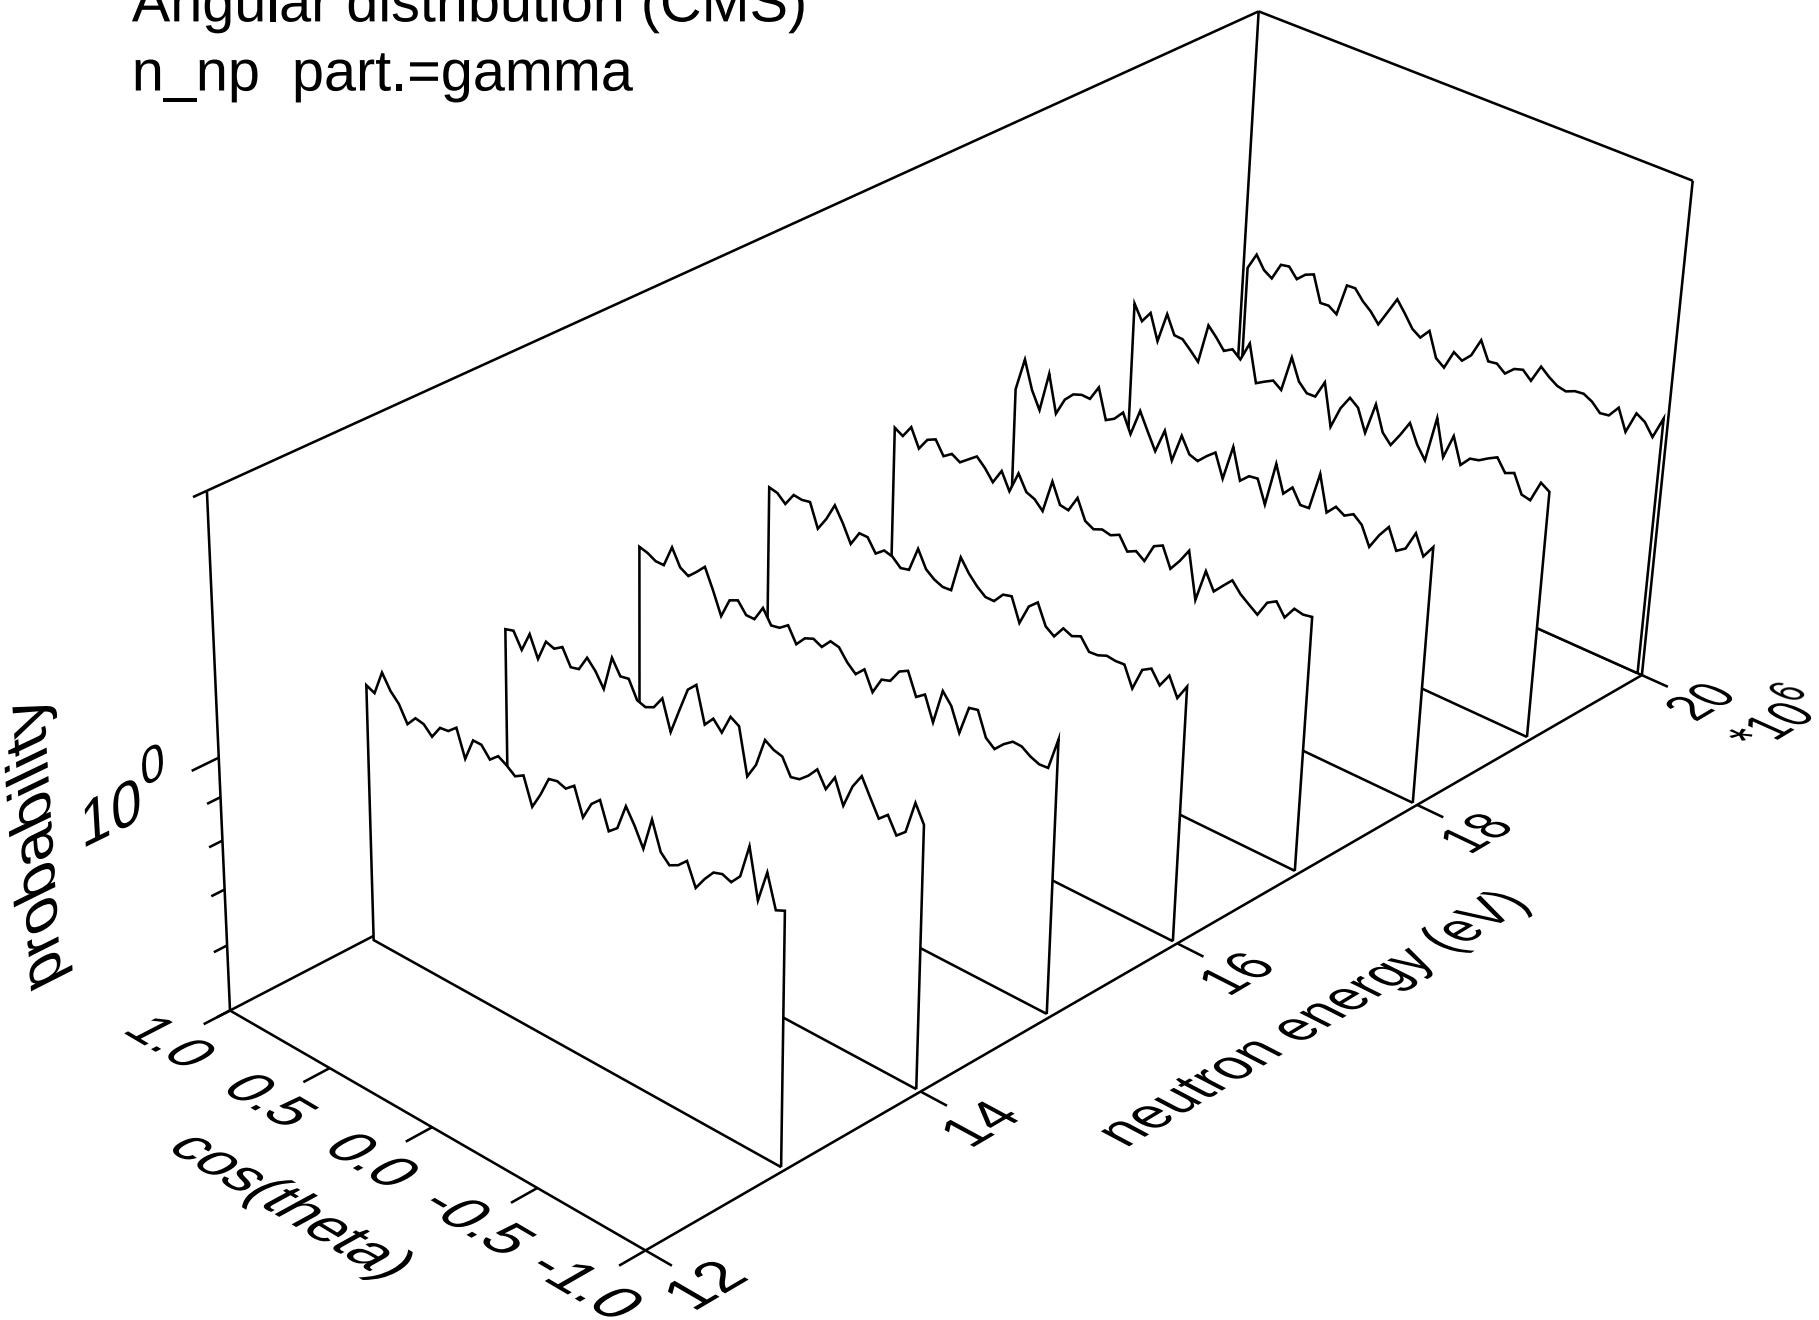
Angular distribution (CMS)
n_np part.=gamma
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
12
14
16
18
20
*10^6
neutron energy (eV)

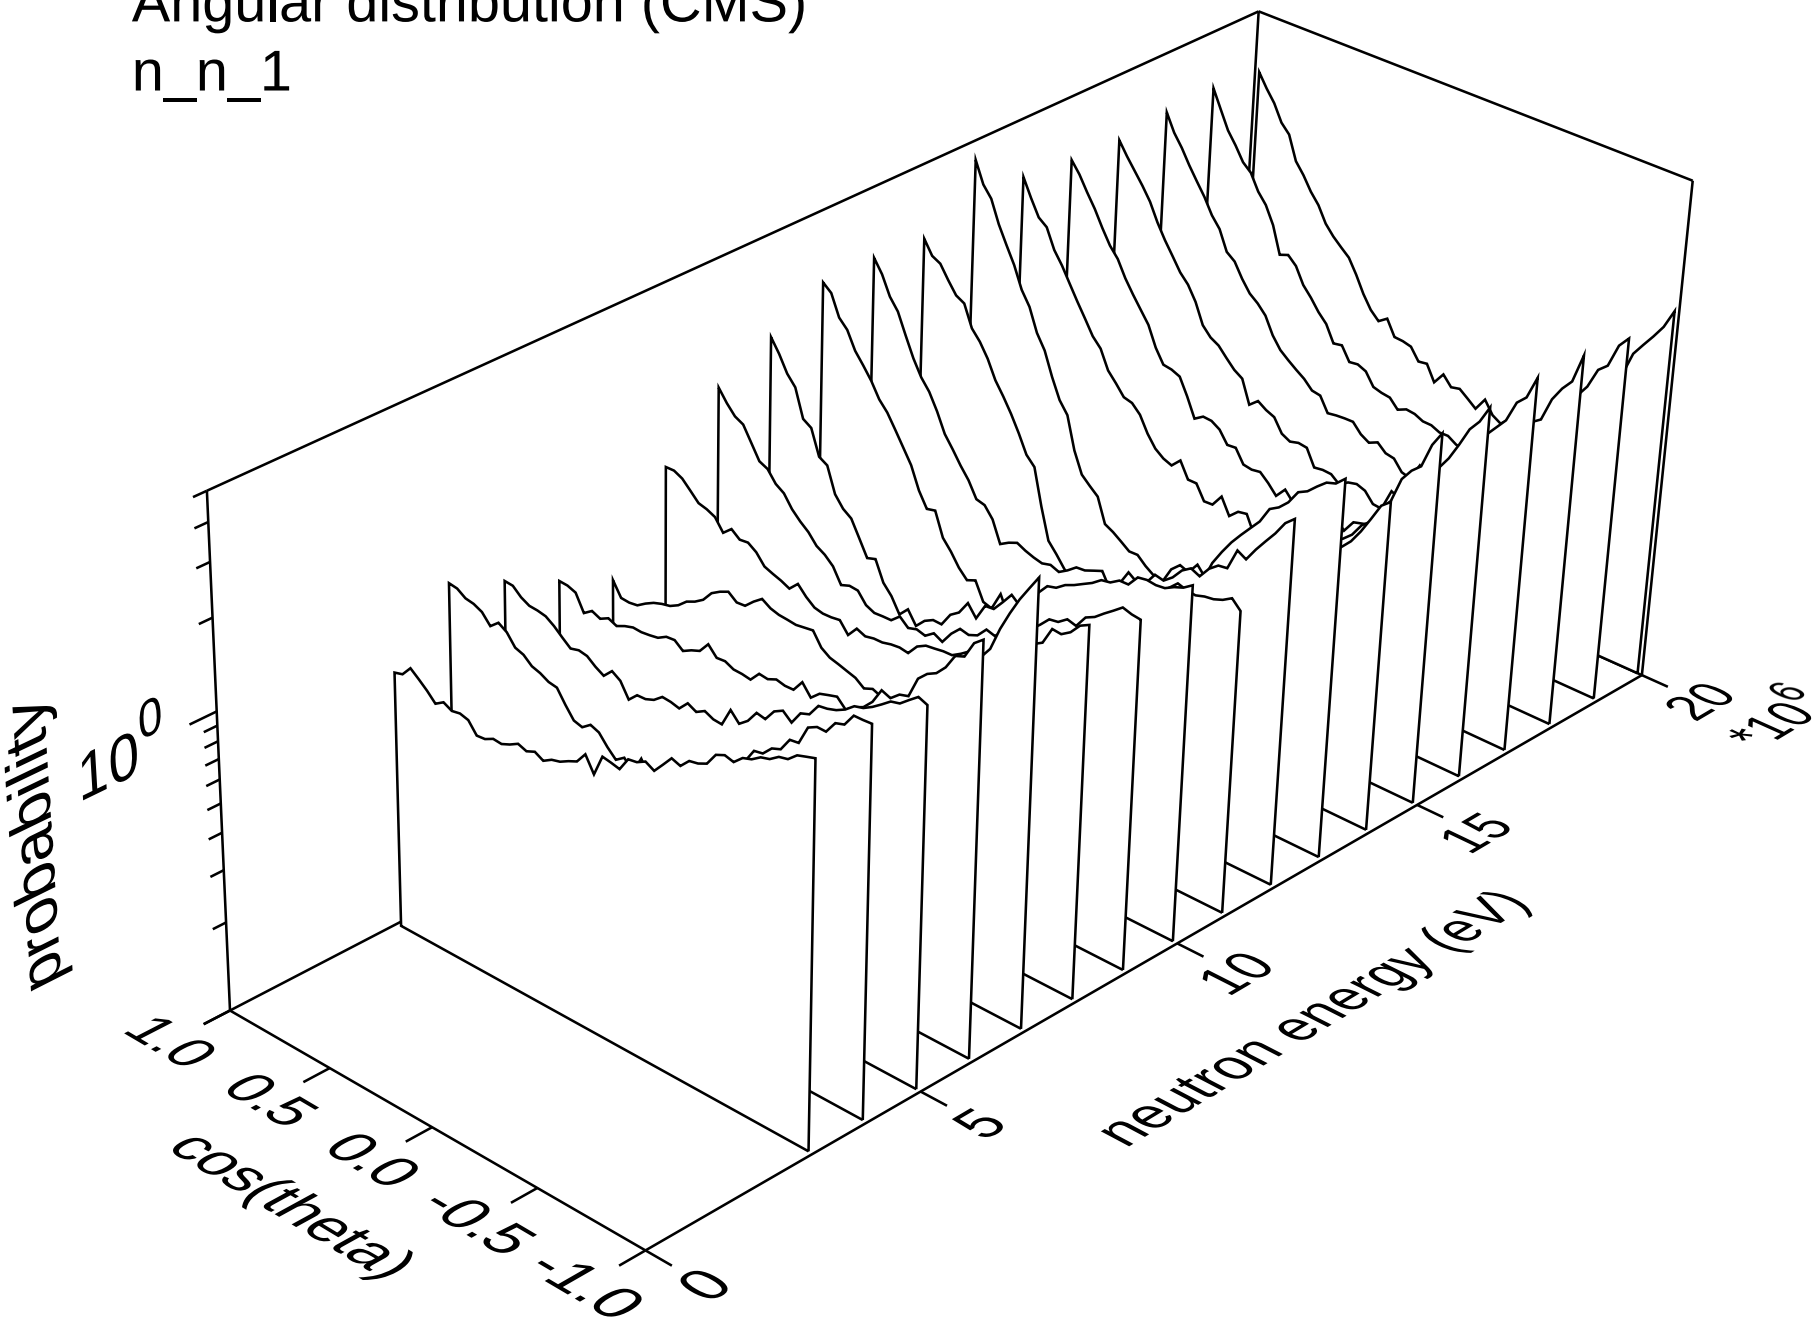
Angular distribution (CMS)
n_n_1
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
0
5
10
15
20
*10^6
neutron energy (eV)

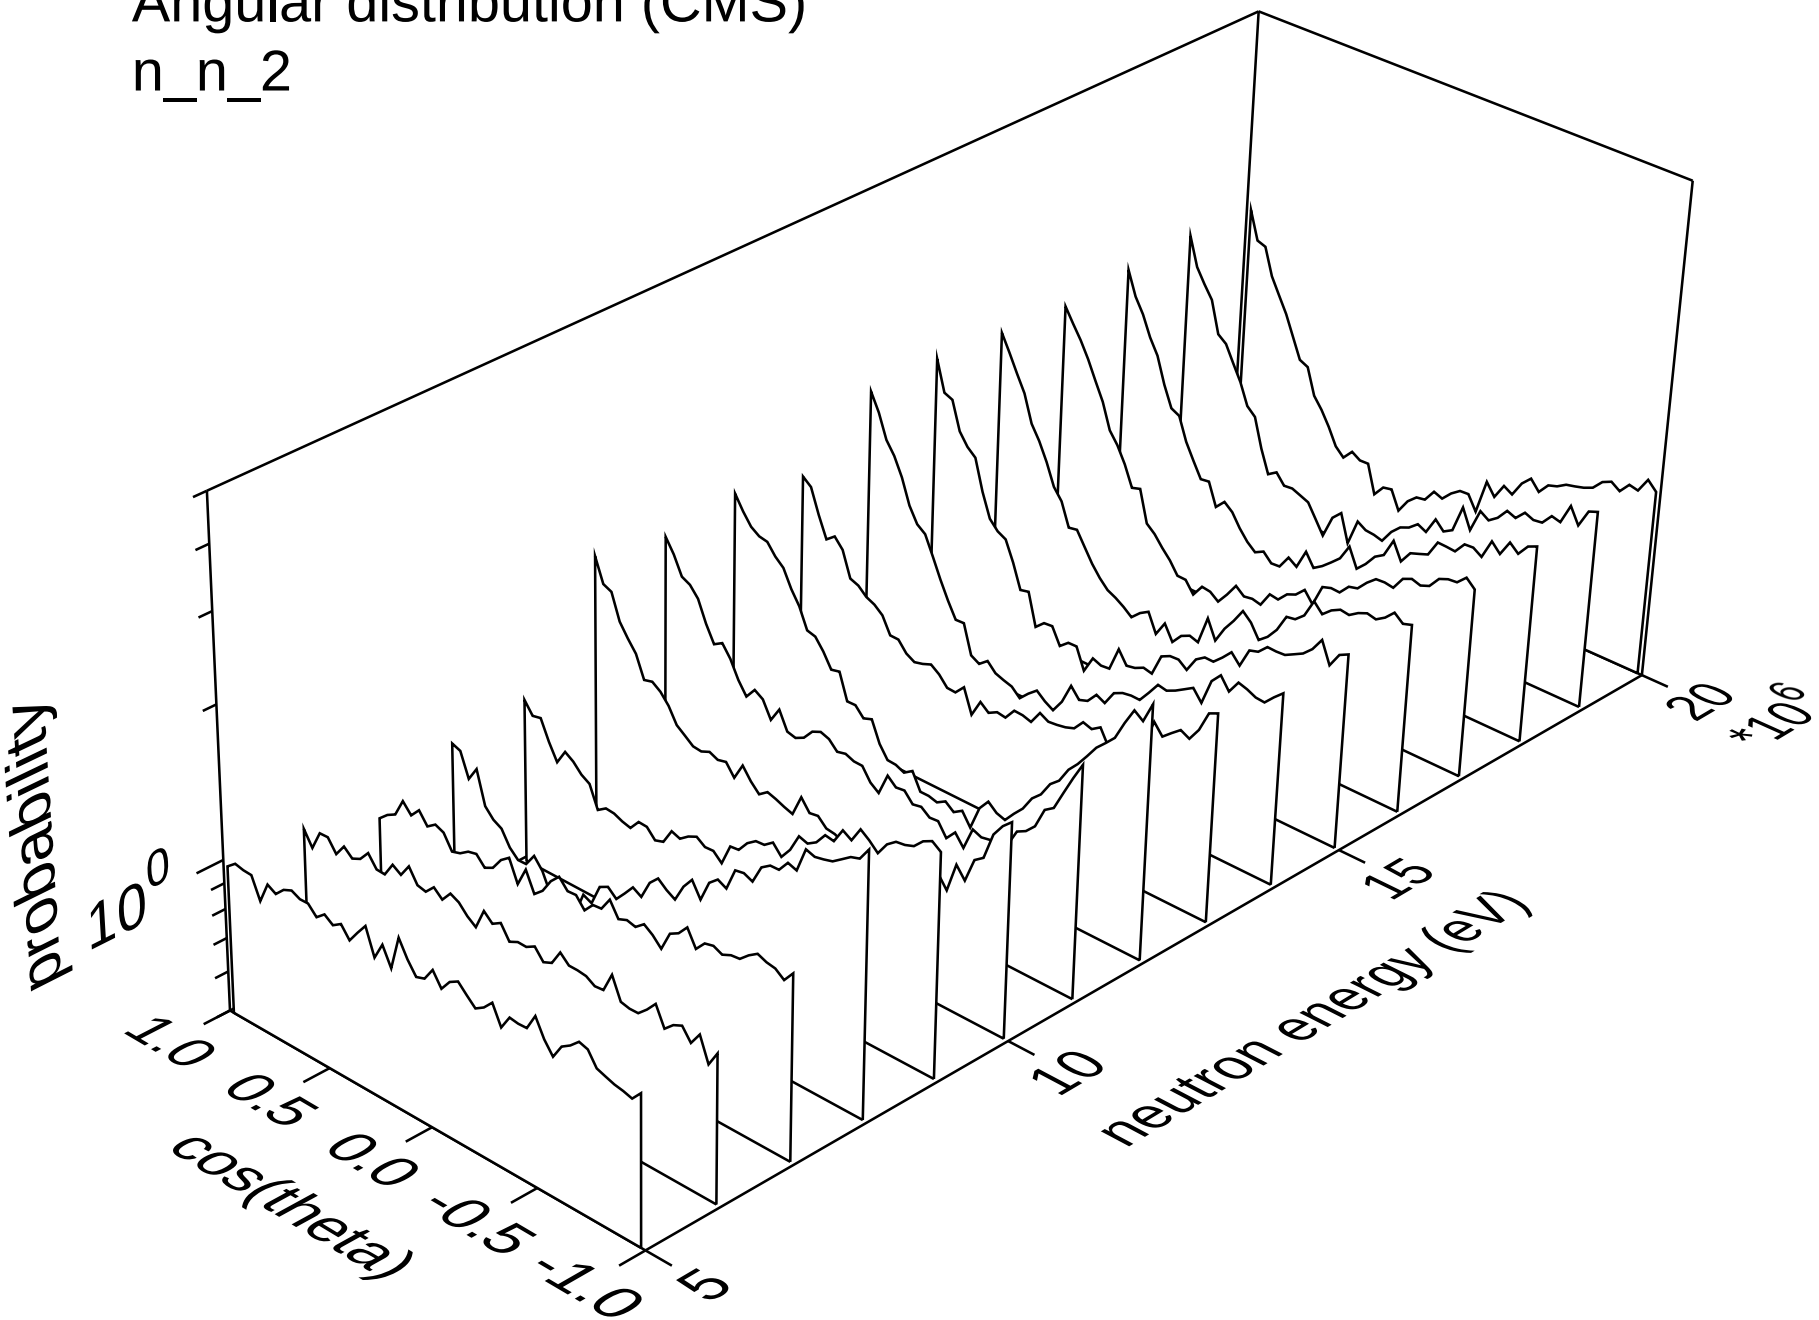
Angular distribution (CMS)
n_n_2
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
5
10
15
20
*10^6
neutron energy (eV)

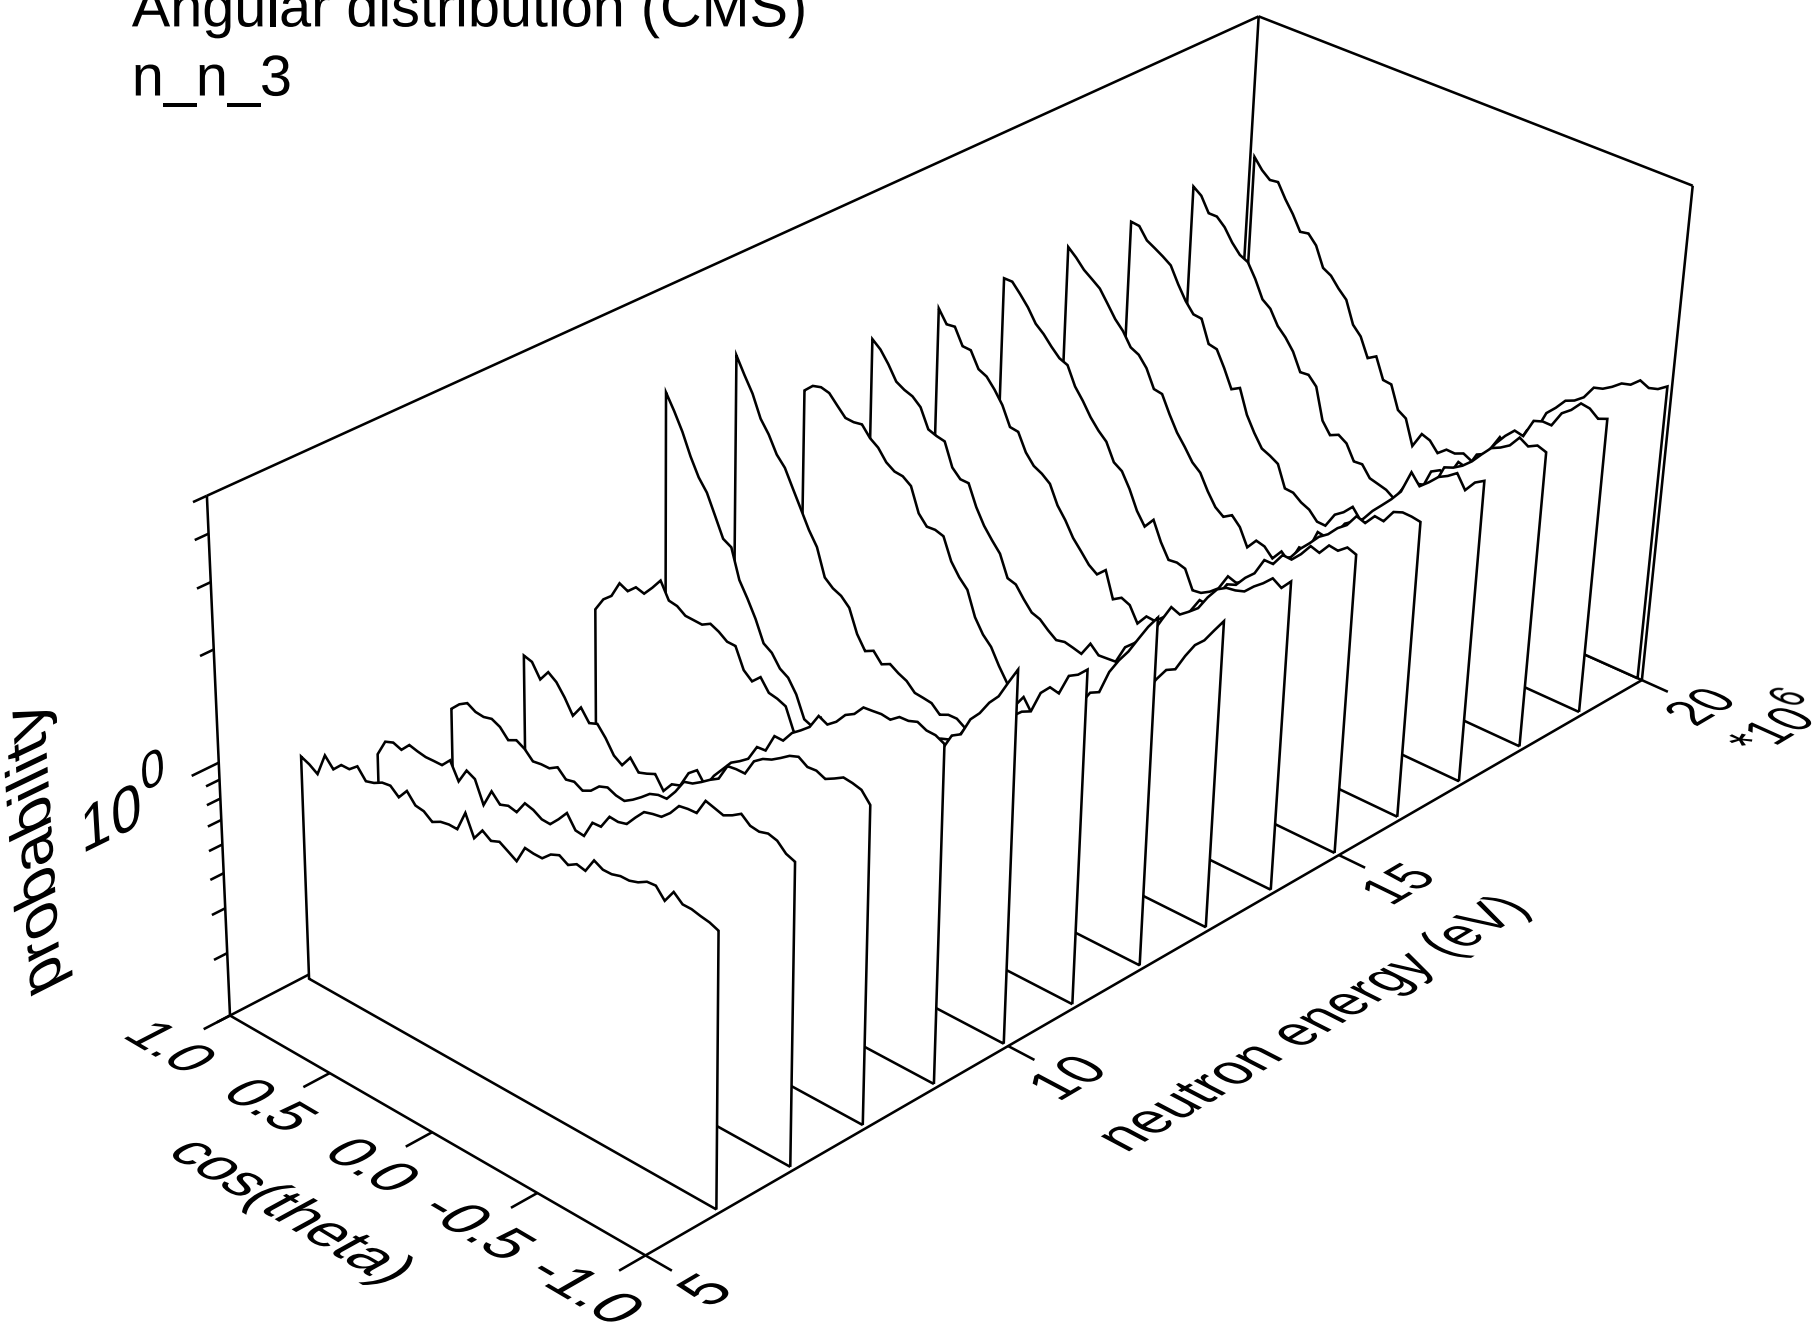
Angular distribution (CMS)
n_n_3
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
5
10
15
20
*10^6
neutron energy (eV)

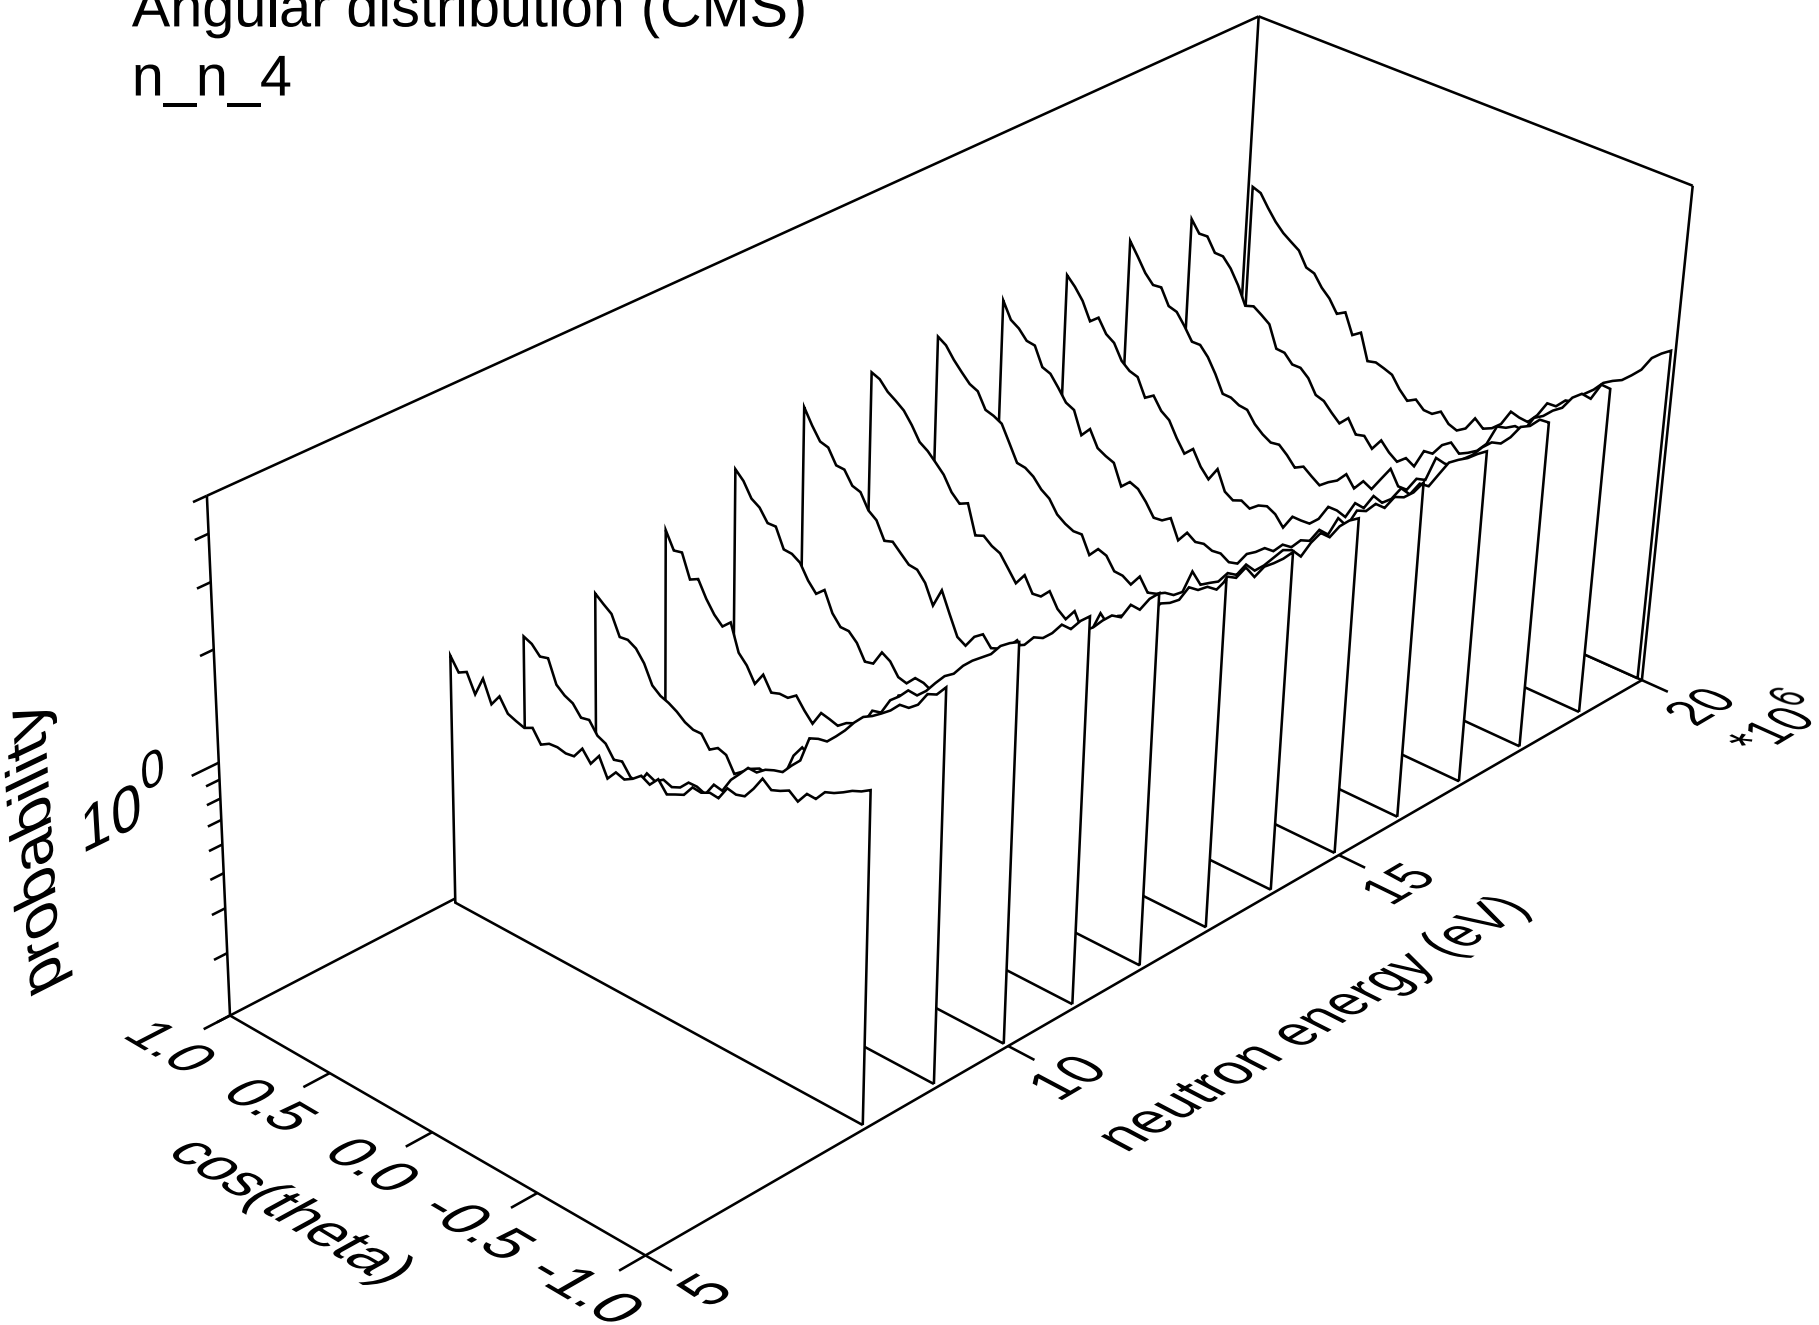
Angular distribution (CMS)
n_n_4
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
5
10
15
20
*10^6
neutron energy (eV)

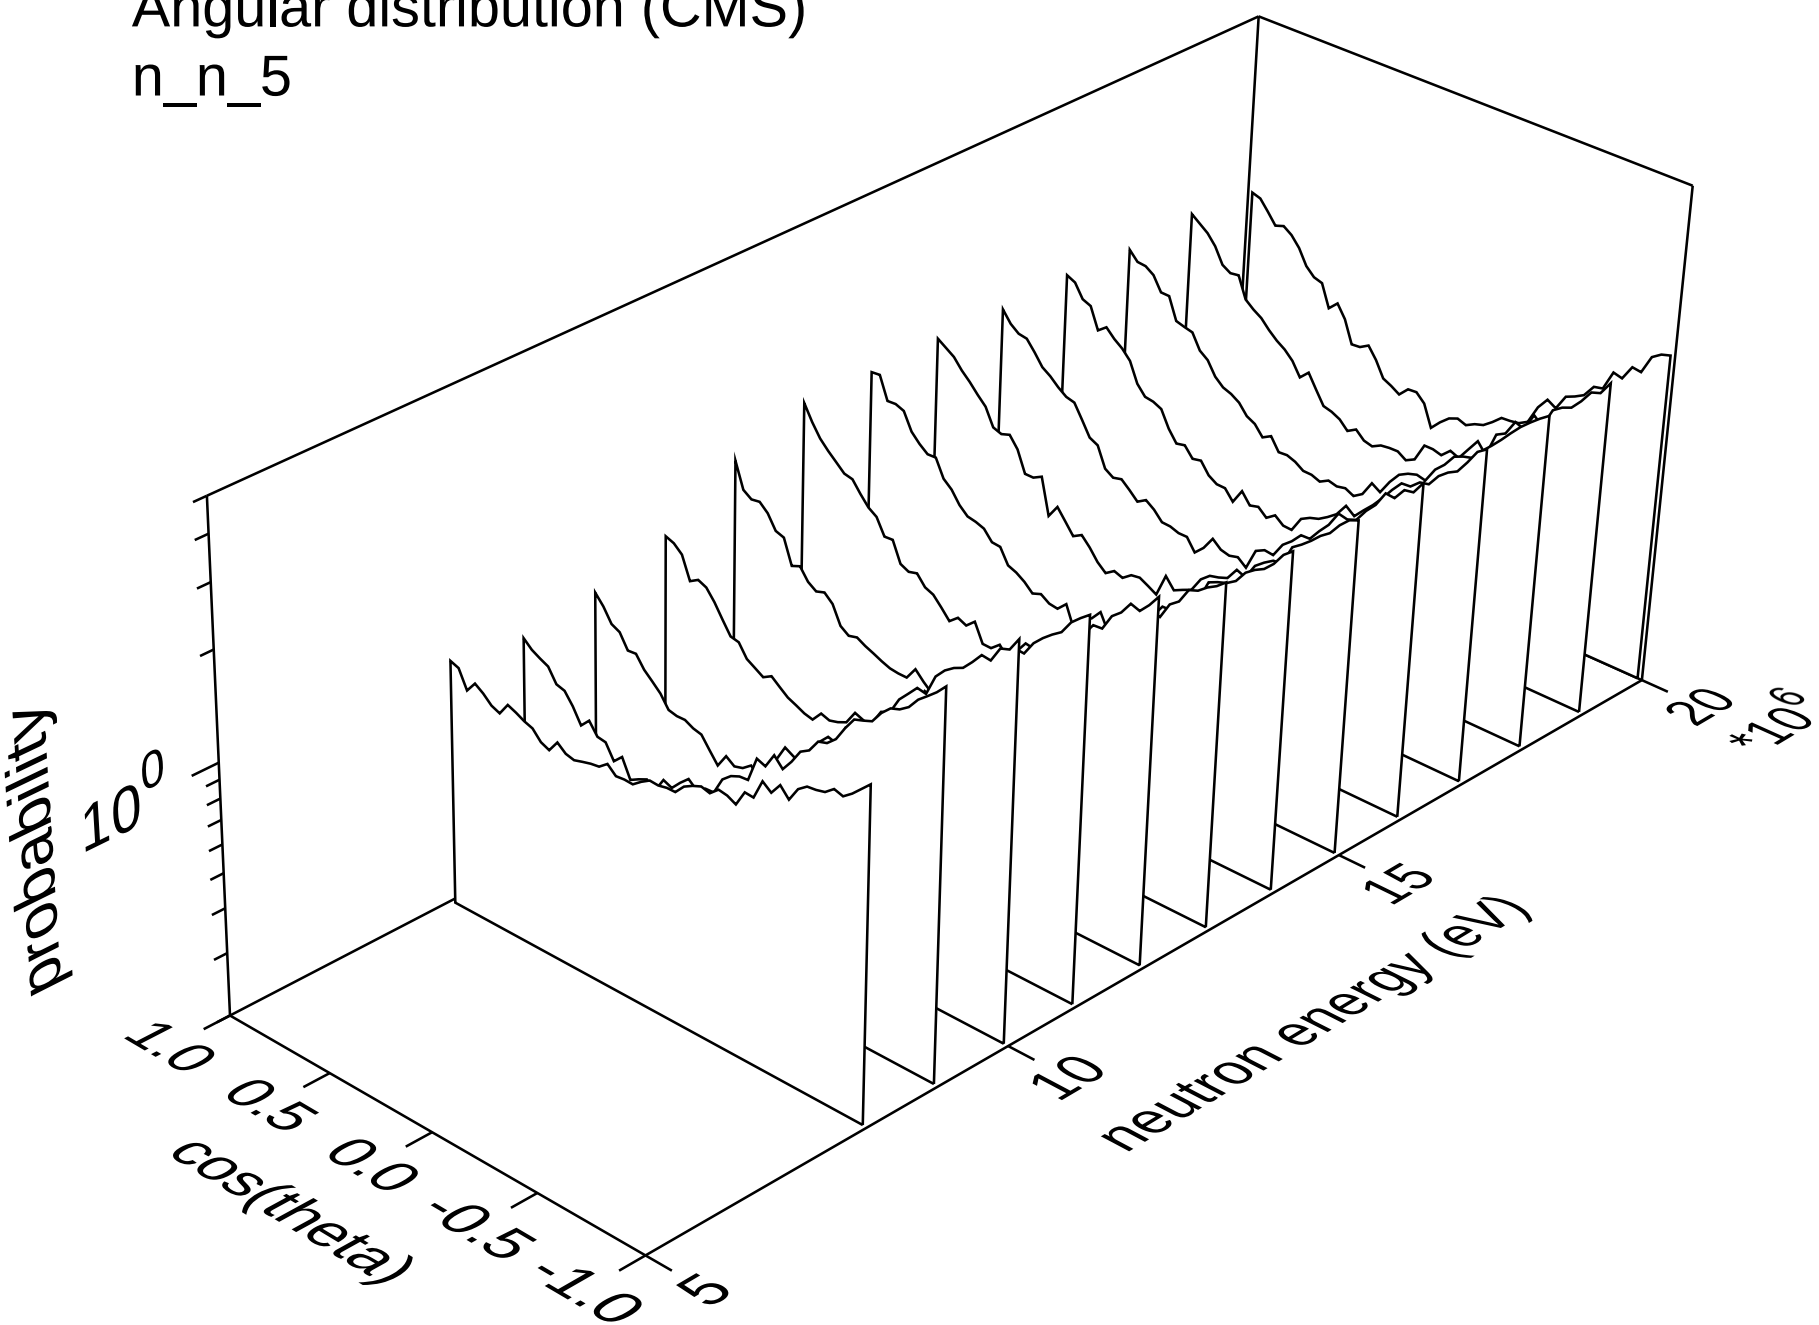
Angular distribution (CMS)
n_n_5
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
5
10
15
20
*10^6
neutron energy (eV)

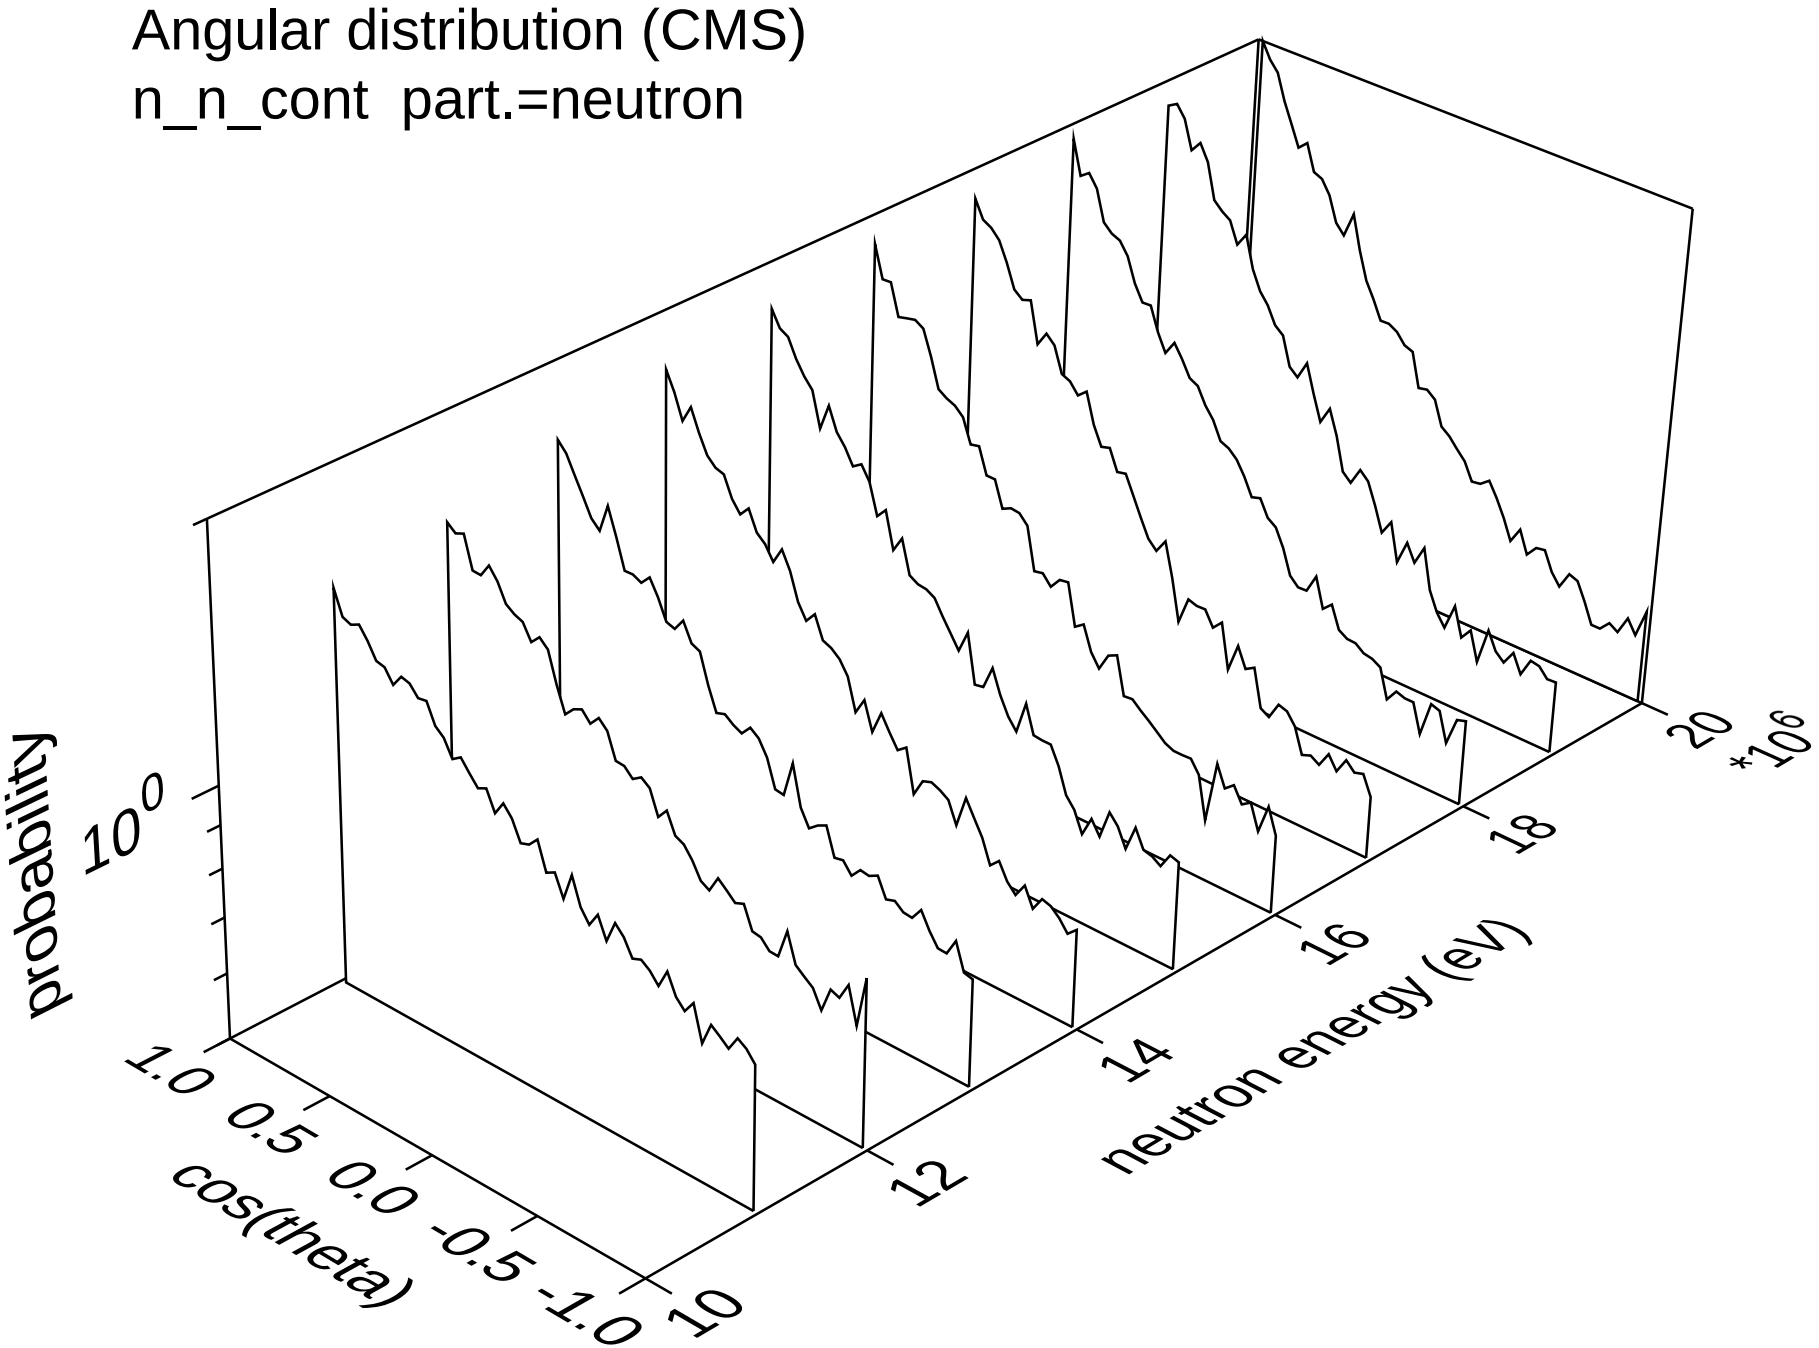
Angular distribution (CMS)
n_n_cont part.=neutron
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
10
12
14
16
18
20
*10^6
neutron energy (eV)

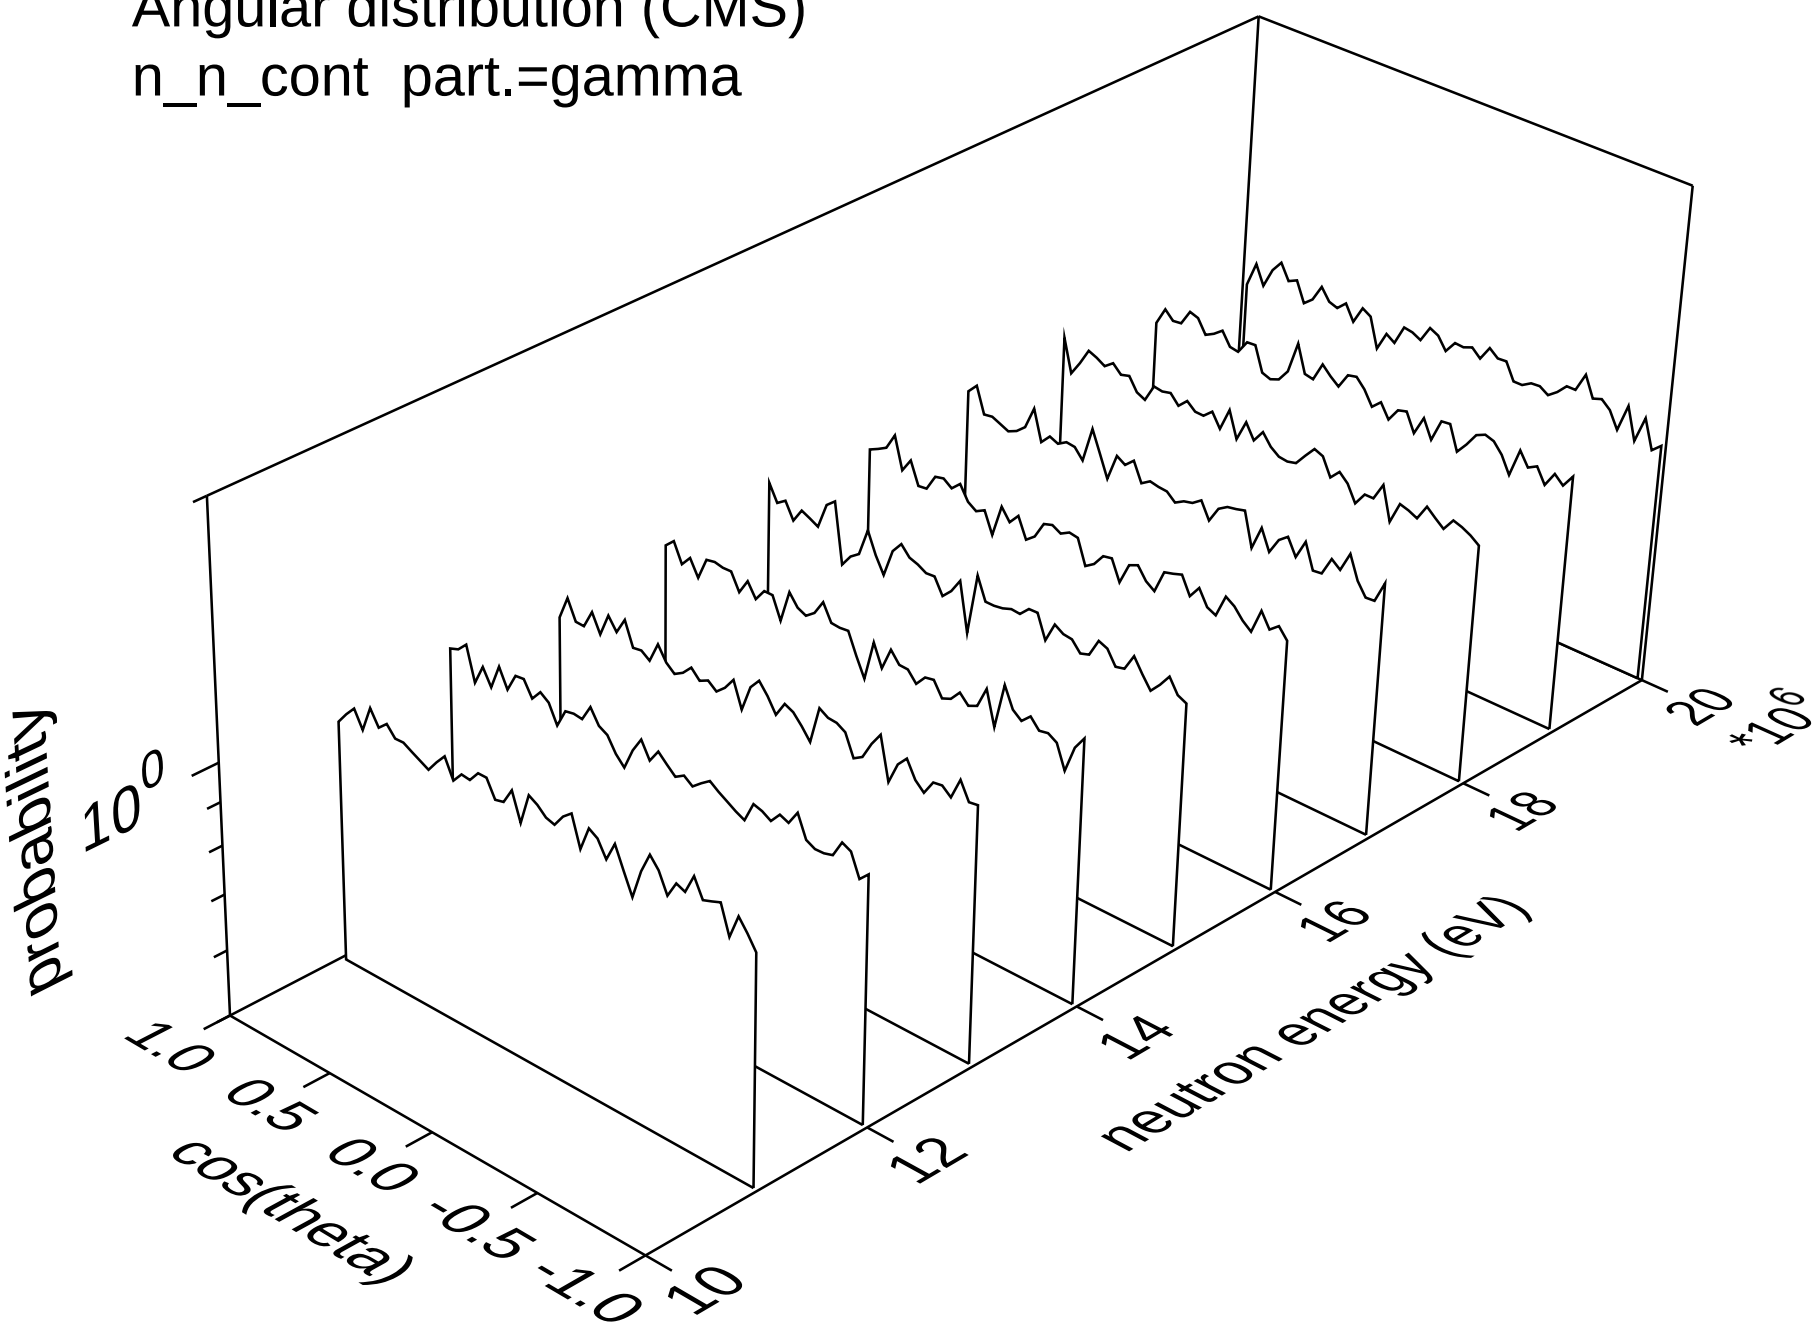
Angular distribution (CMS)
n_n_cont part.=gamma
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
10
12
14
16
18
20
*10^6
neutron energy (eV)

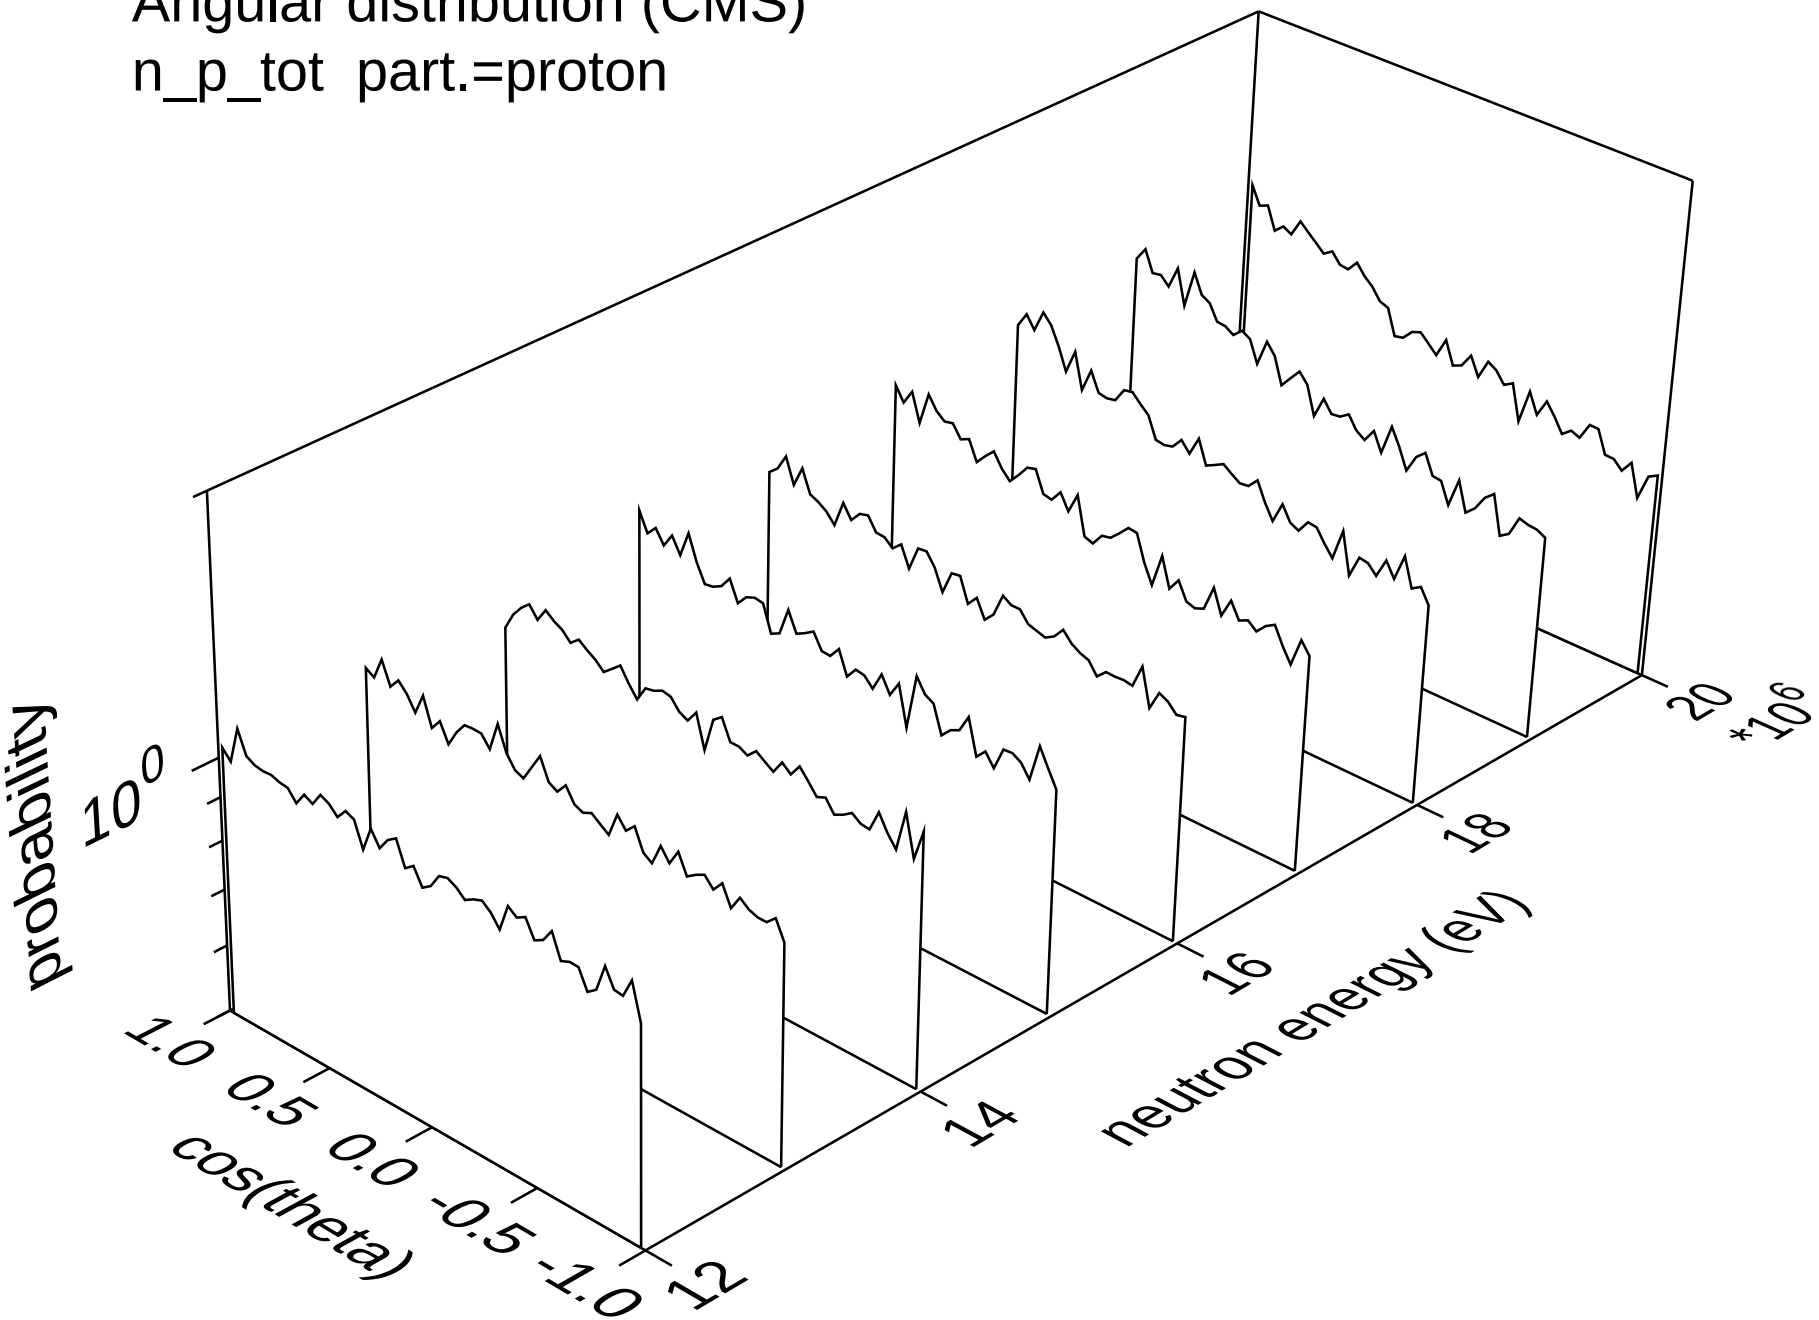
Angular distribution (CMS)
n_p_tot part.=proton
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
12
14
16
18
20
*10^6
neutron energy (eV)

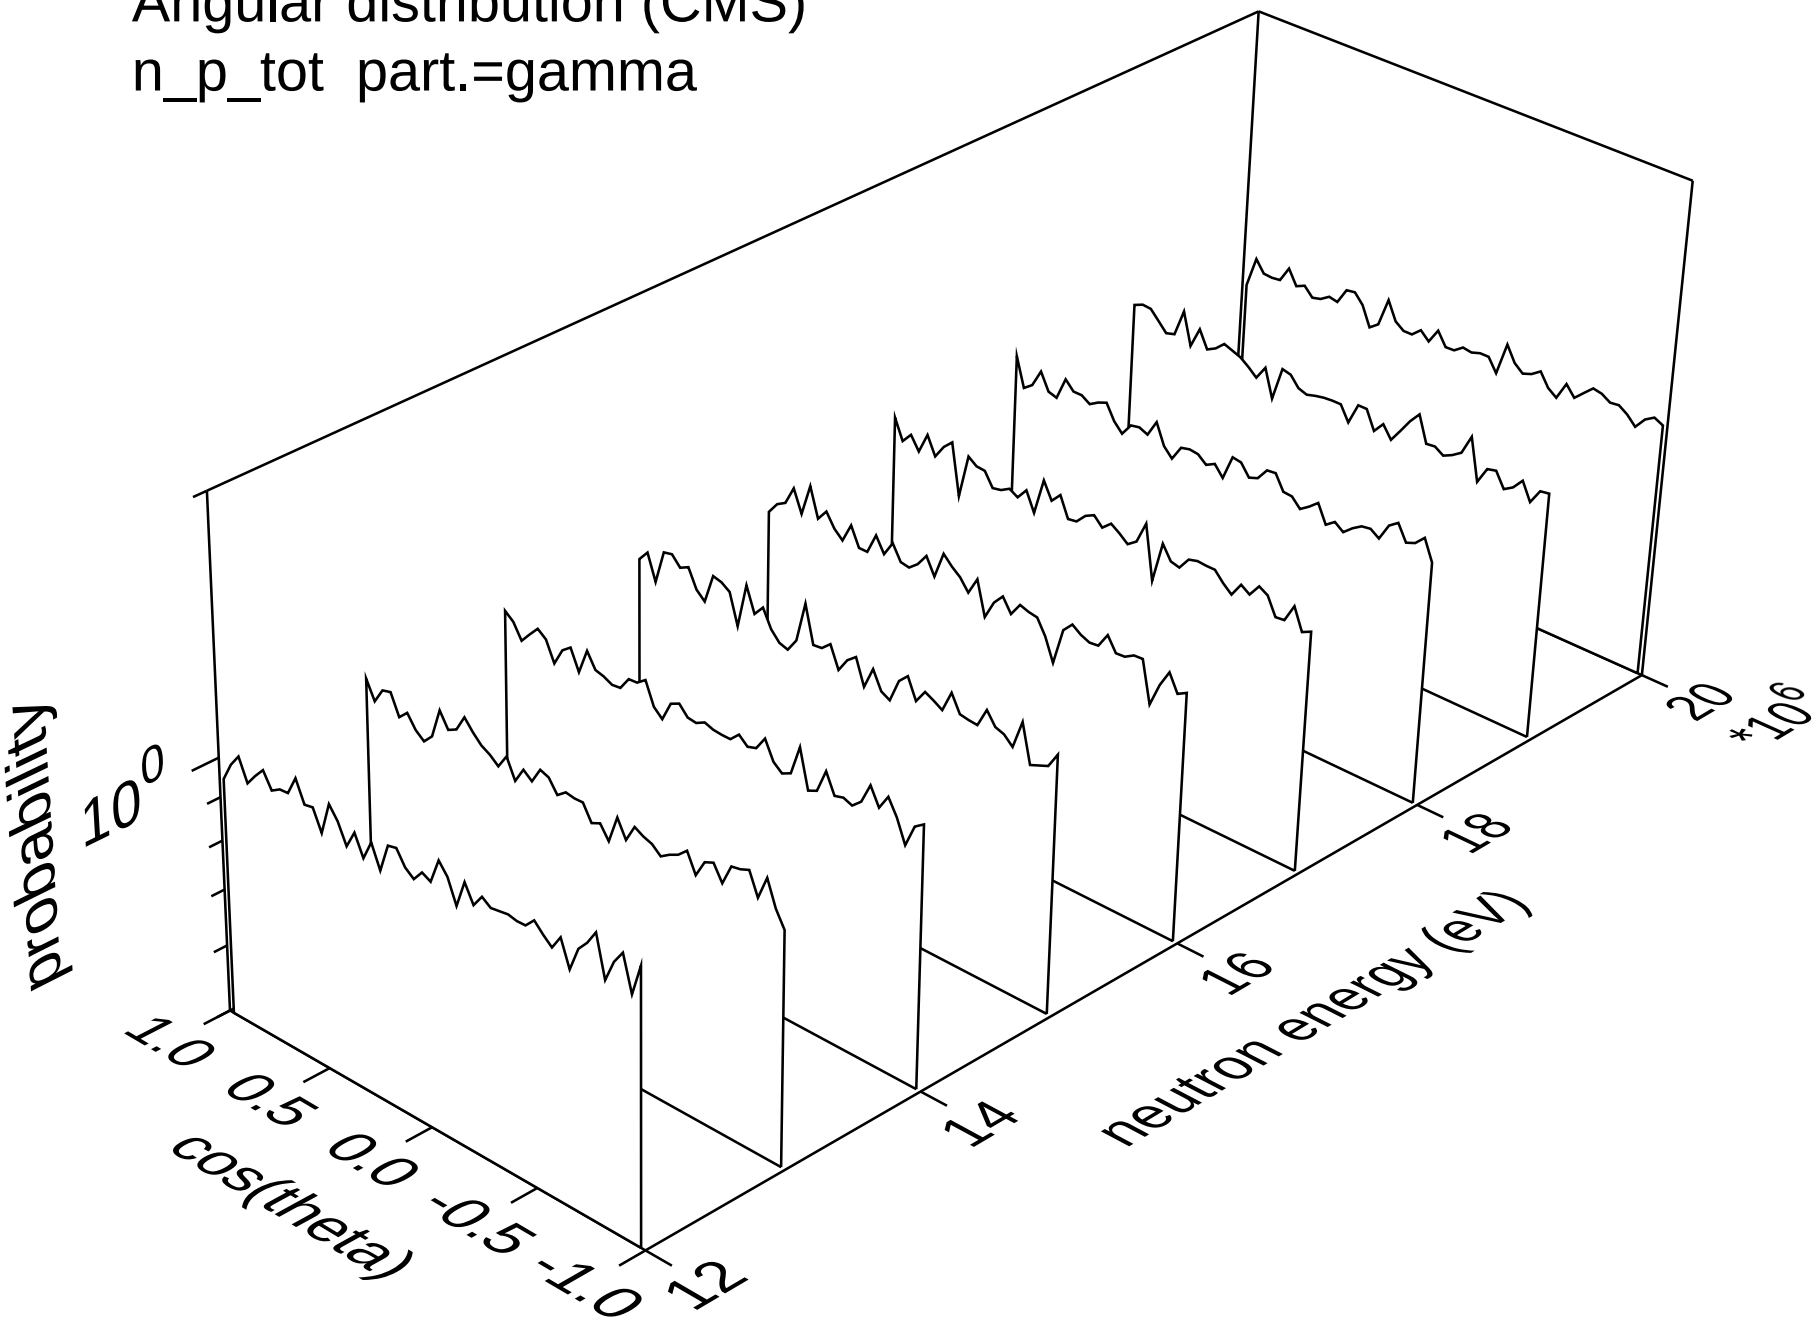
Angular distribution (CMS)
n_p_tot part.=gamma
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
12
14
16
18
20
*10^6
neutron energy (eV)

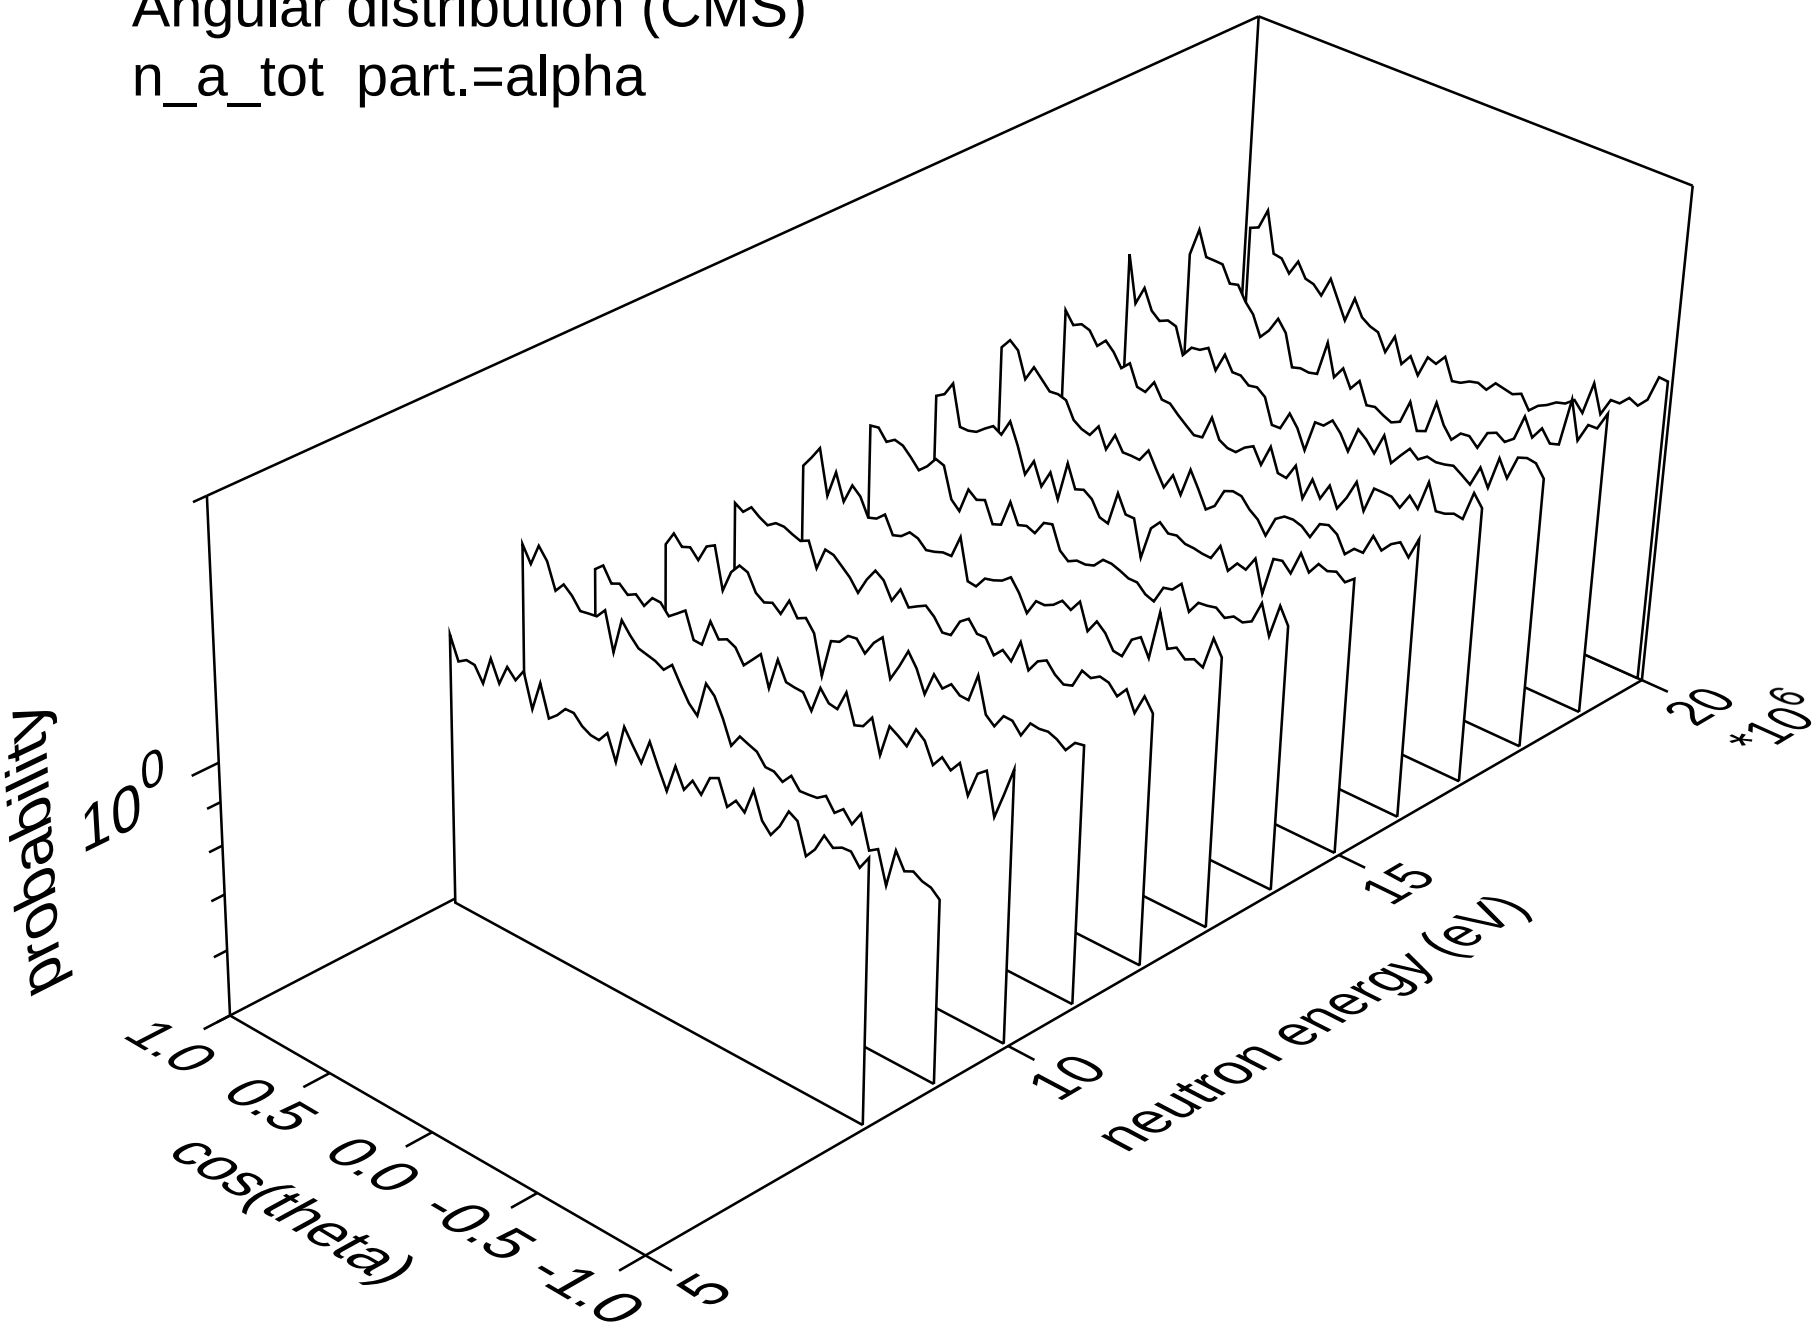
Angular distribution (CMS)
n_a_tot part.=alpha
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
5
10
15
20
*10^6
neutron energy (eV)

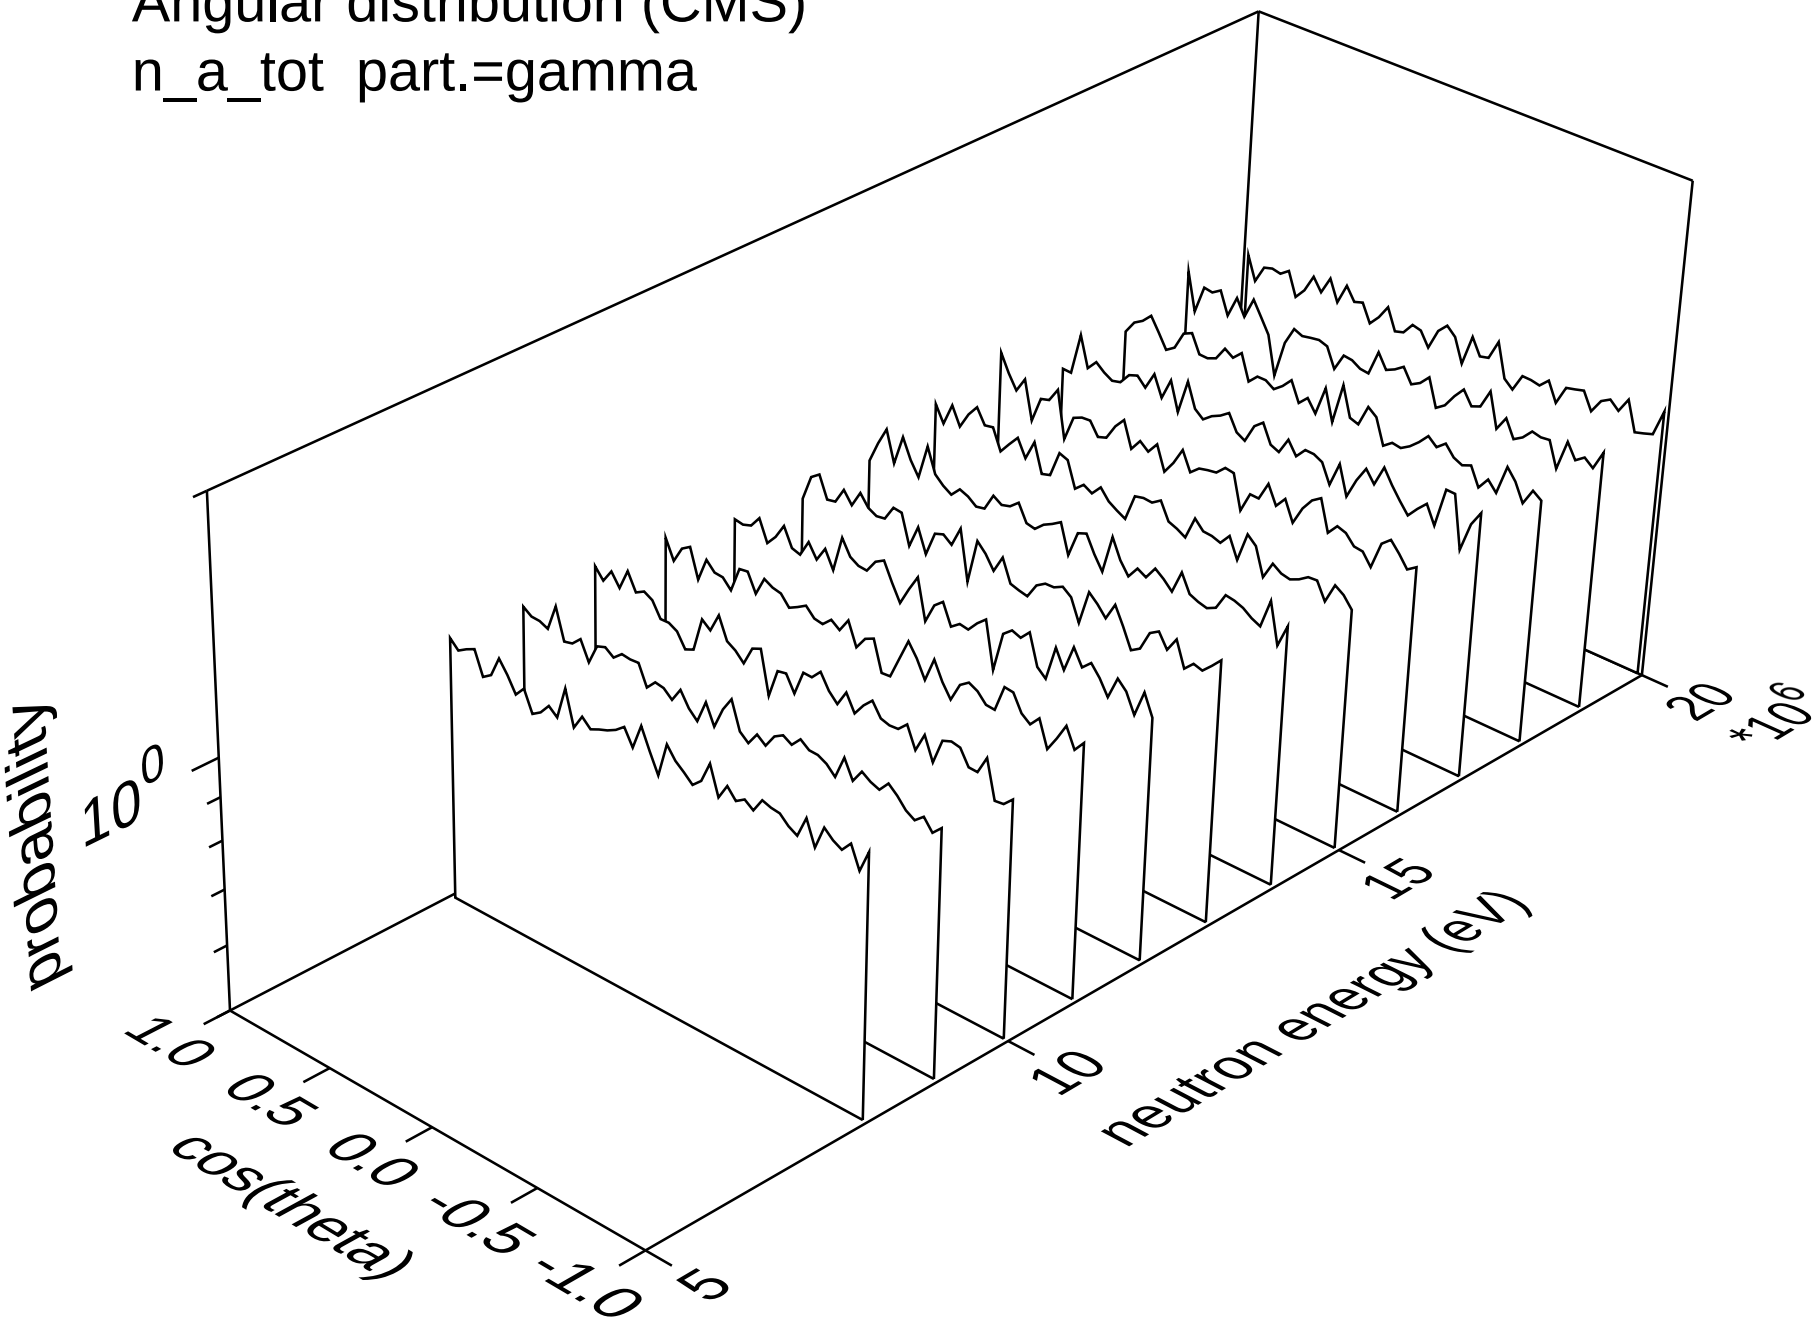
Angular distribution (CMS)
n_a_tot part.=gamma
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
5
10
15
20
*10^6
neutron energy (eV)

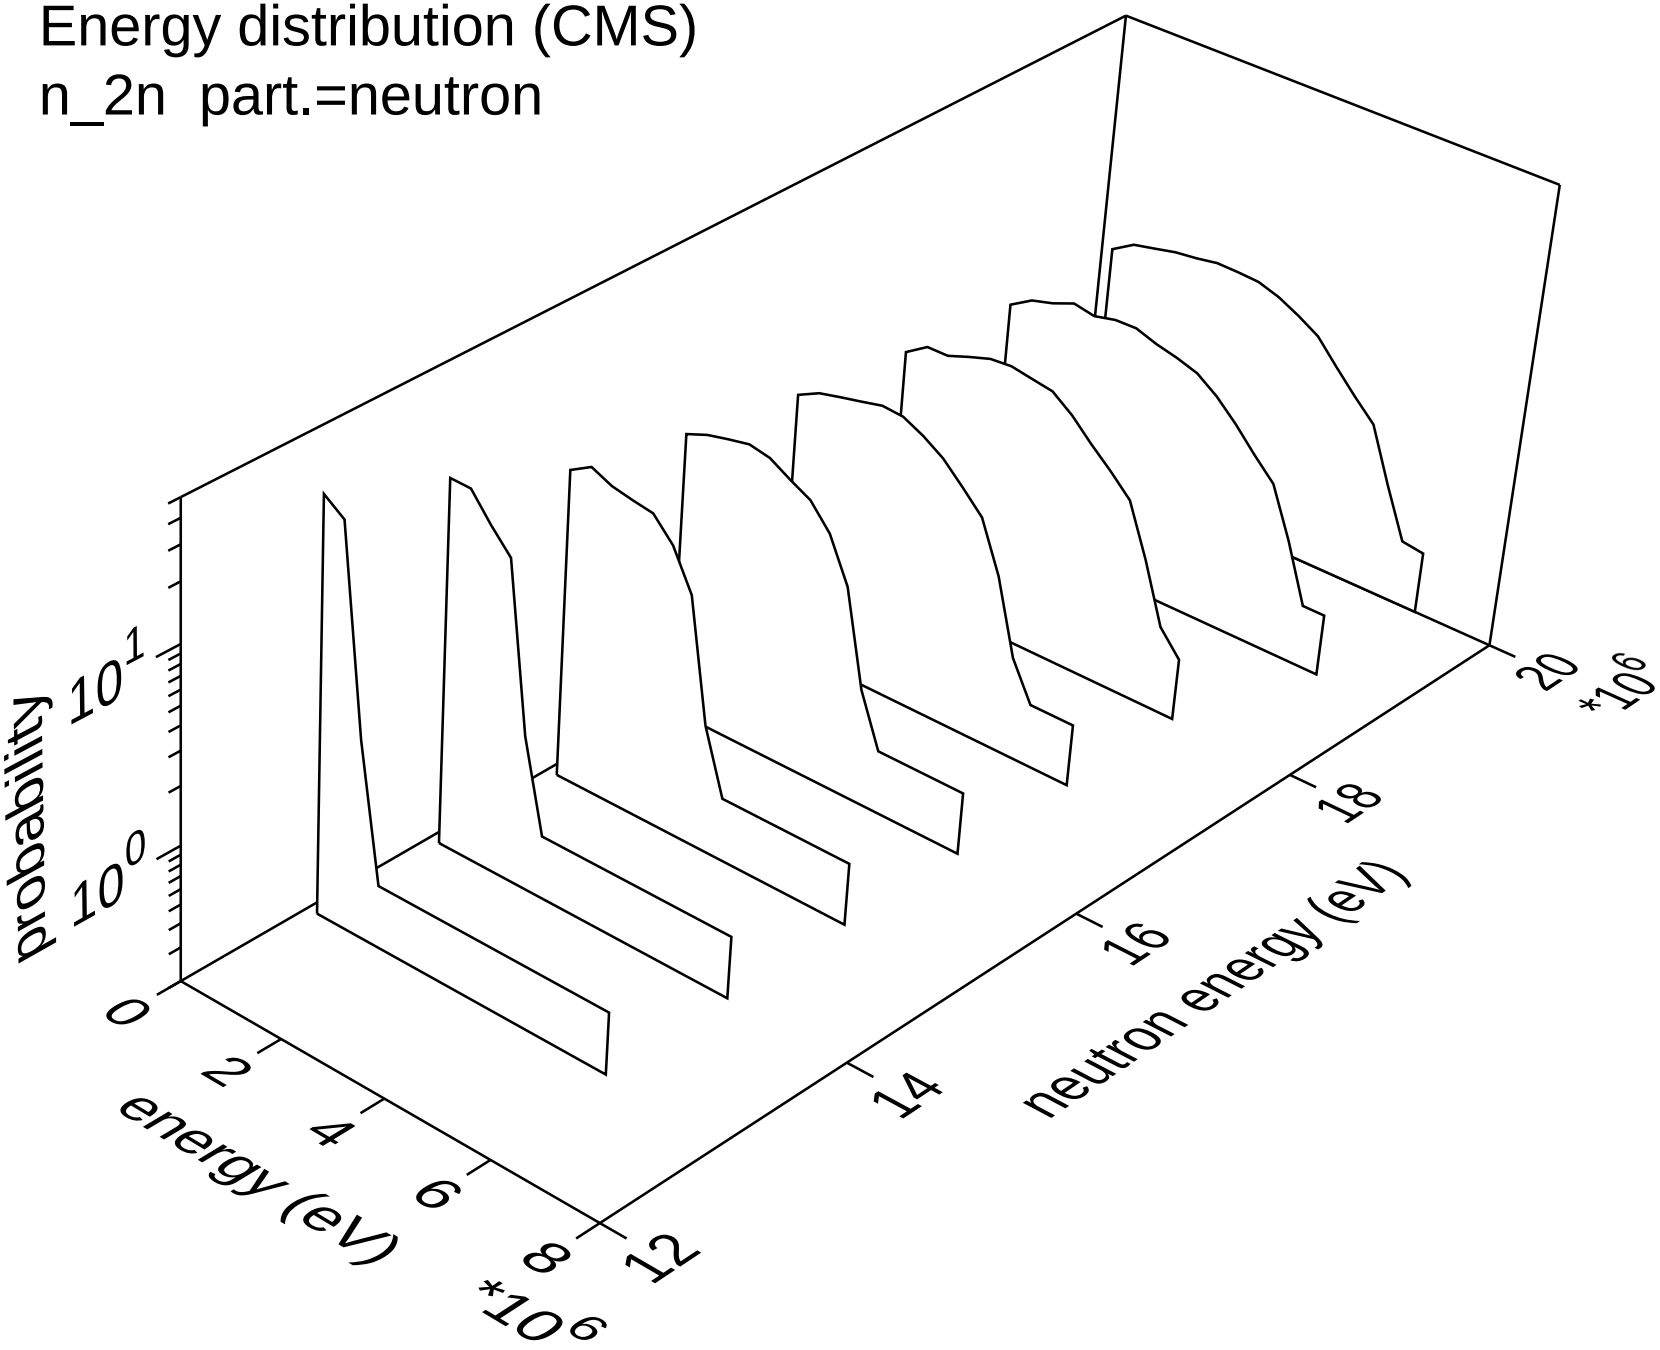
Energy distribution (CMS)
n_2n part.=neutron
probability
10^1
10^0
0
2
4
6
8
*10 6
energy (eV)
12
14
16
18
20
*10^6
neutron energy (eV)

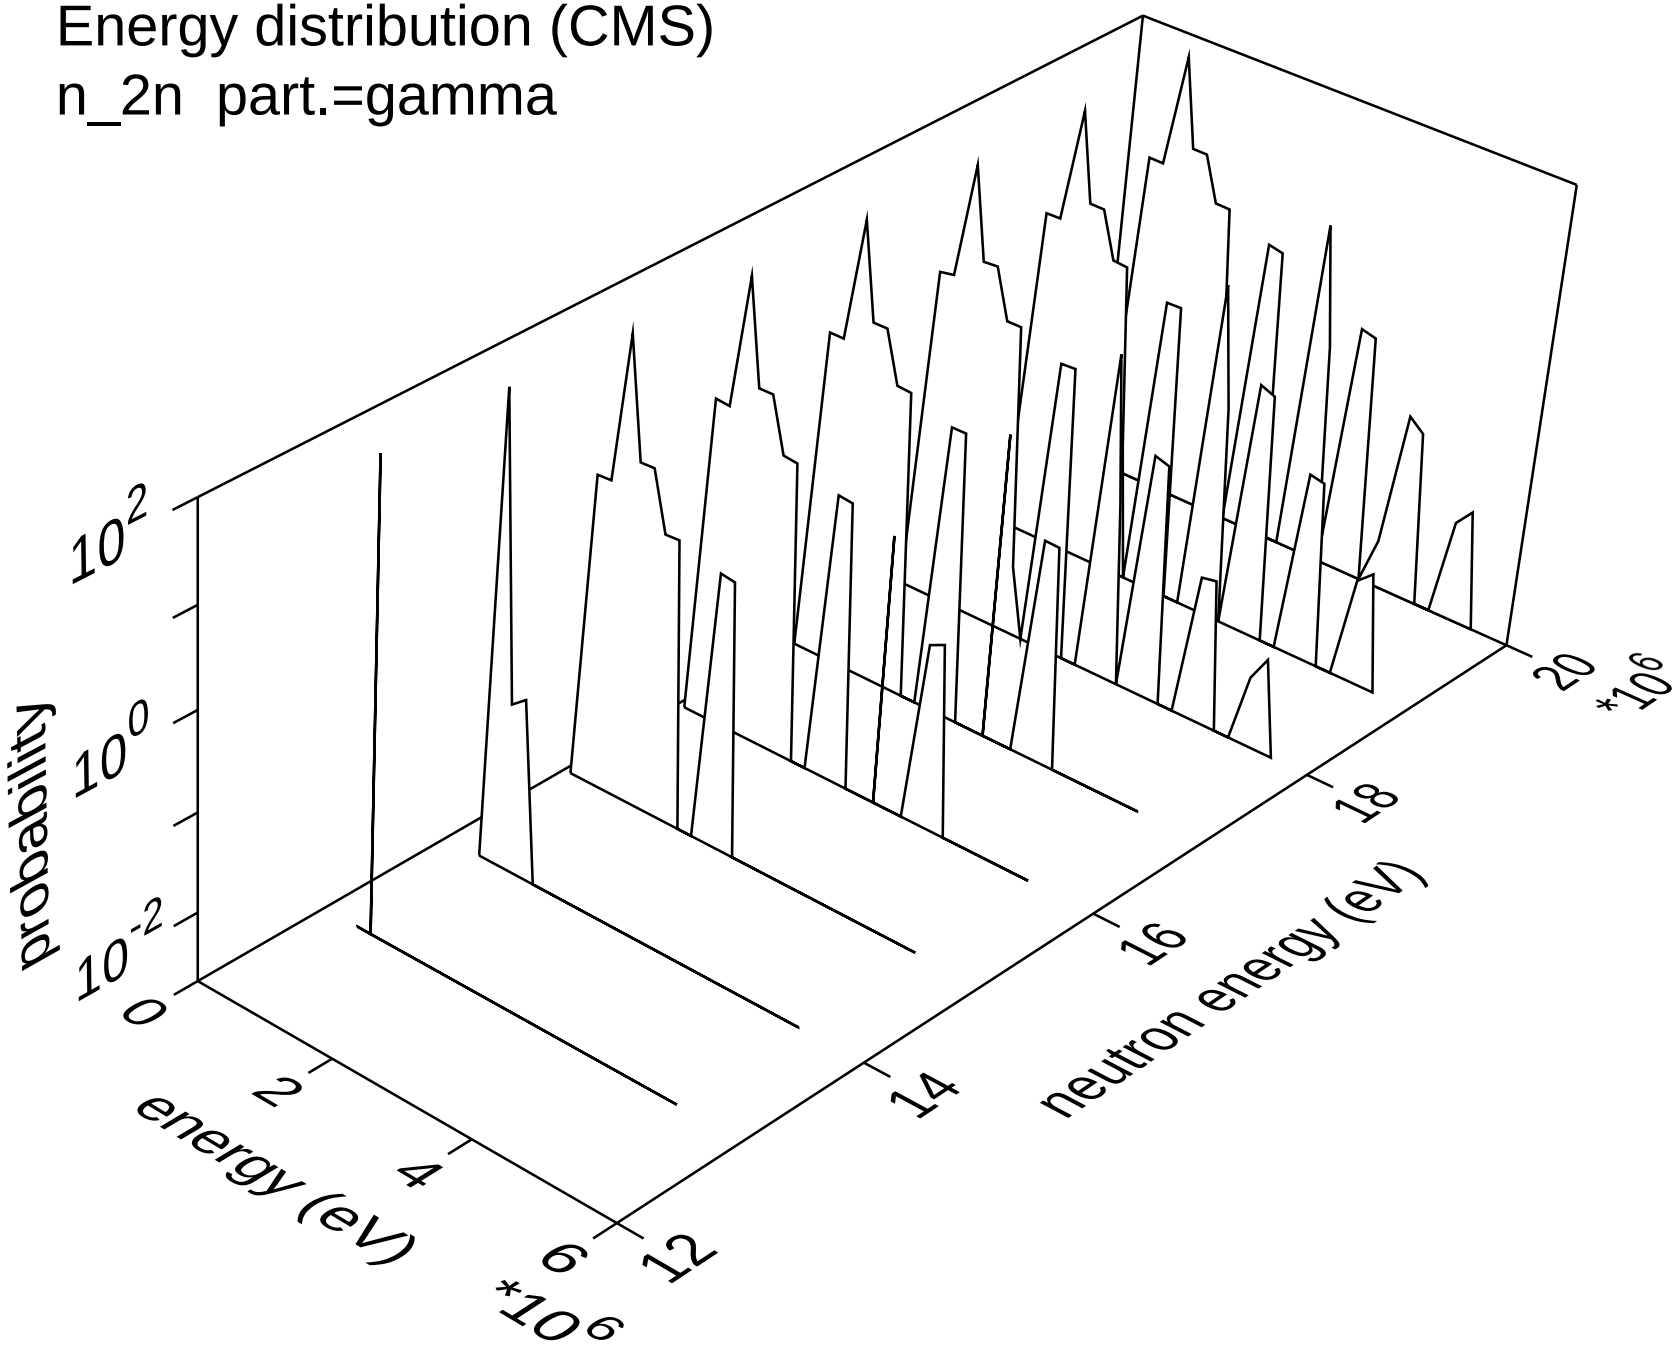
Energy distribution (CMS)
n_2n part.=gamma
probability
10^{2}
10^{0}
10^{-2}
0
2
4
6
*10^6
energy (eV)
12
14
16
18
20
*10^6
neutron energy (eV)

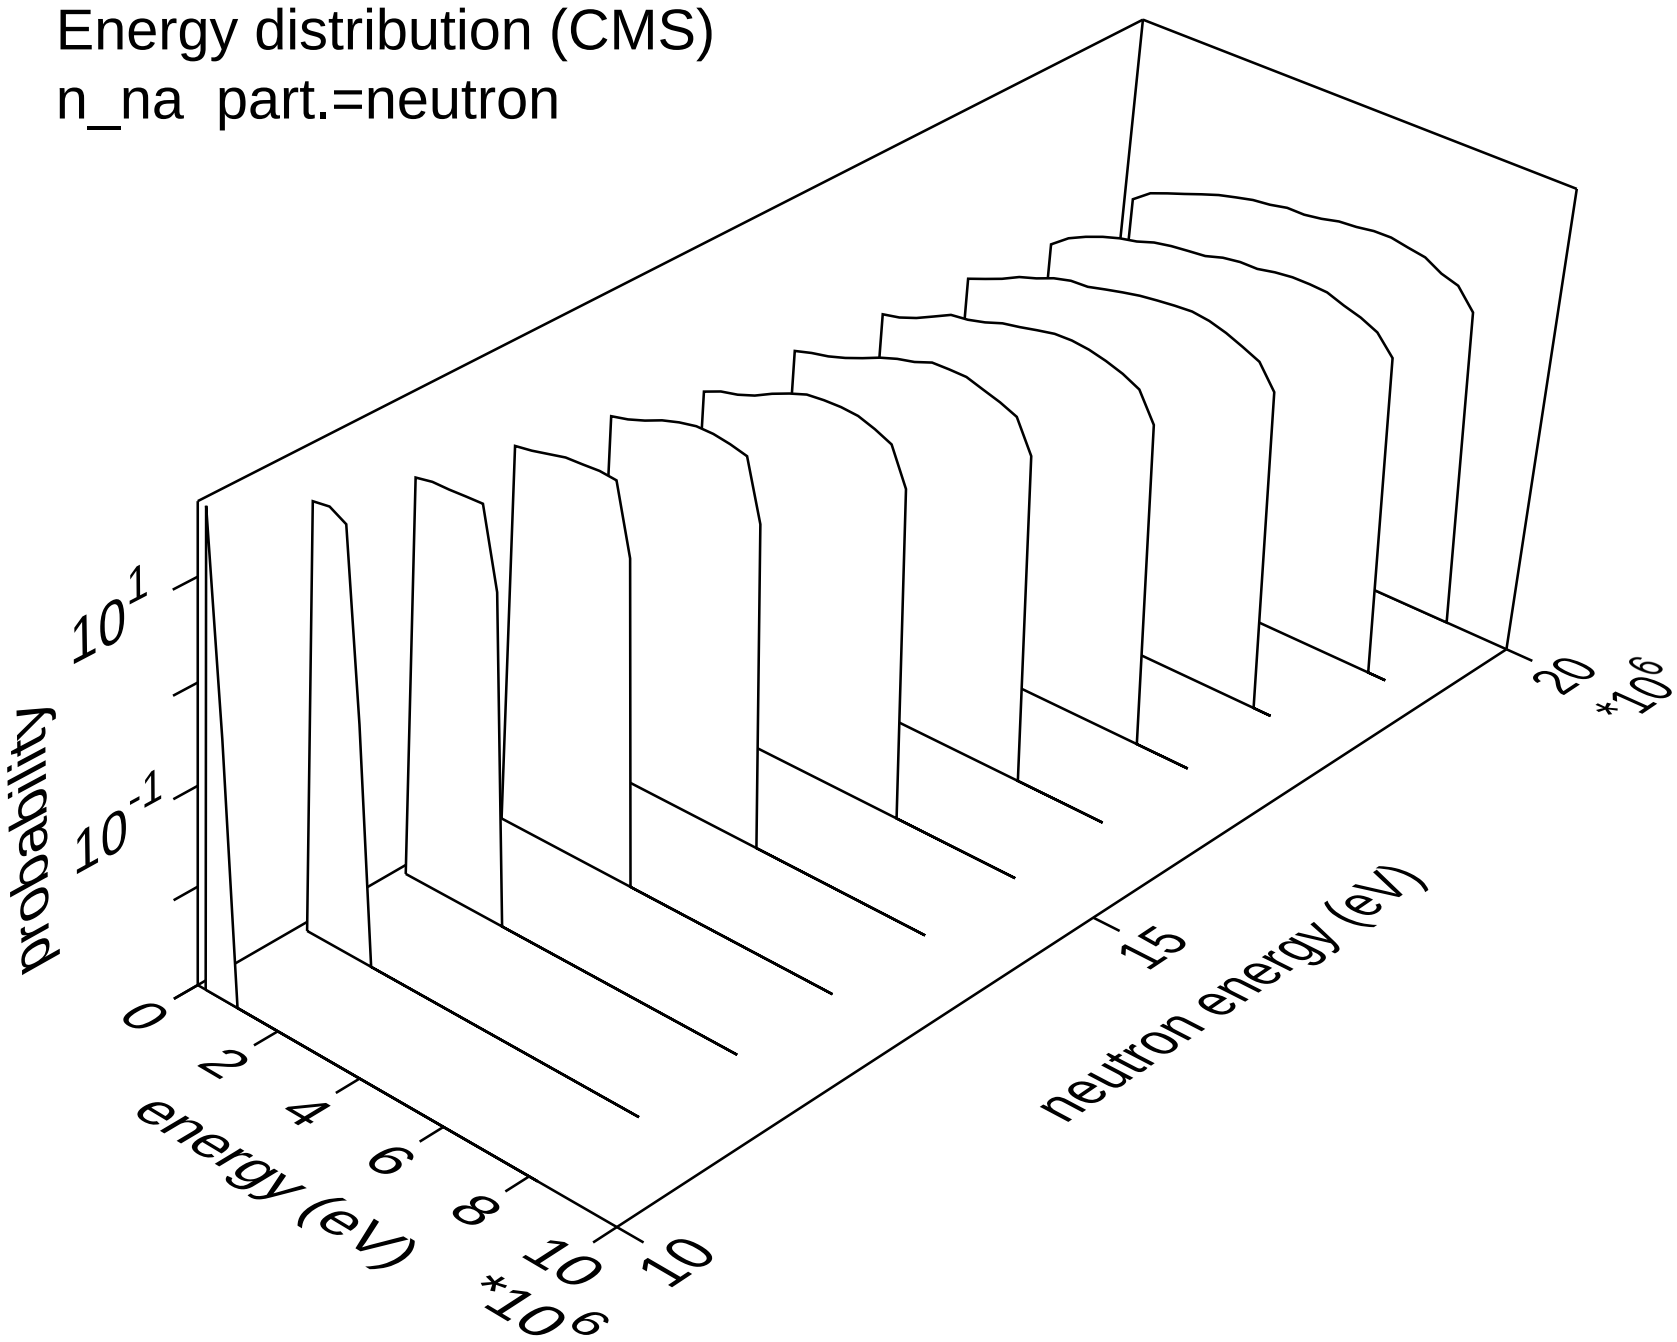
Energy distribution (CMS)
n_na part.=neutron
probability
10^{1}
10^{-1}
0
2
4
6
8
10
*10^6
energy (eV)
10
15
20
*10^6
neutron energy (eV)

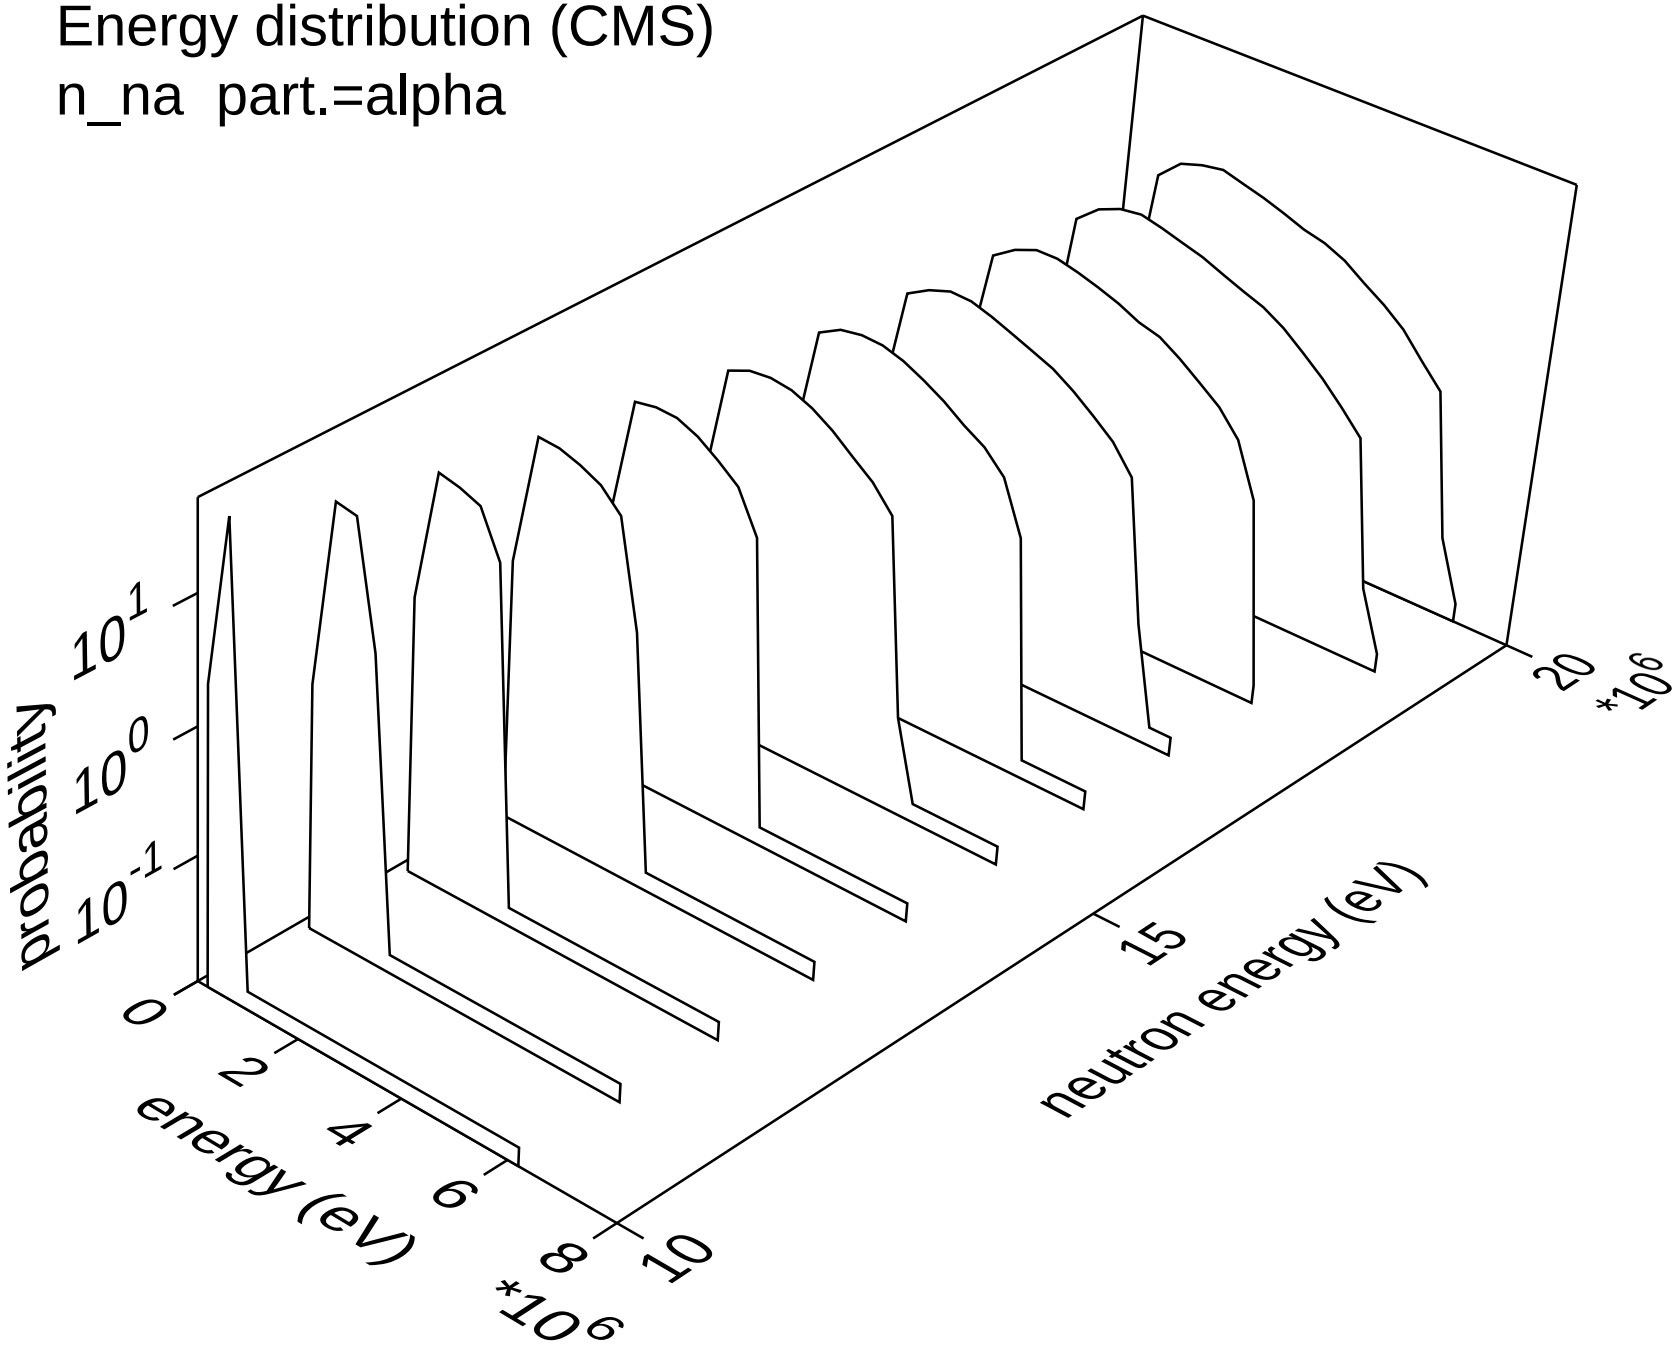
Energy distribution (CMS)
n_na part.=alpha
probability
10^{1}
10^{0}
10^{-1}
0
2
4
6
8
10
*10 6
energy (eV)
15
20
*10^6
neutron energy (eV)

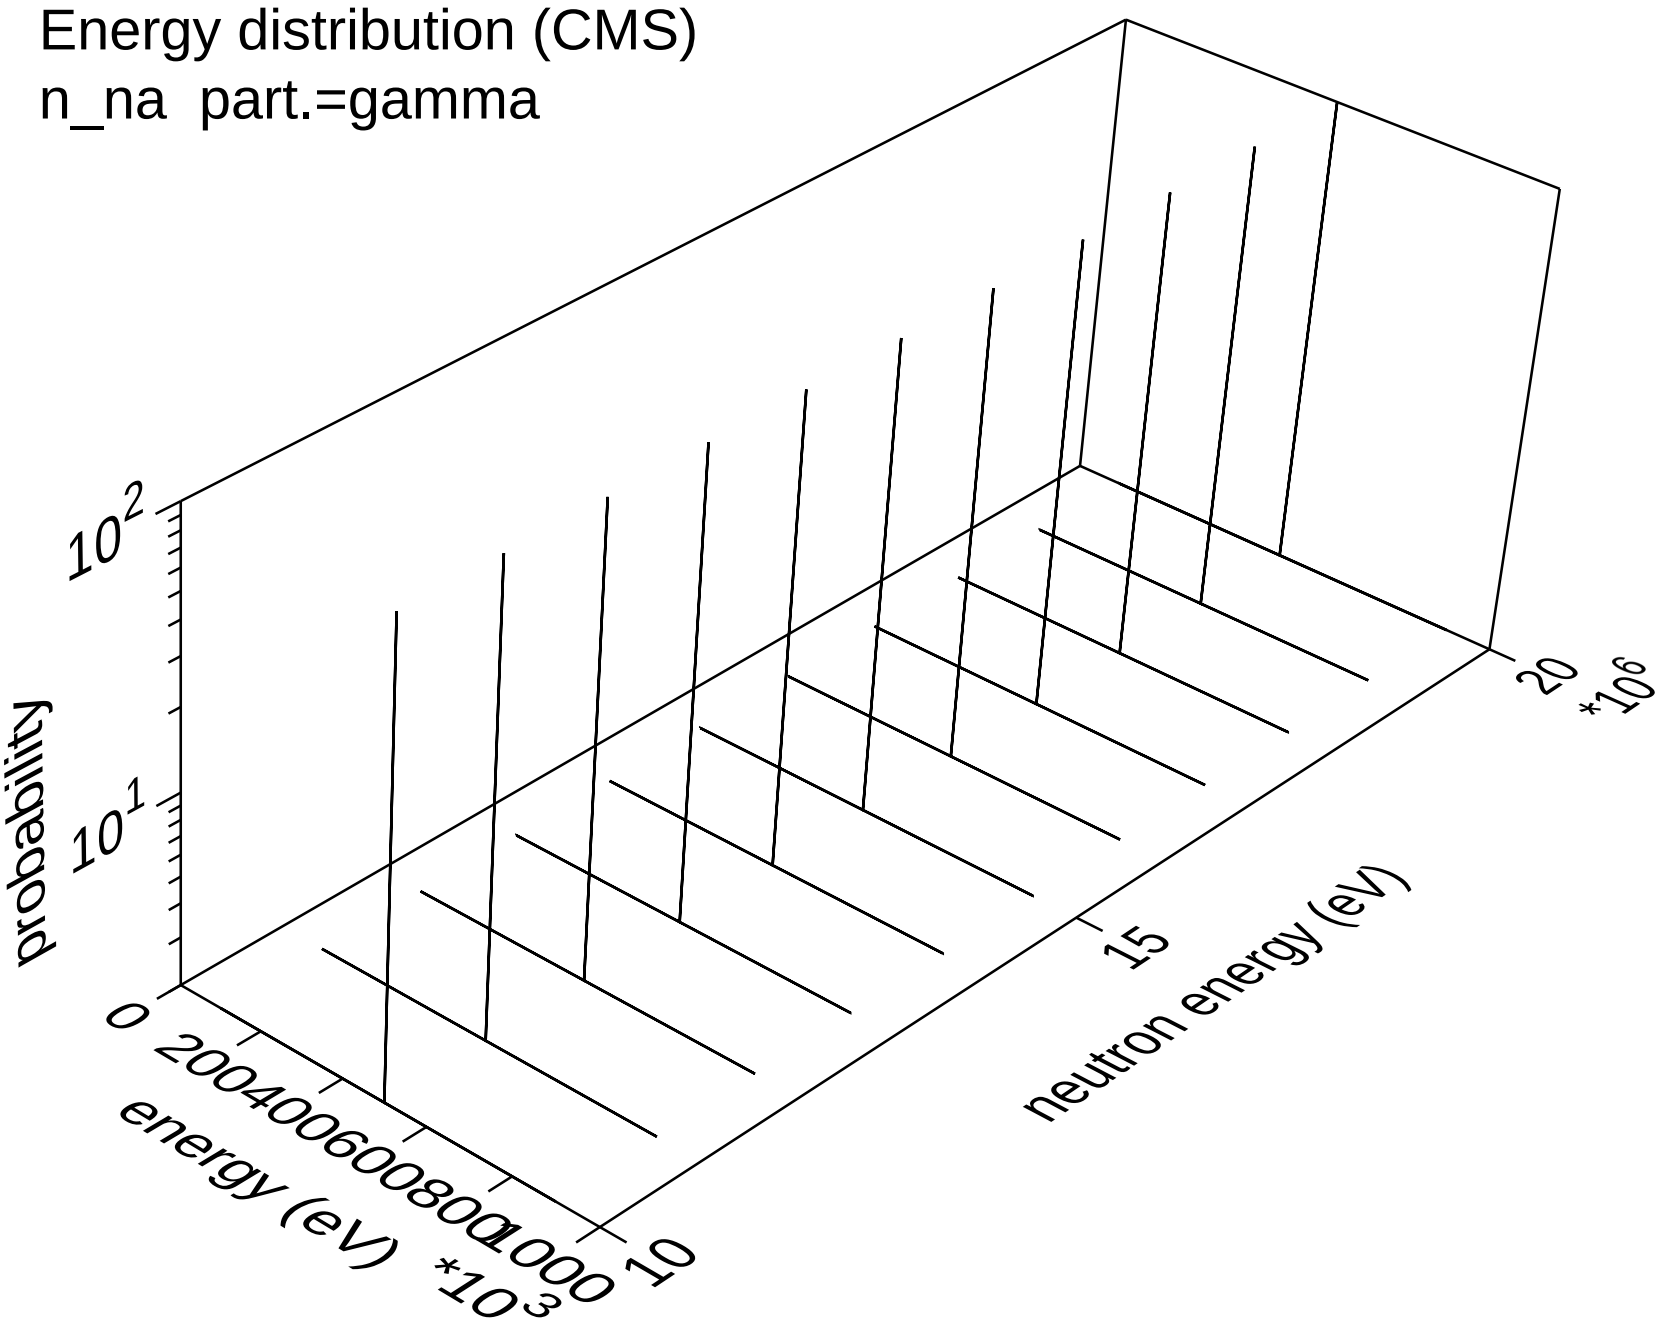
Energy distribution (CMS)
n_na part.=gamma
probability
10^2
10^1
0
200
400
600
800
1000
energy (eV) *10^3
10
15
20
neutron energy (eV) *10^6

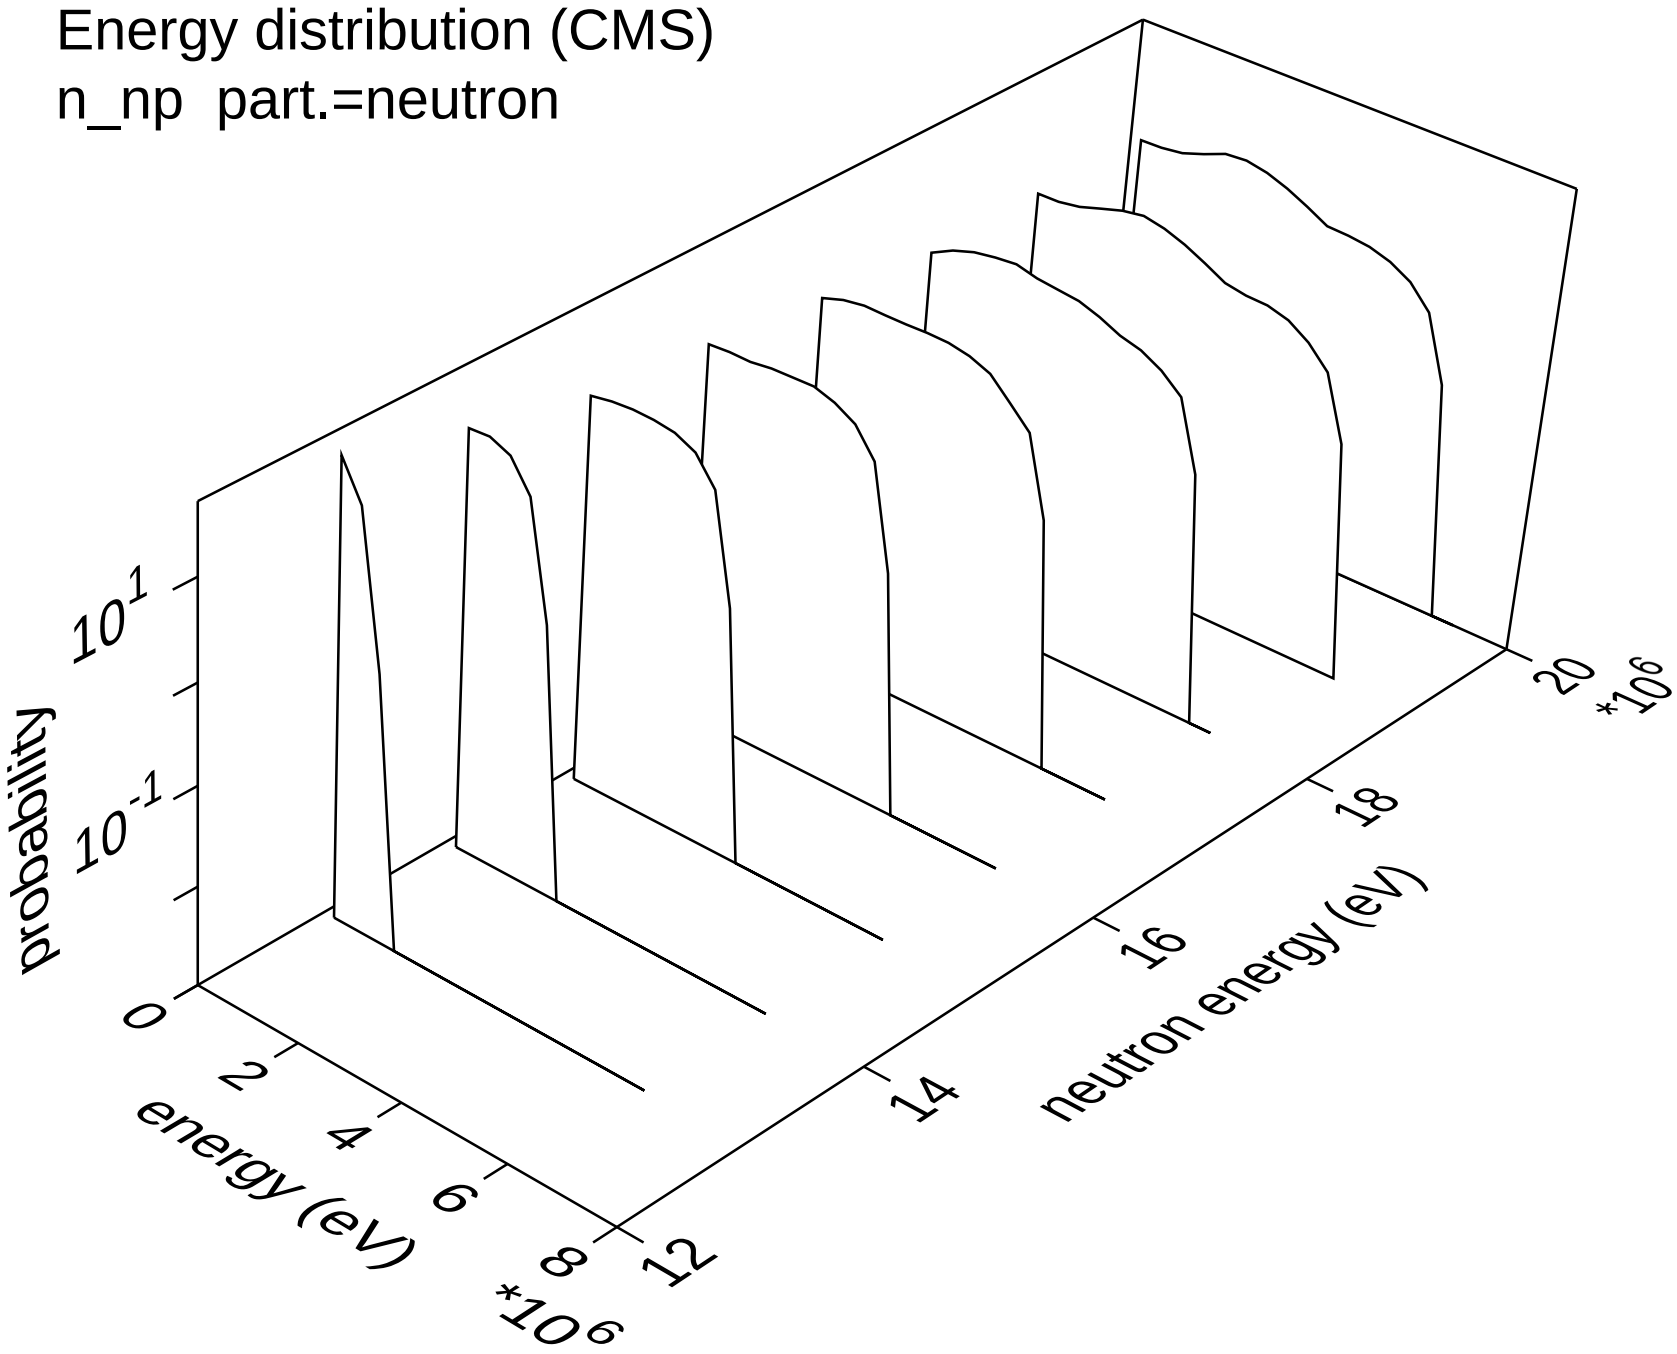
Energy distribution (CMS)
n_np part.=neutron
probability
10^{1}
10^{-1}
0
2
4
6
8
*10 6
energy (eV)
12
14
16
18
20
*10^6
neutron energy (eV)

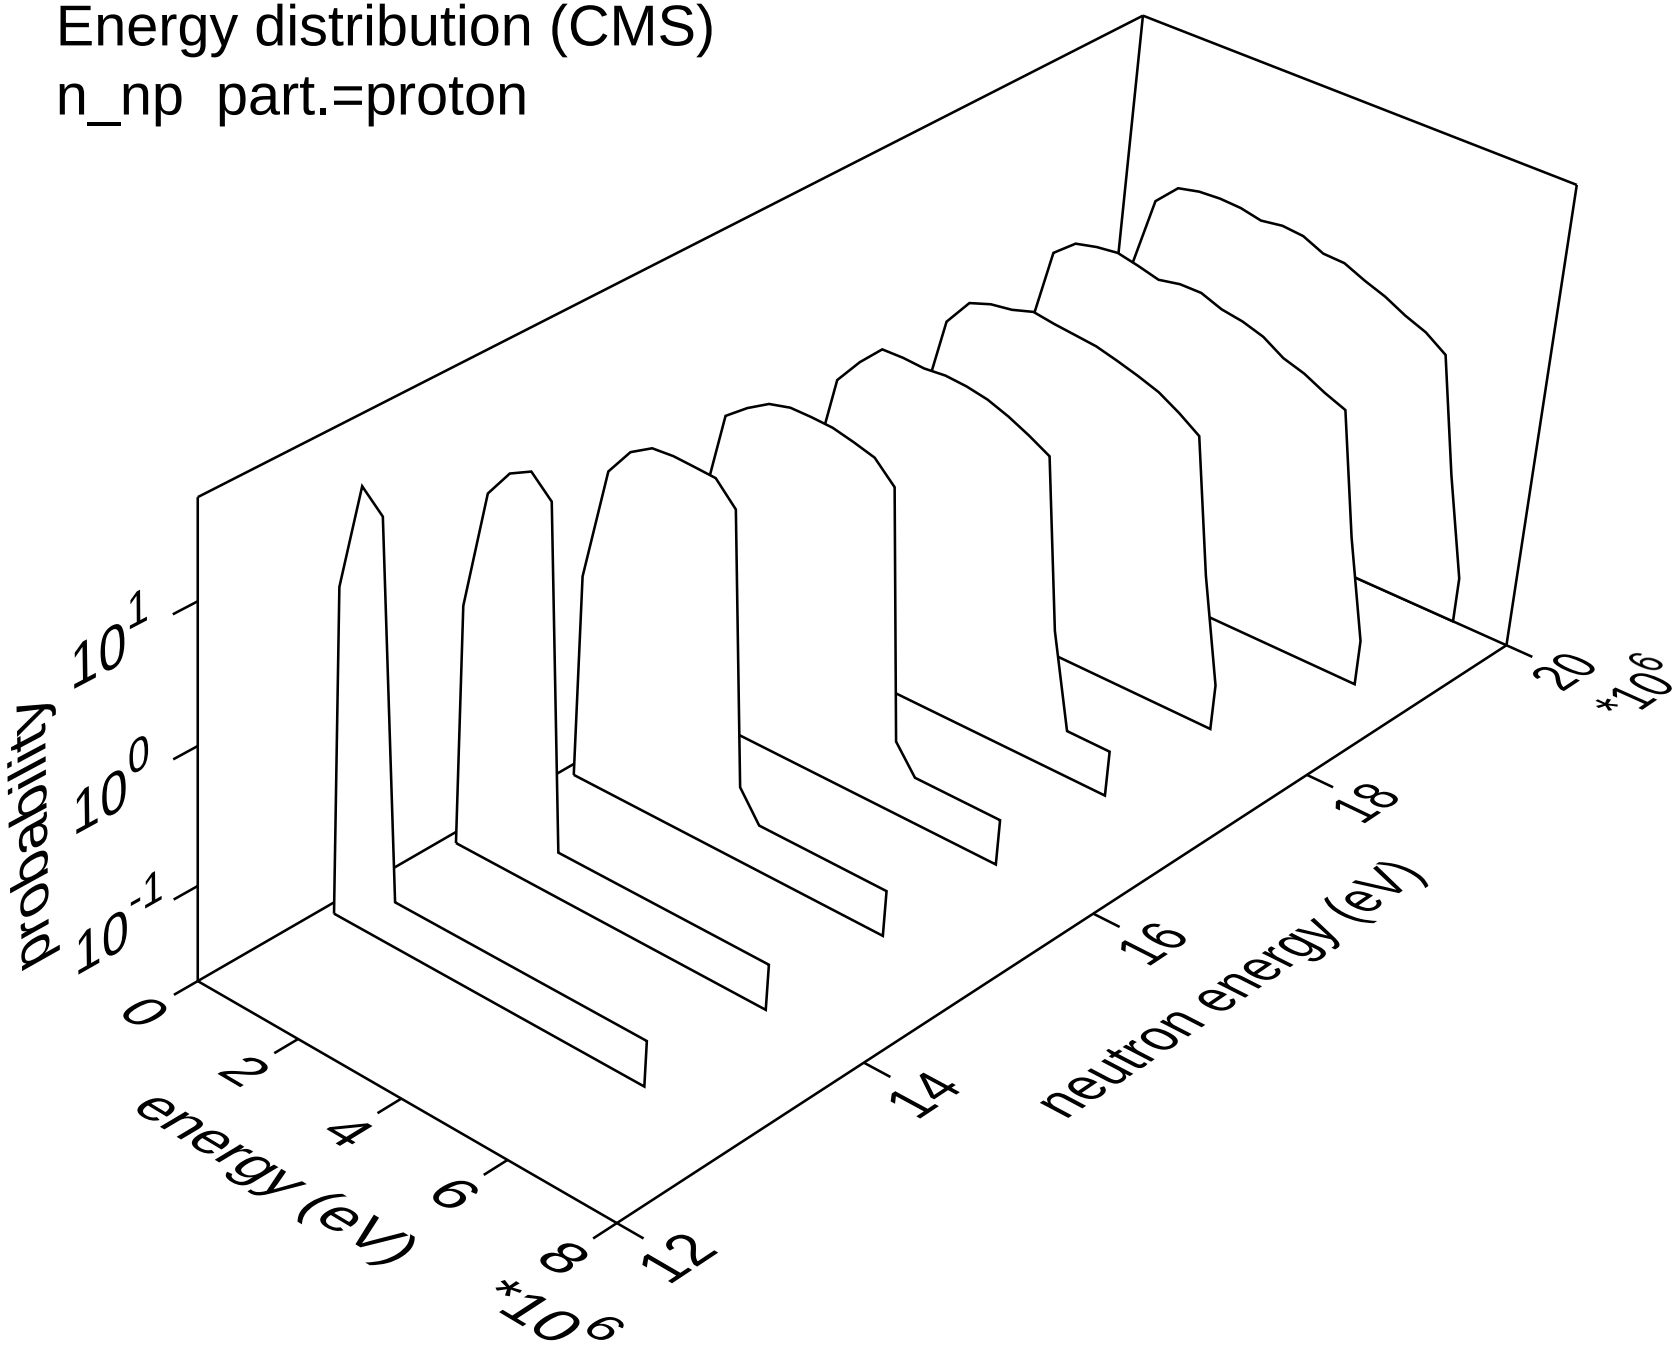
Energy distribution (CMS)
n_np part.=proton
probability
10^{1}
10^{0}
10^{-1}
0
2
4
6
8
*10 6
energy (eV)
12
14
16
18
20
*10^6
neutron energy (eV)

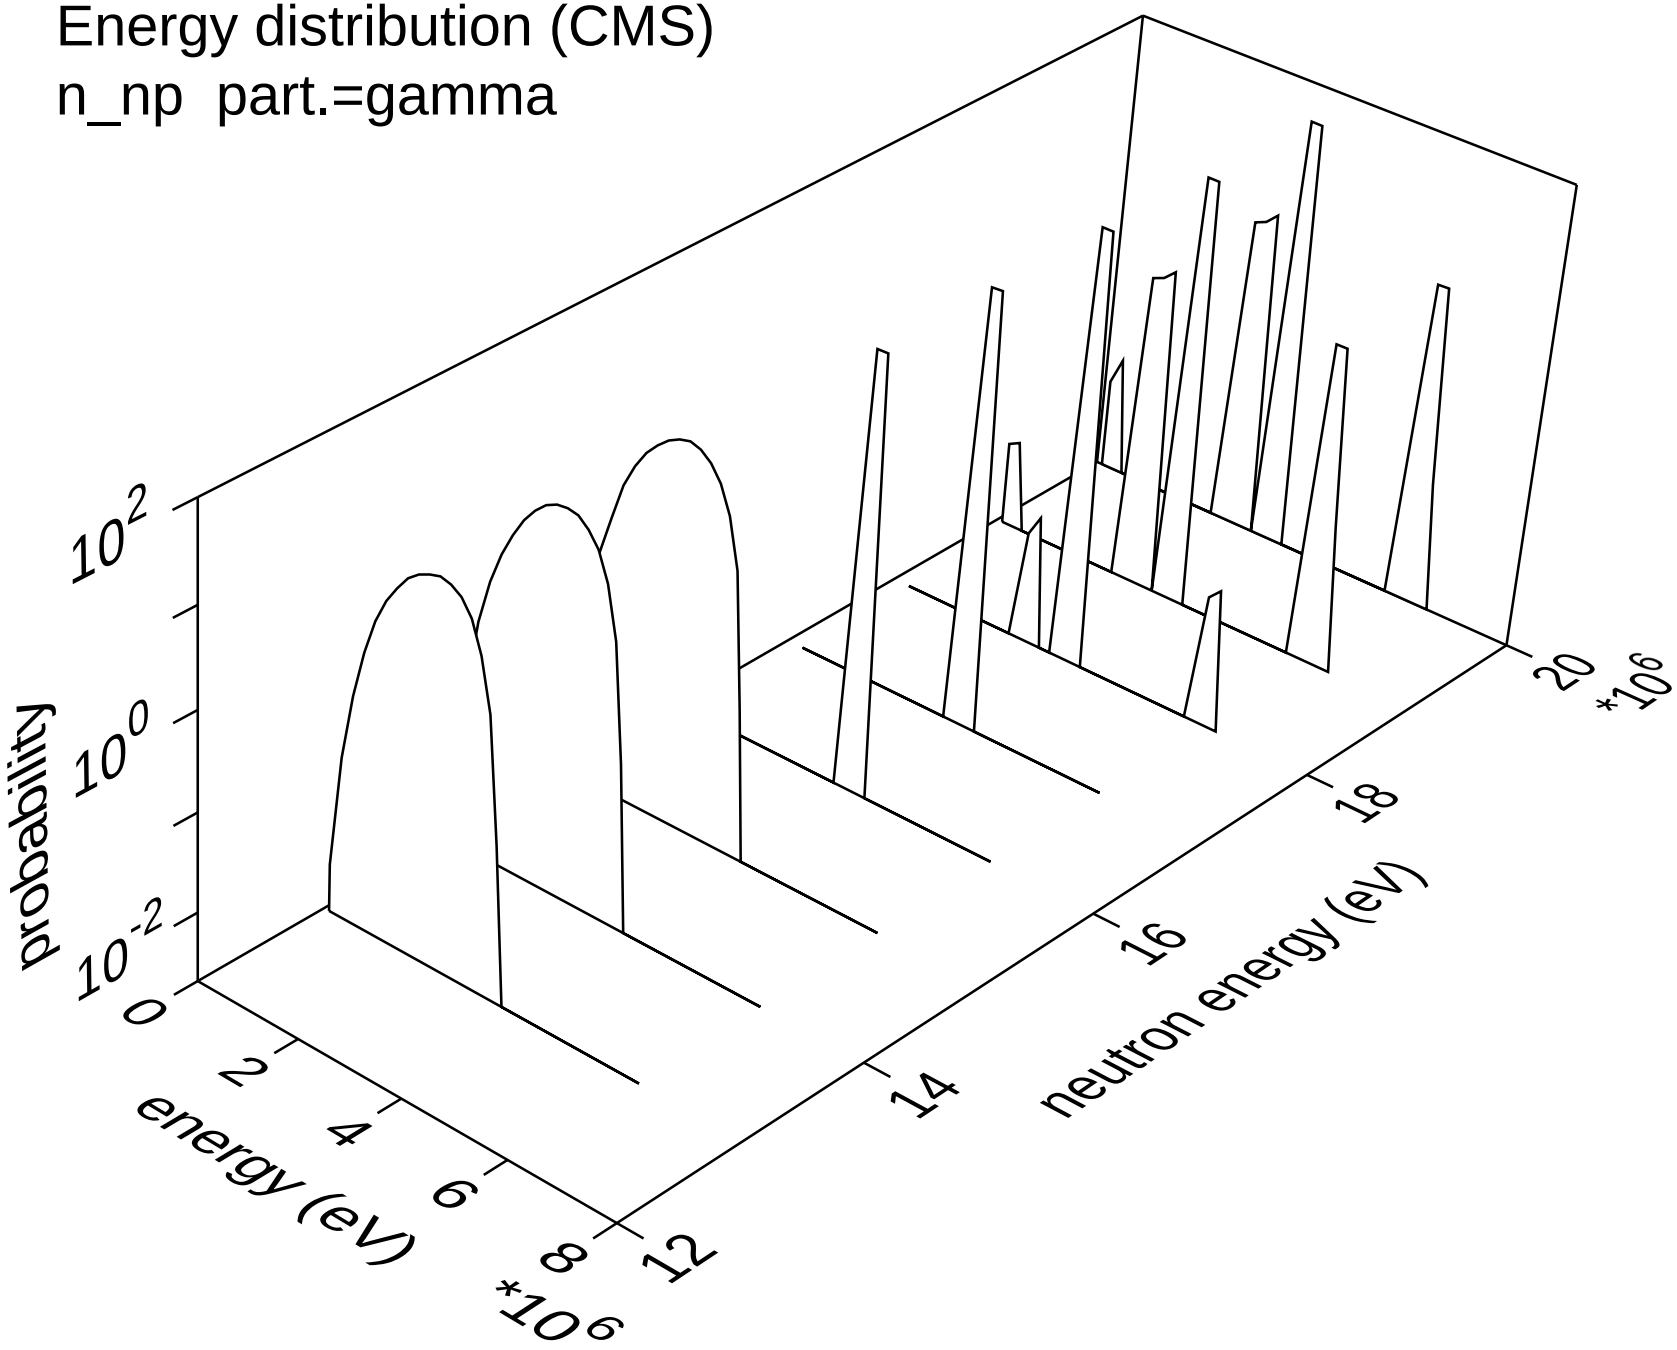
Energy distribution (CMS)
n_np part.=gamma
probability
10^{2}
10^{0}
10^{-2}
0
2
4
6
8
*10 6
energy (eV)
12
14
16
18
20
*10^6
neutron energy (eV)

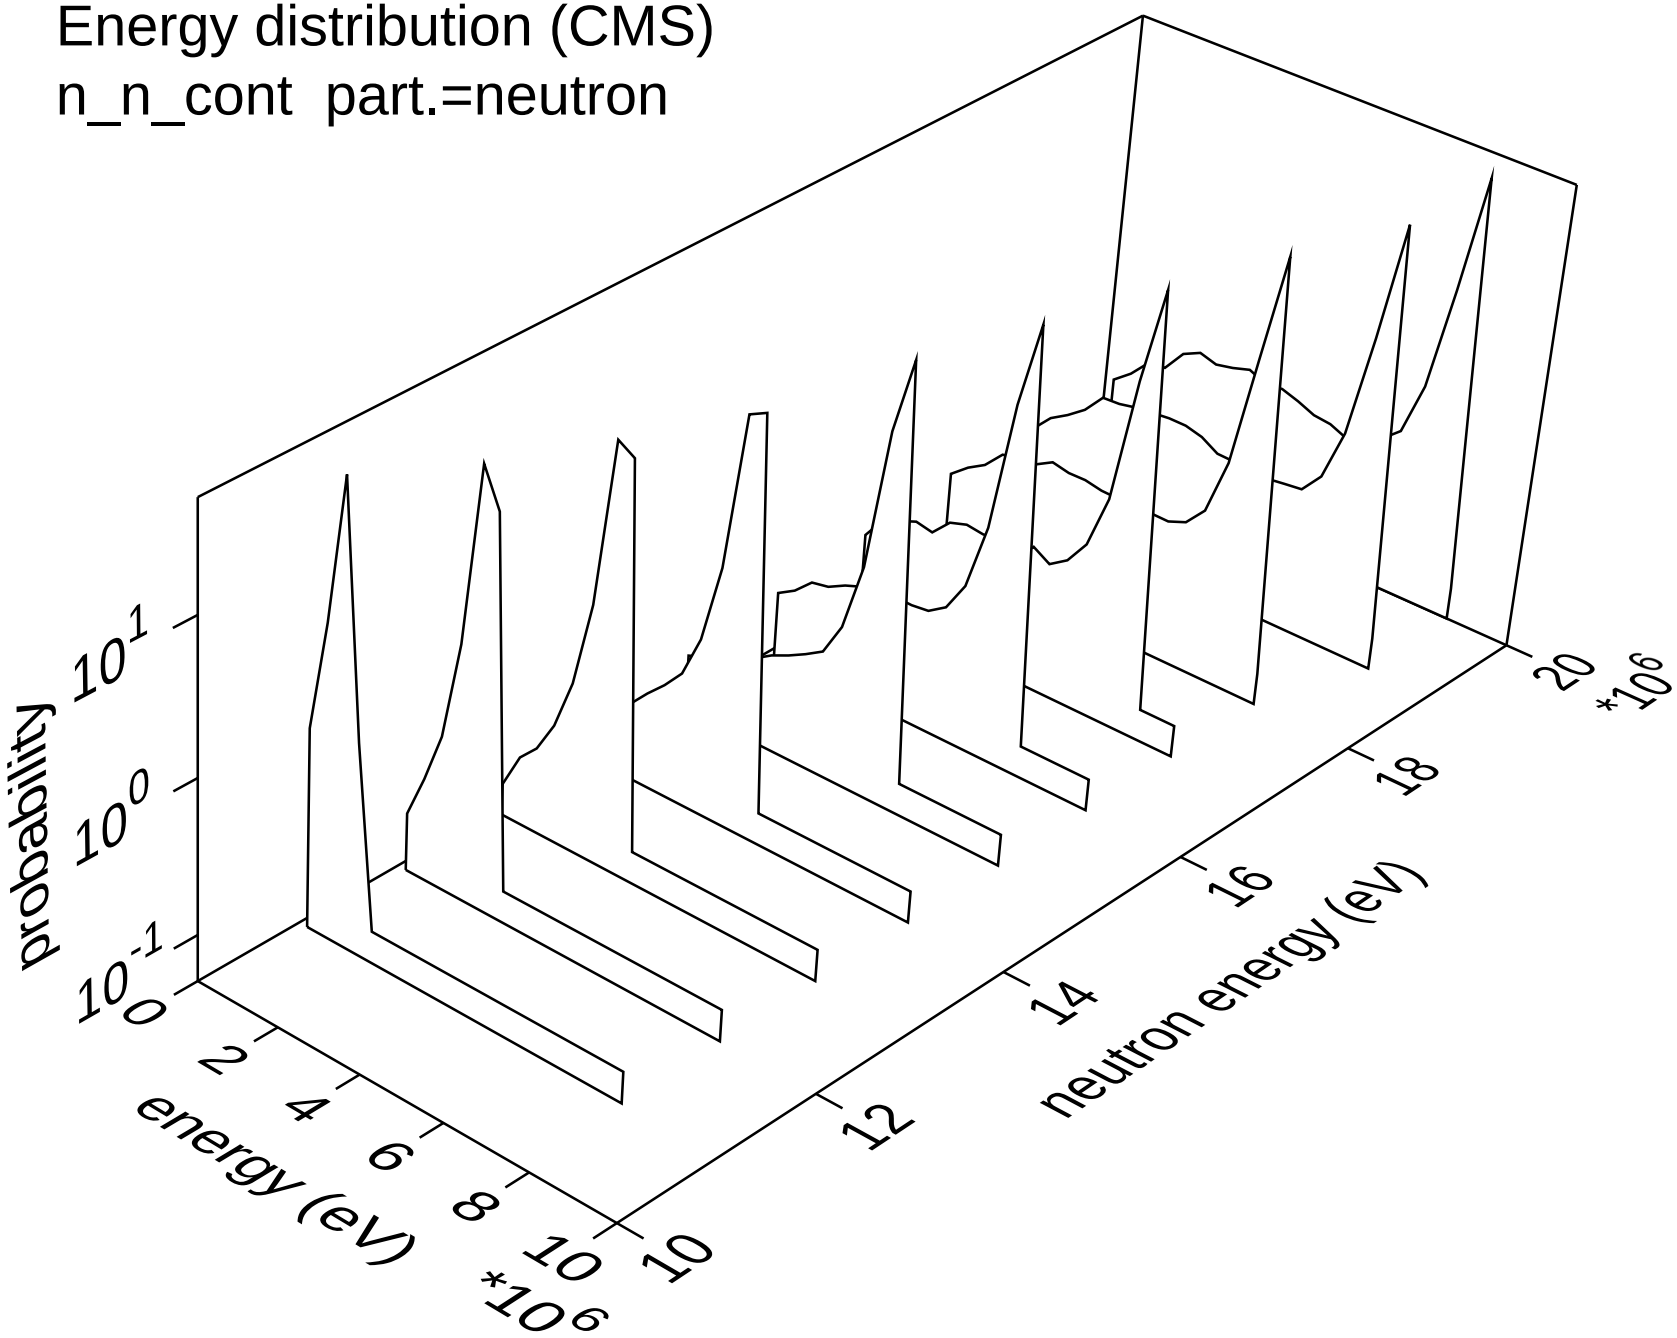
Energy distribution (CMS)
n_n_cont part.=neutron
probability
10^{1}
10^{0}
10^{-1}
0
2
4
6
8
10
*10^6
energy (eV)
10
12
14
16
18
20
*10^6
neutron energy (eV)

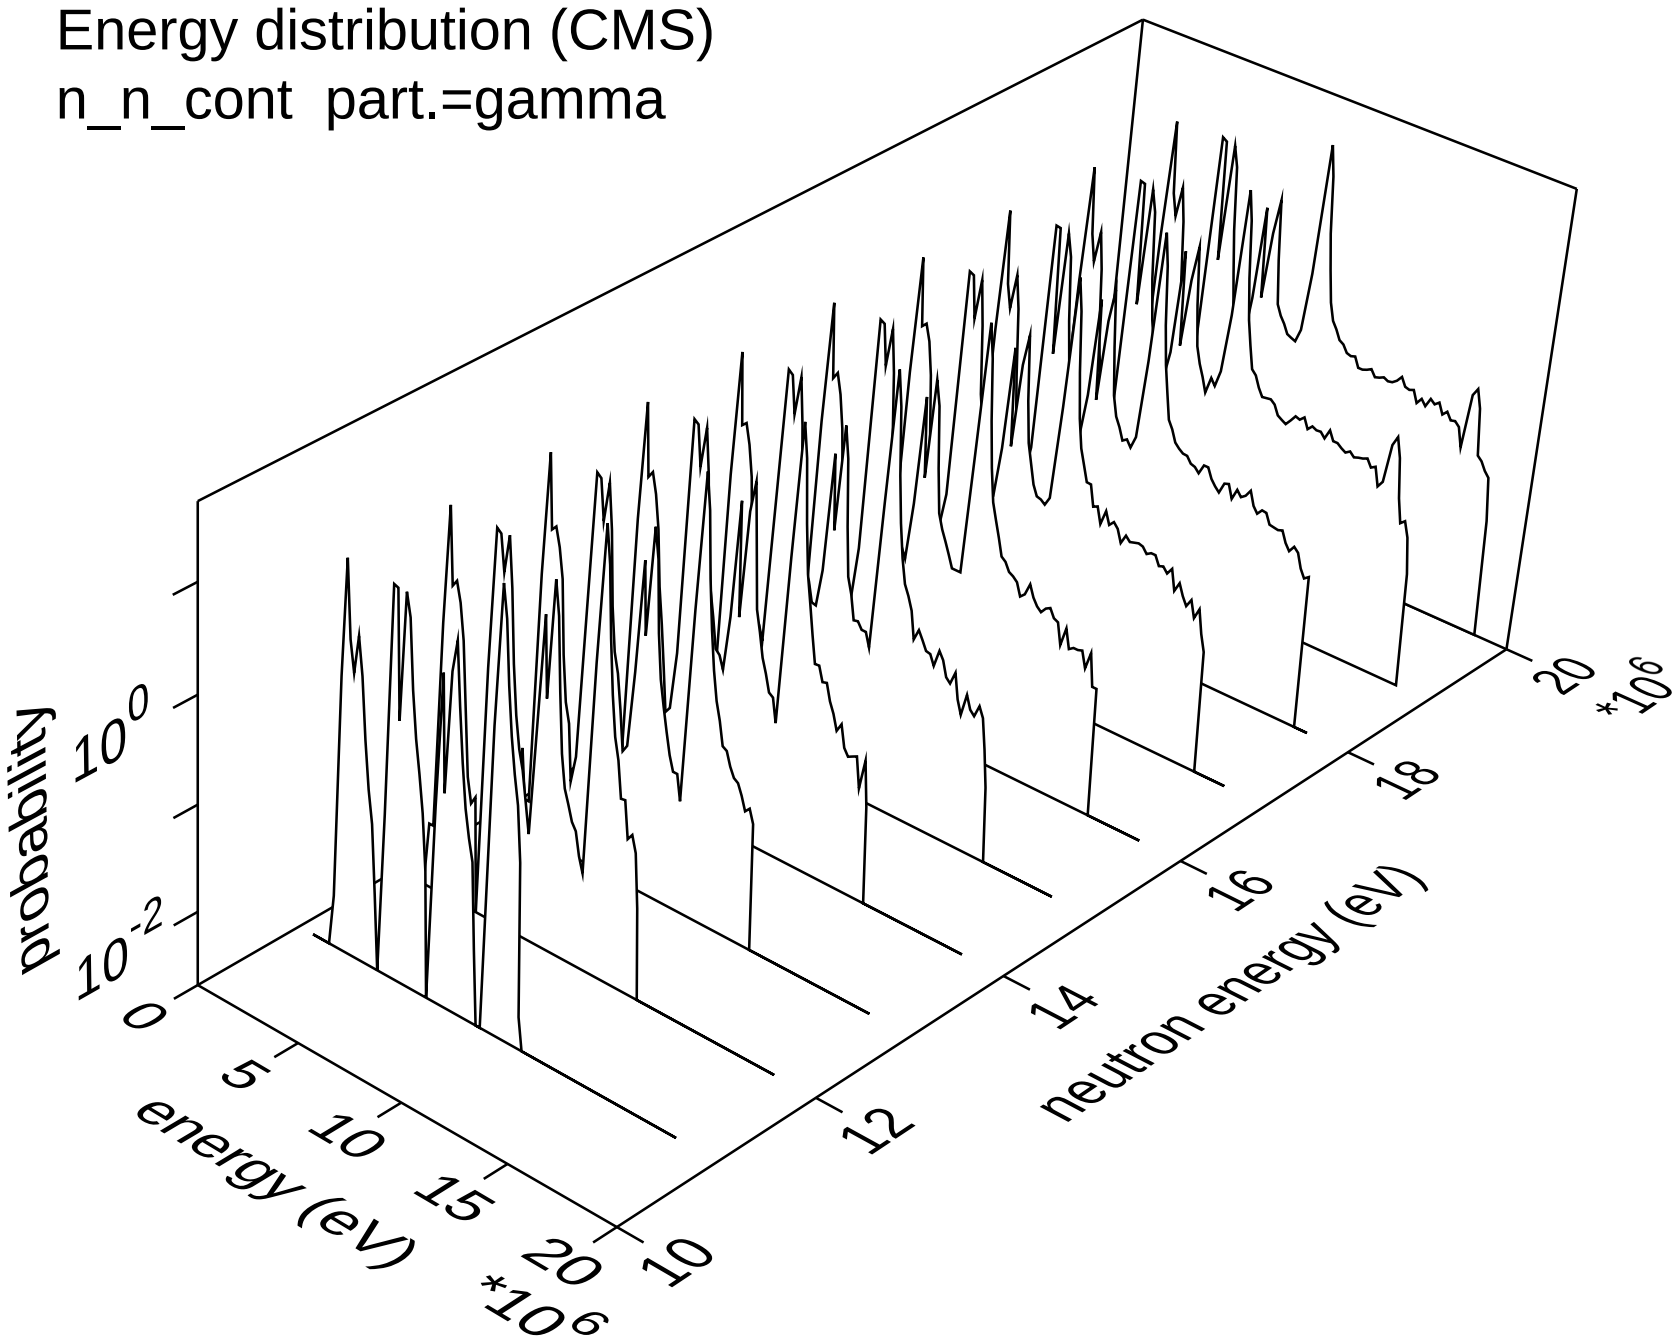
Energy distribution (CMS)
n_n_cont part.=gamma
probability
10^0
10^{-2}
0
5
10
15
20
*10^6
energy (eV)
10
12
14
16
18
20
*10^6
neutron energy (eV)

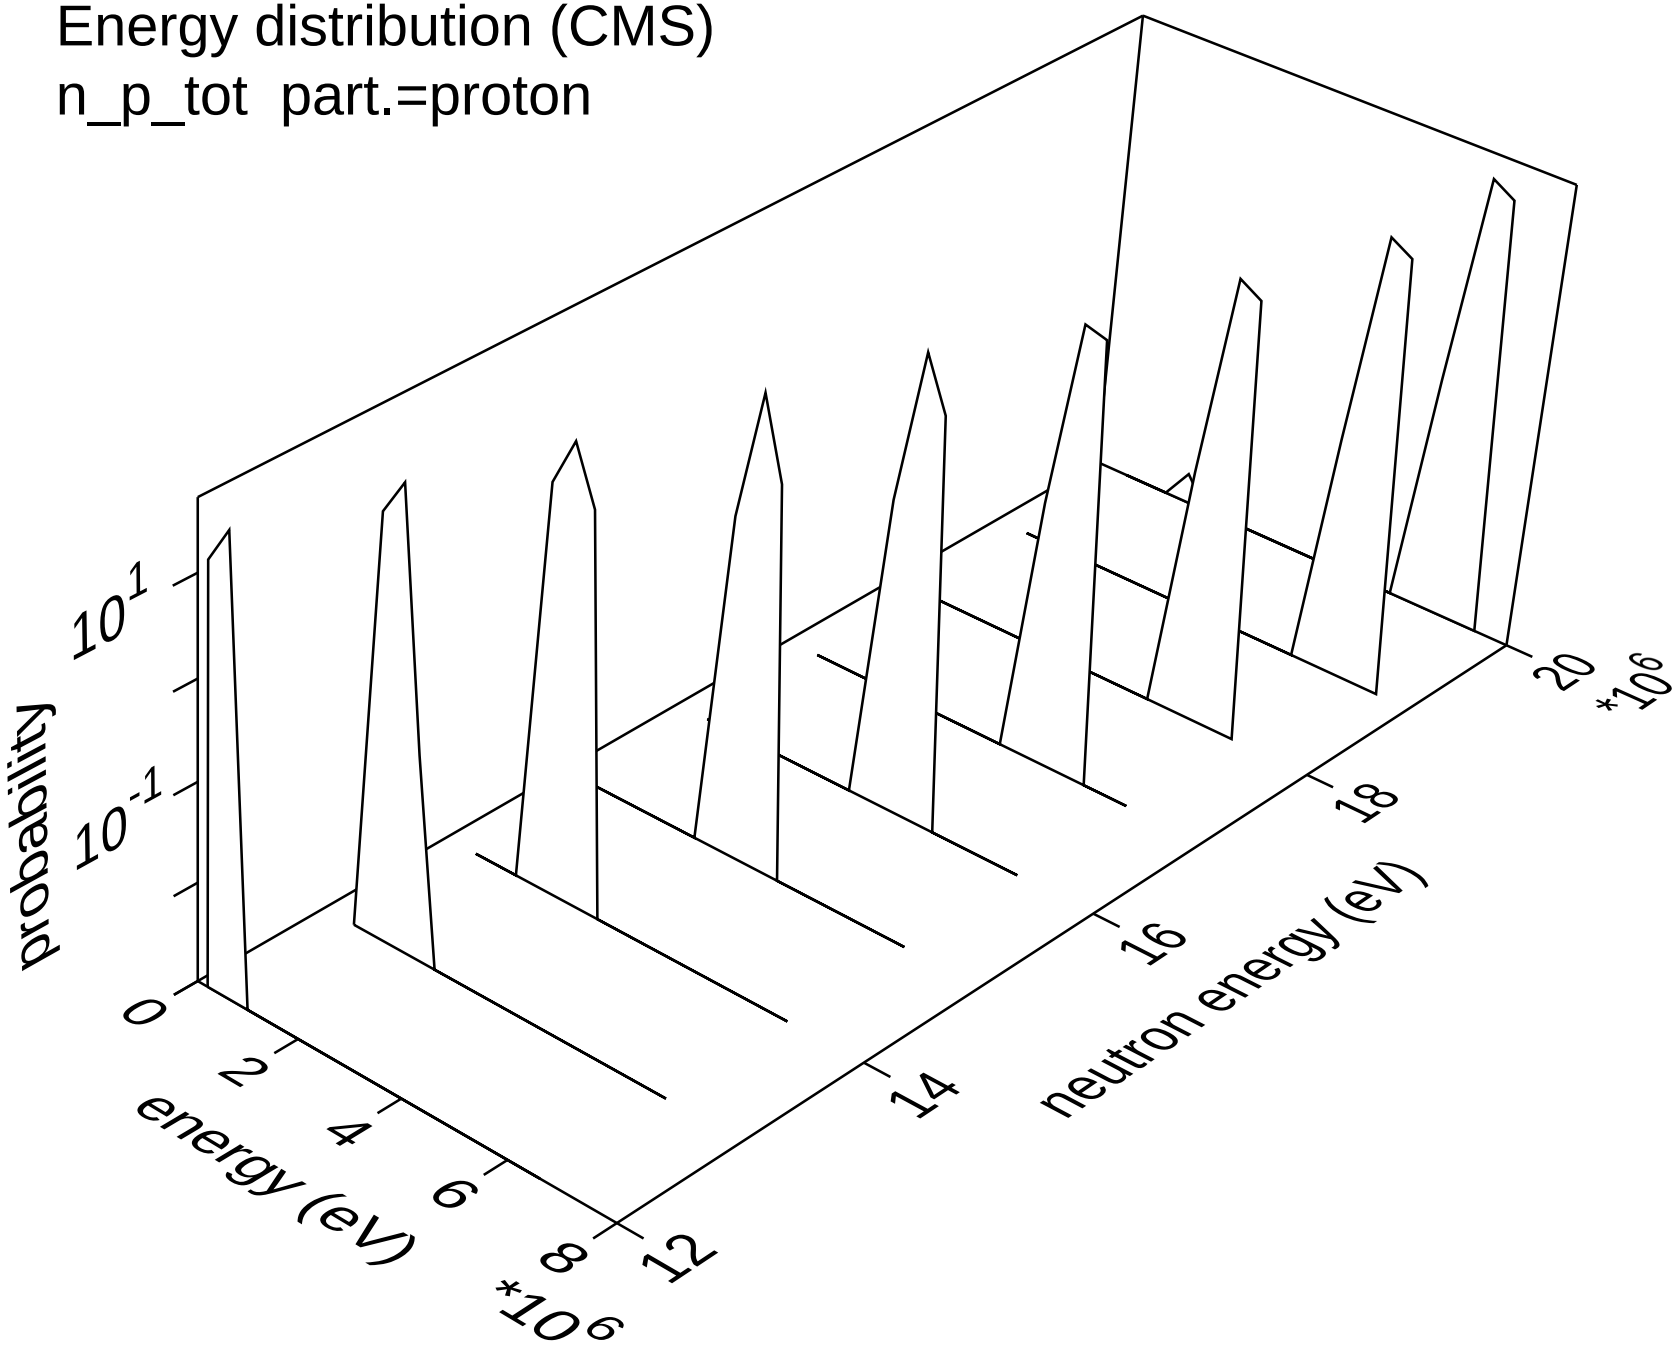
Energy distribution (CMS)
n_p_tot part.=proton
probability
10^{1}
10^{-1}
0
2
4
6
8
*10 6
energy (eV)
12
14
16
18
20
*10⁶
neutron energy (eV)

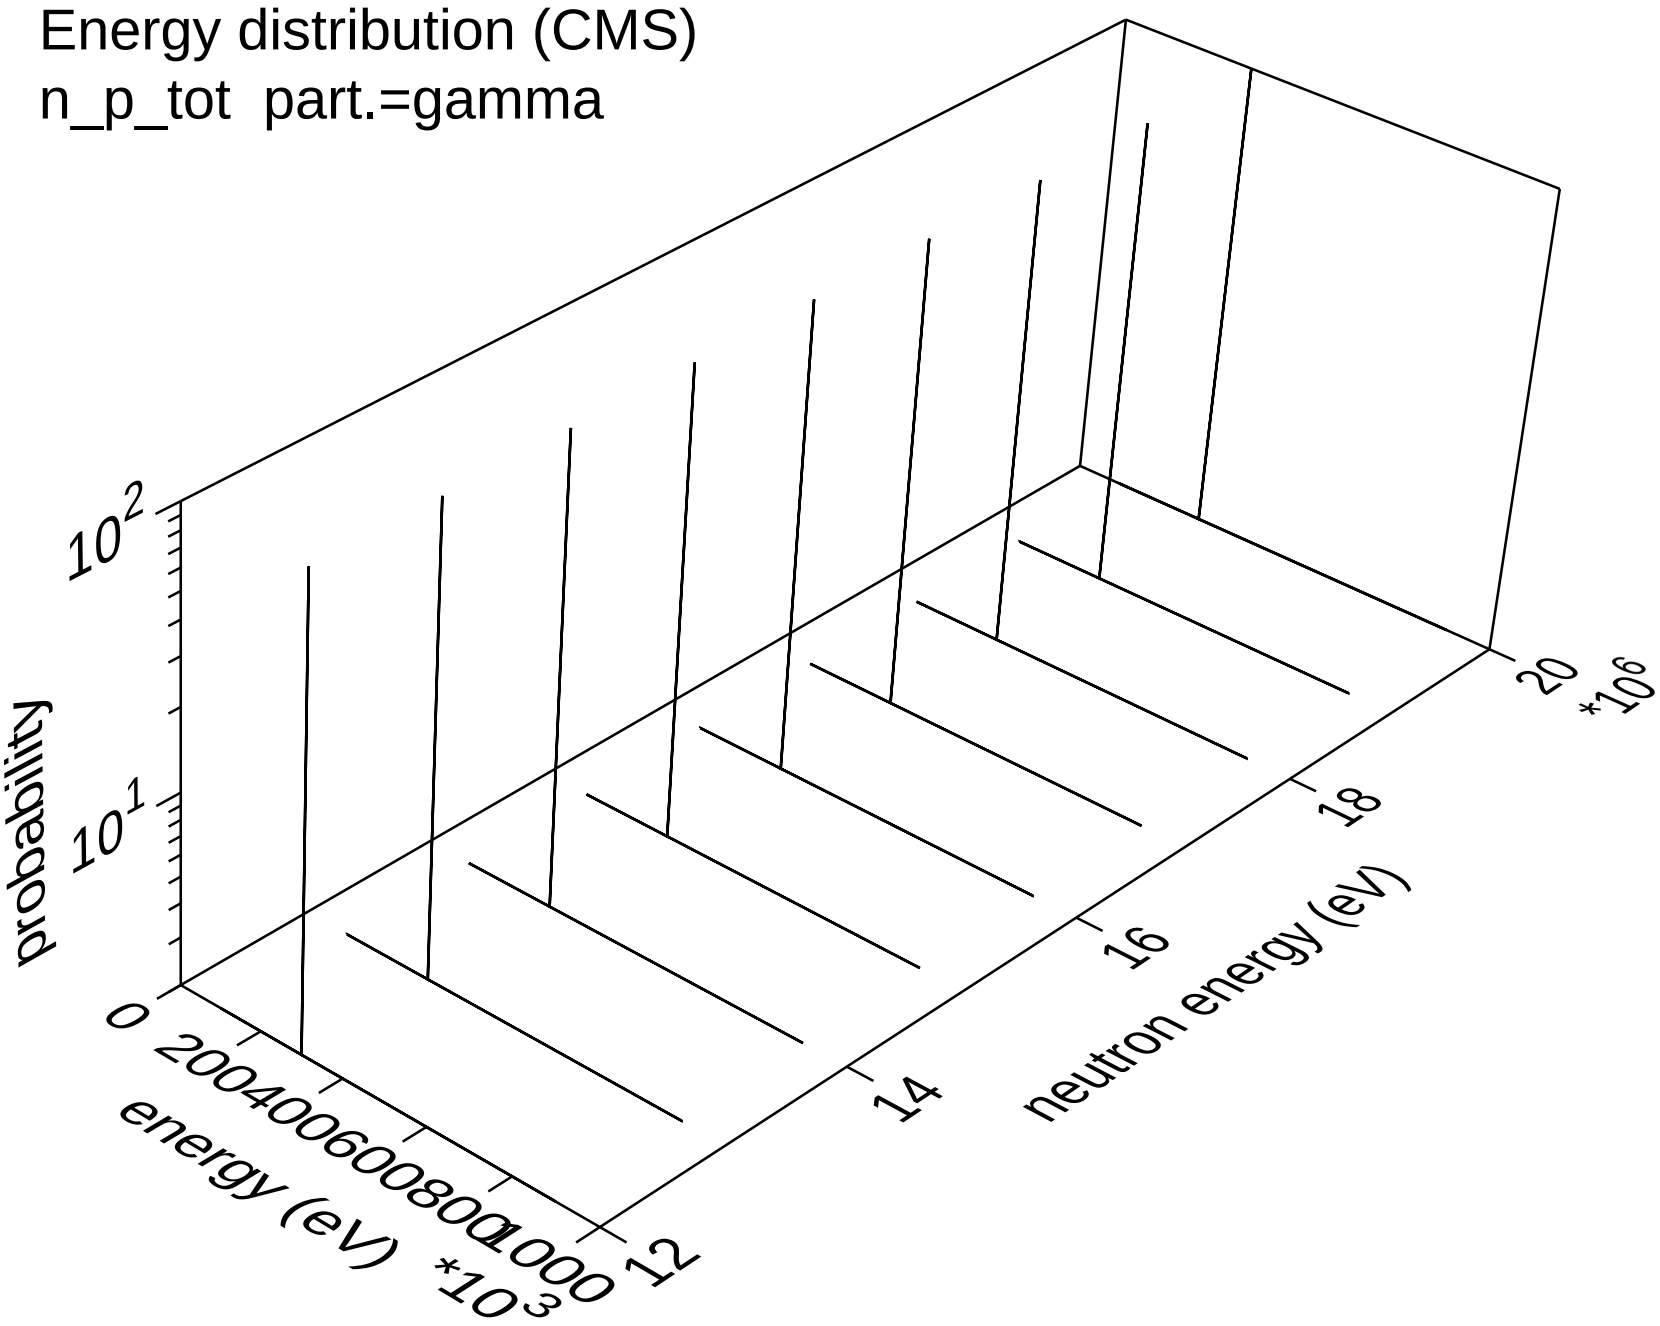
Energy distribution (CMS)
n_p_tot part.=gamma
probability
10^2
10^1
0
200
400
600
800
1000
12
14
16
18
20
$*10^6$
neutron energy (eV)
energy (eV) $*10^3$

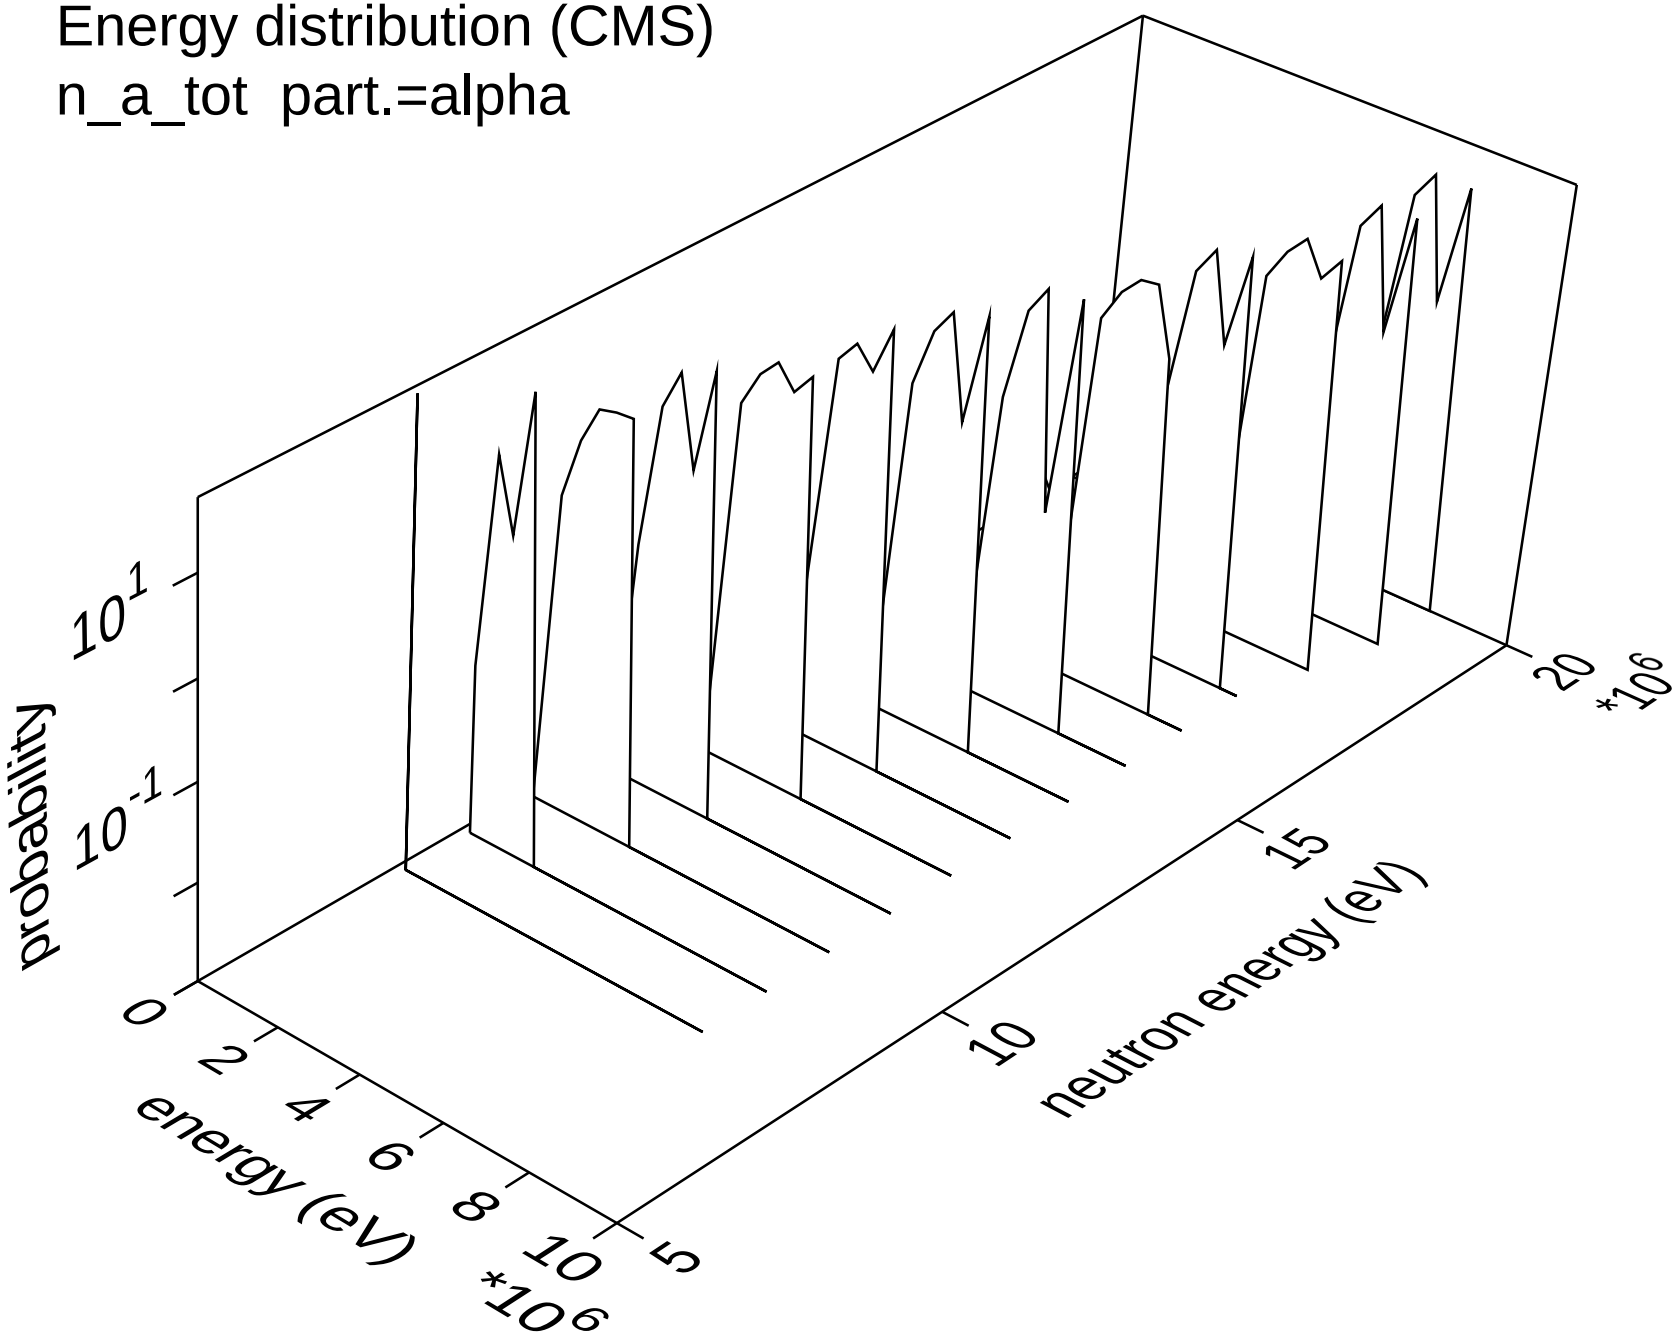
Energy distribution (CMS)
n_a_tot part.=alpha
probability
10^{1}
10^{-1}
0
2
4
6
8
10
*10^6
energy (eV)
5
10
15
20
*10^6
neutron energy (eV)

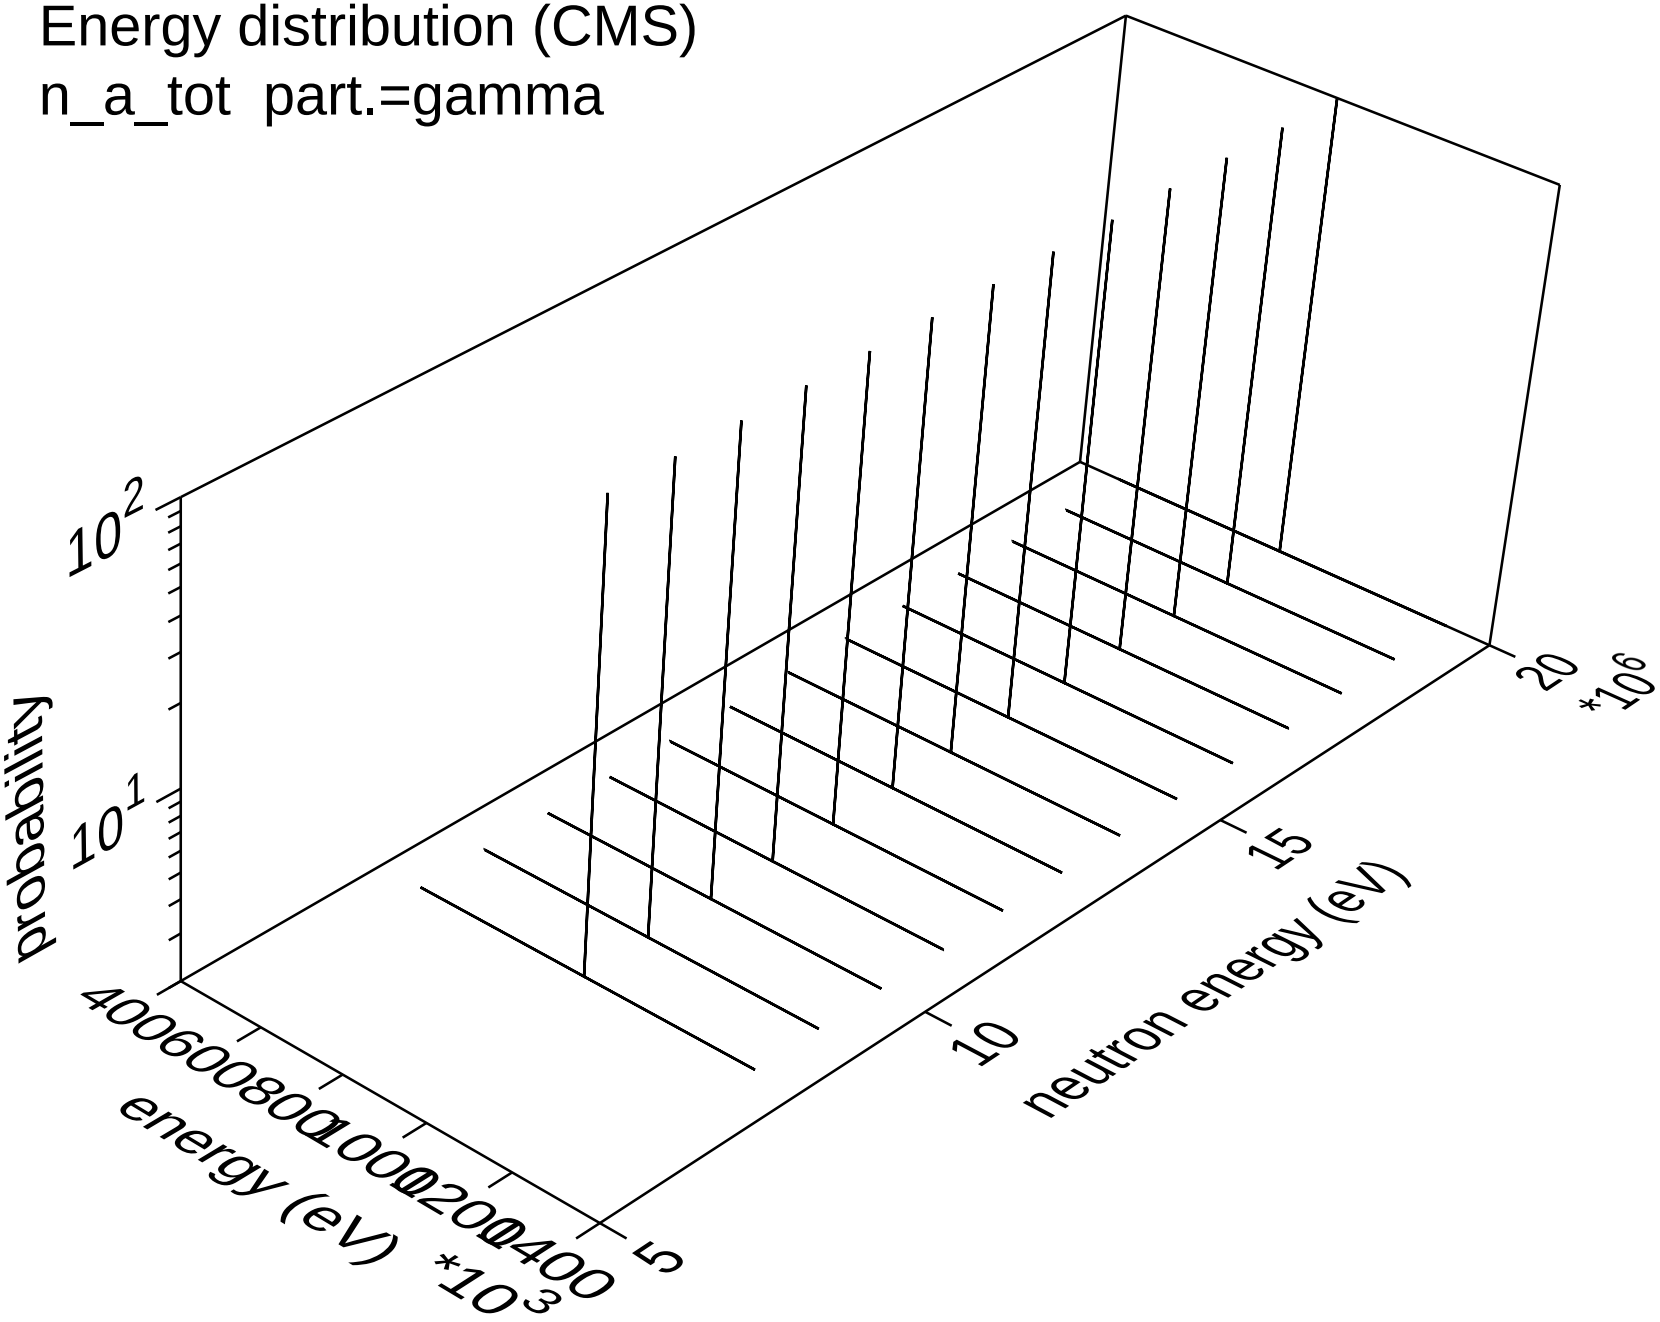
Energy distribution (CMS)
n_a_tot part.=gamma
probability
10^2
10^1
energy (eV) *10^3
400
600
800
1000
1200
1400
5
10
15
20
neutron energy (eV)
*10^6

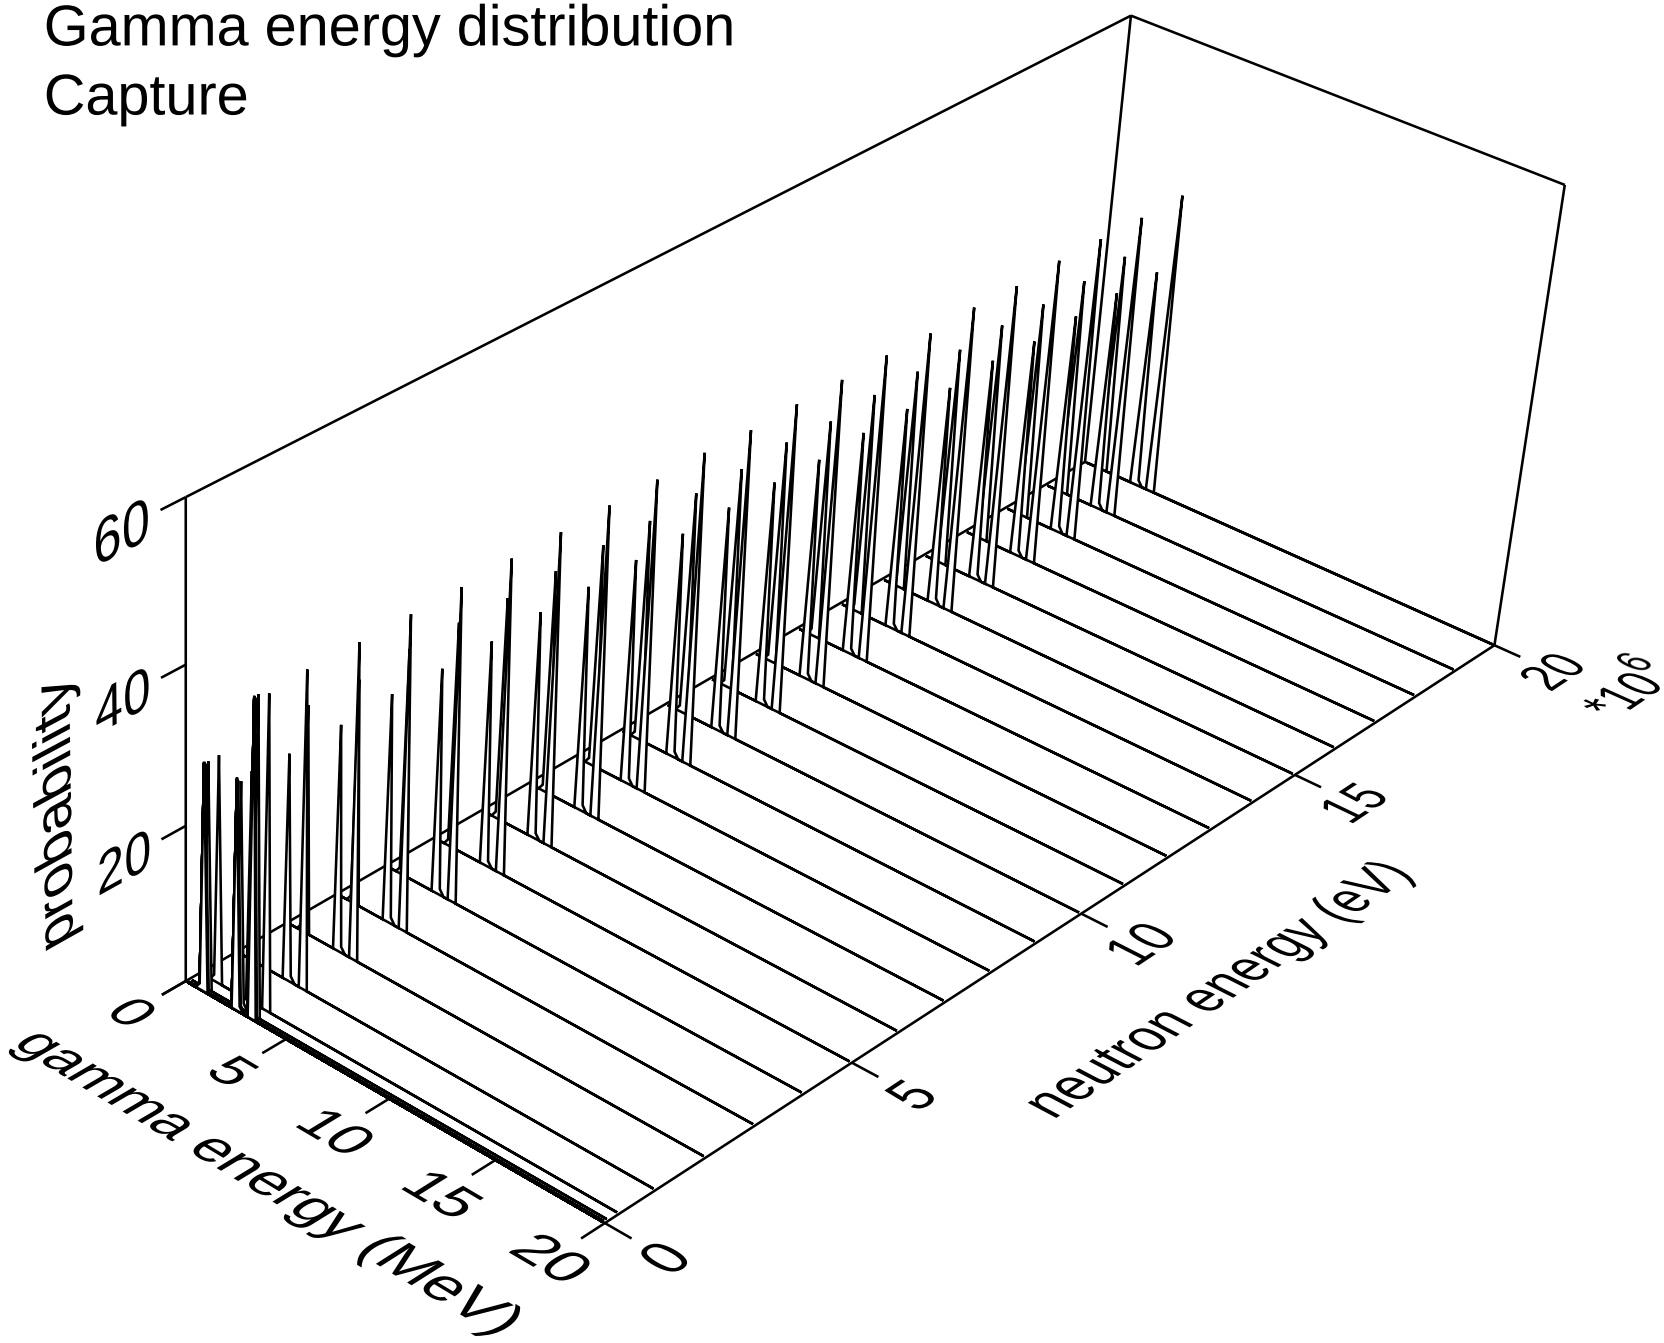
Gamma energy distribution
Capture
probability
60
40
20
0
gamma energy (MeV)
0
5
10
15
20
neutron energy (eV)
5
10
15
20
*10^6

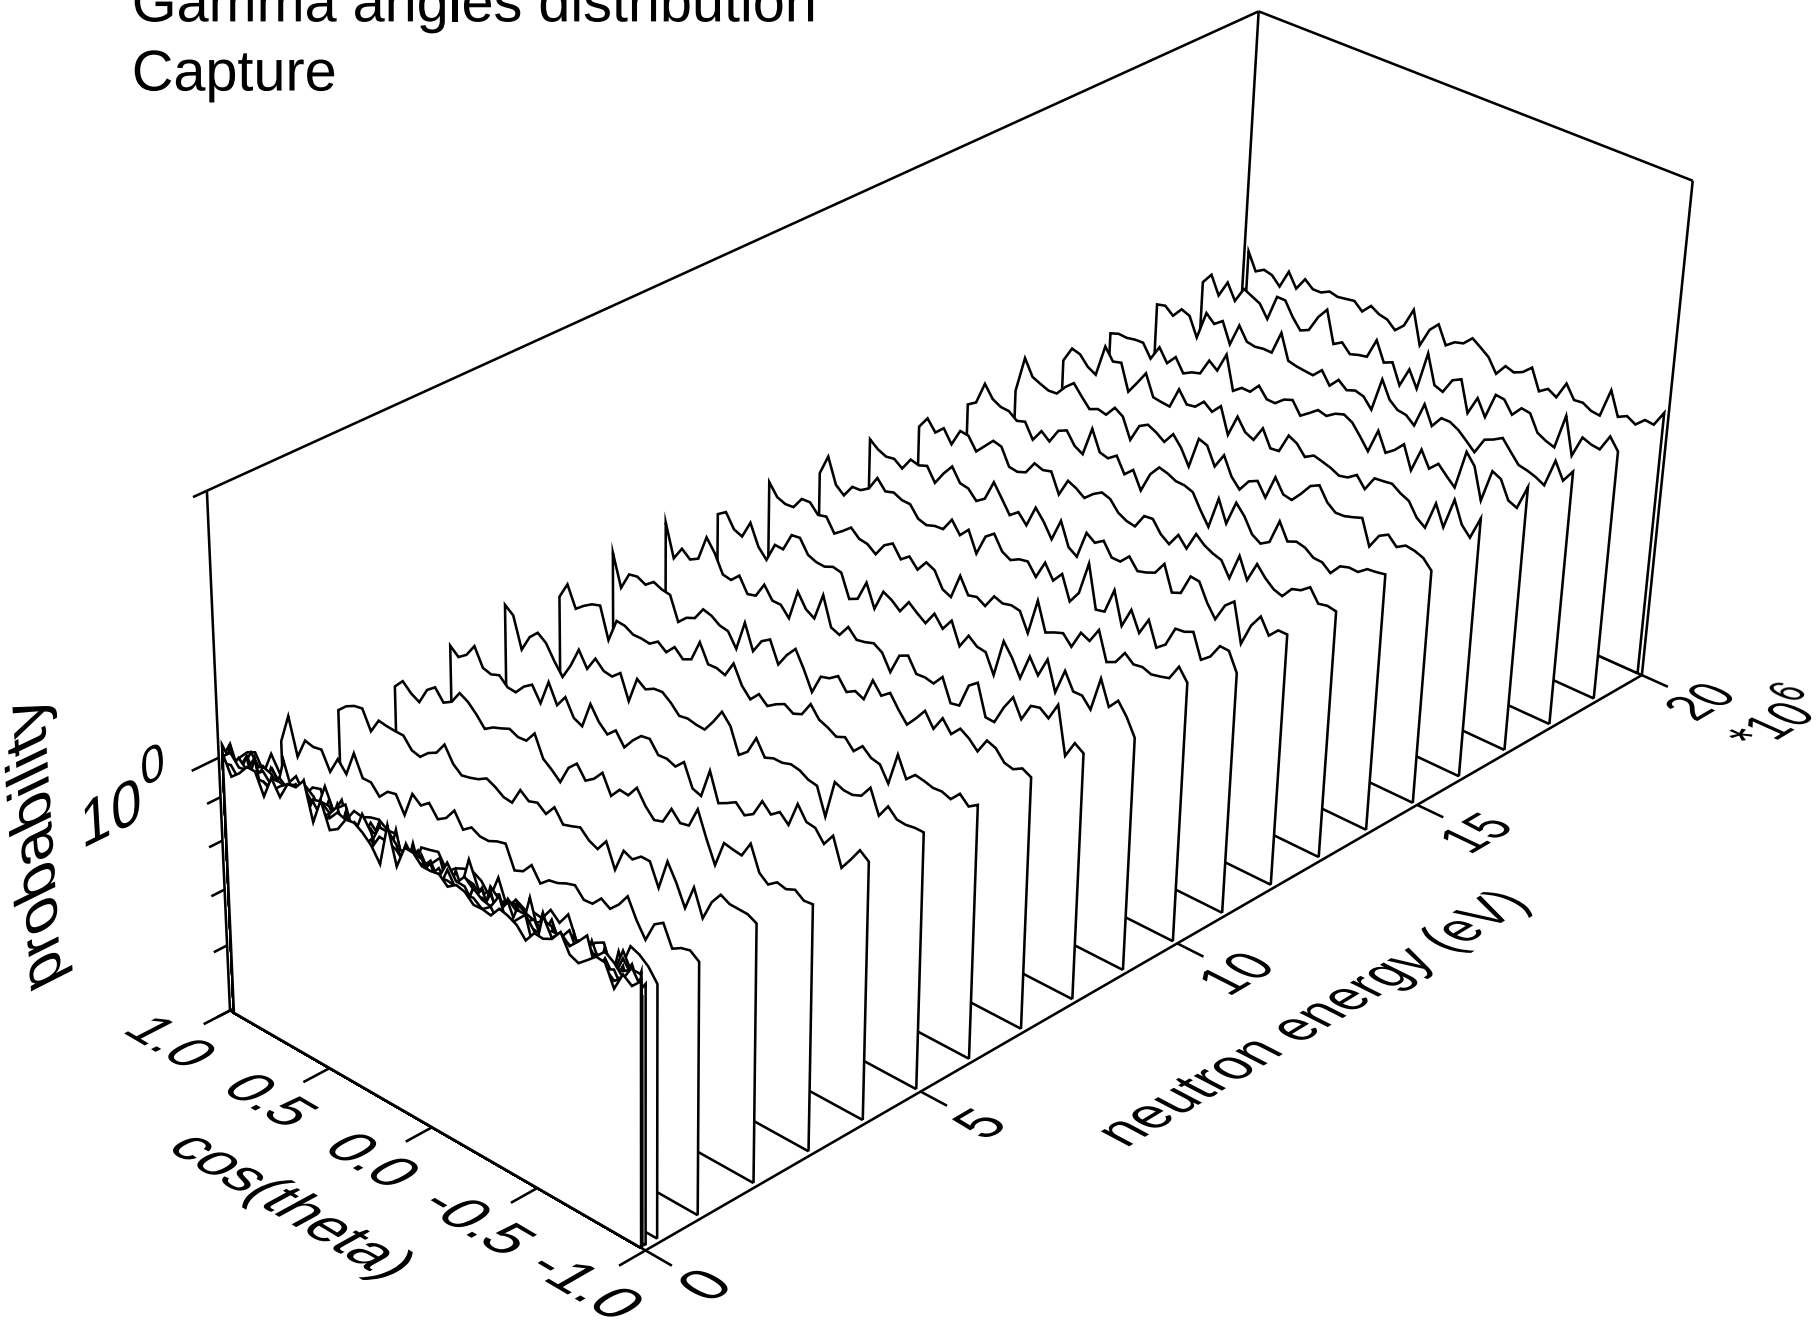
Gamma angles distribution
Capture
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
0
5
10
15
20
*10^6
neutron energy (eV)

Gamma multiplicities distribution
Capture

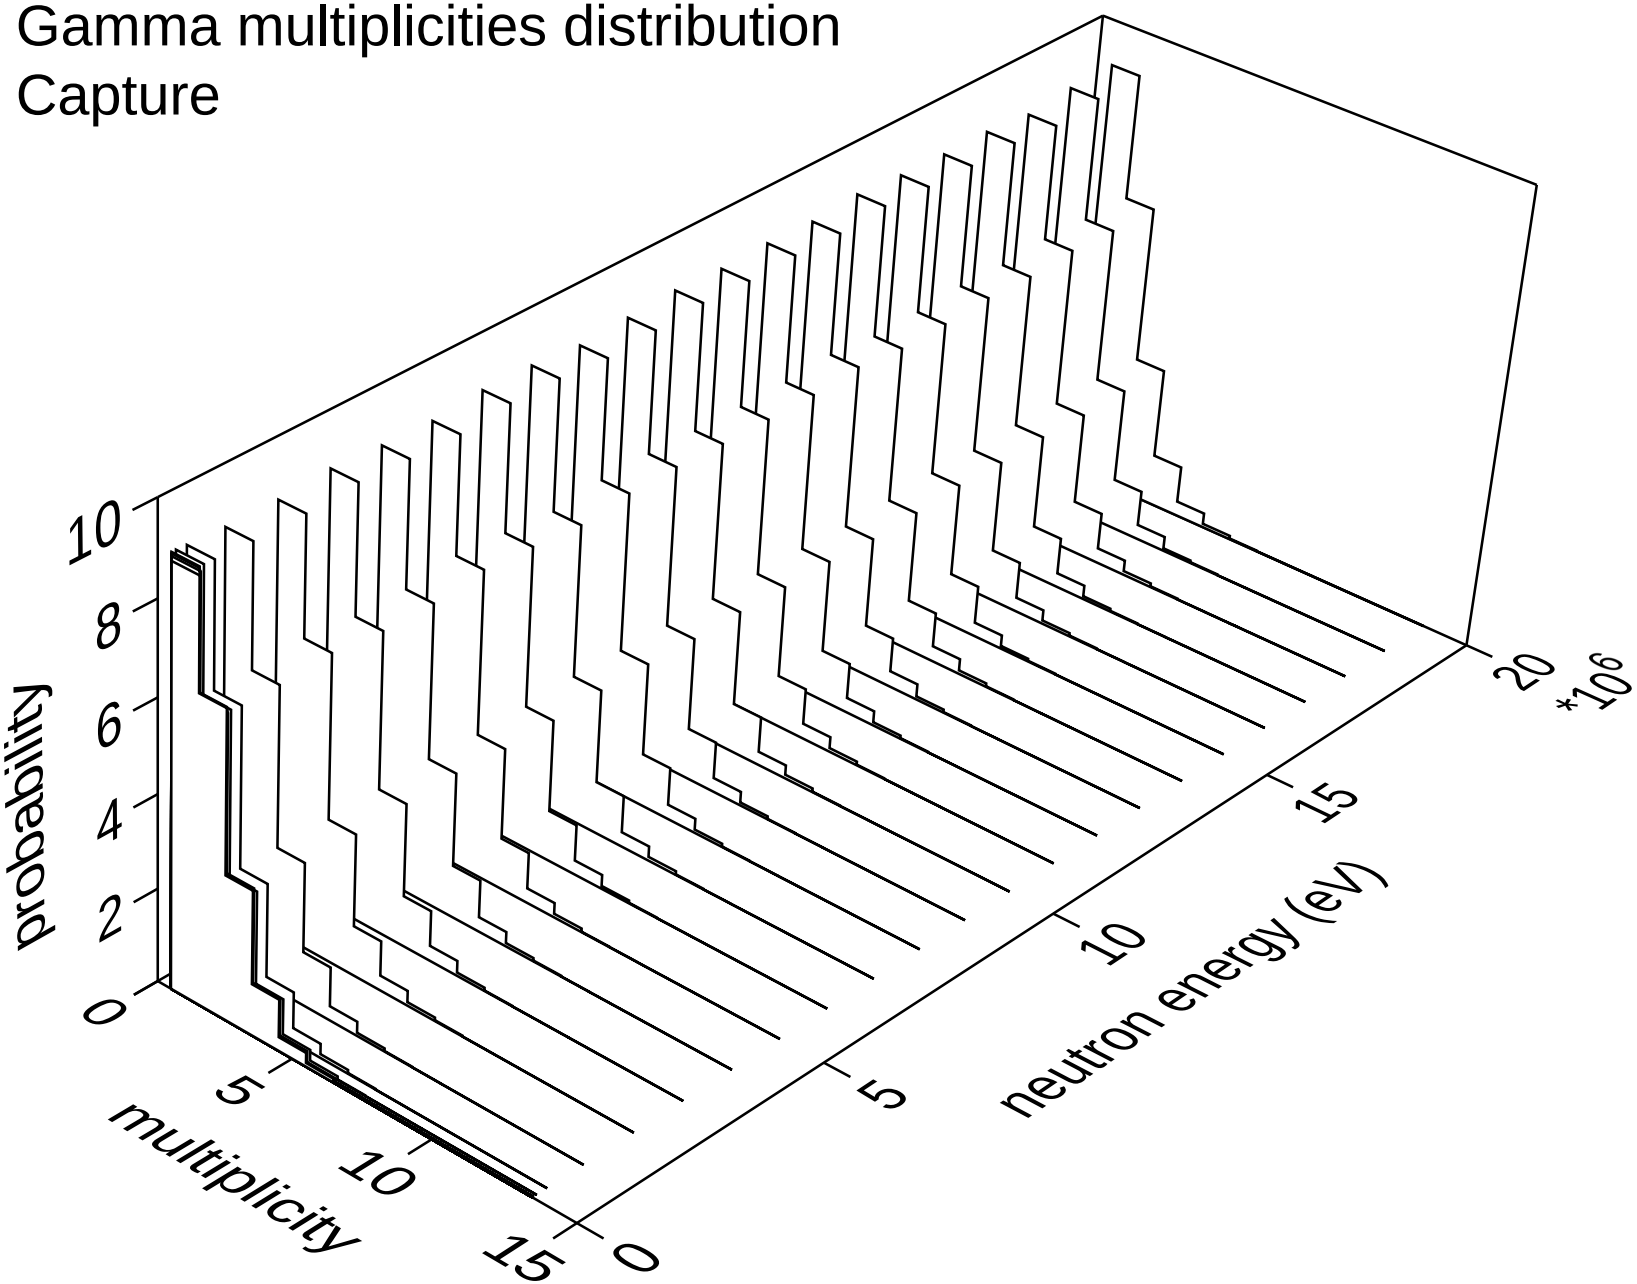

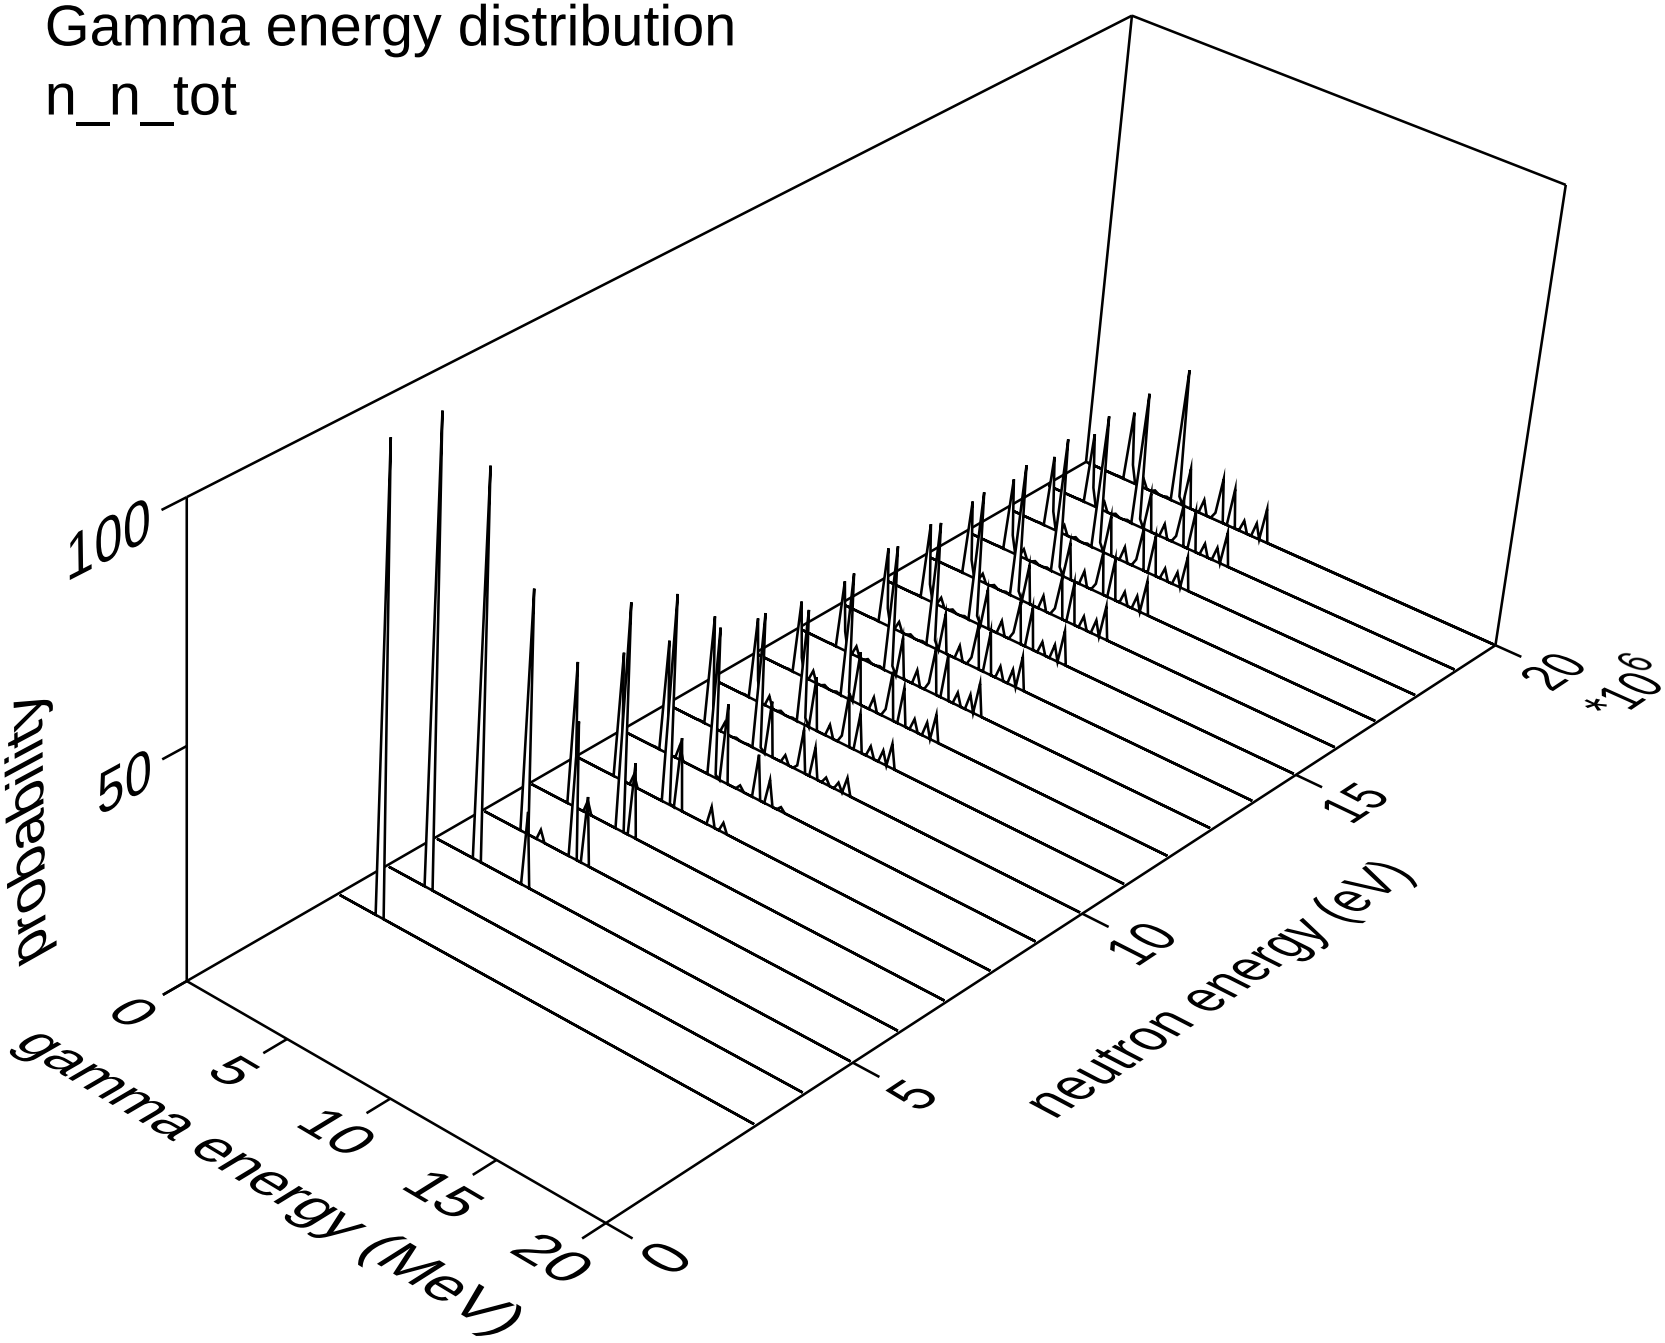
Gamma energy distribution
n_n_tot
probability
100
50
0
gamma energy (MeV)
0
5
10
15
20
neutron energy (eV)
0
5
10
15
20
*10^6

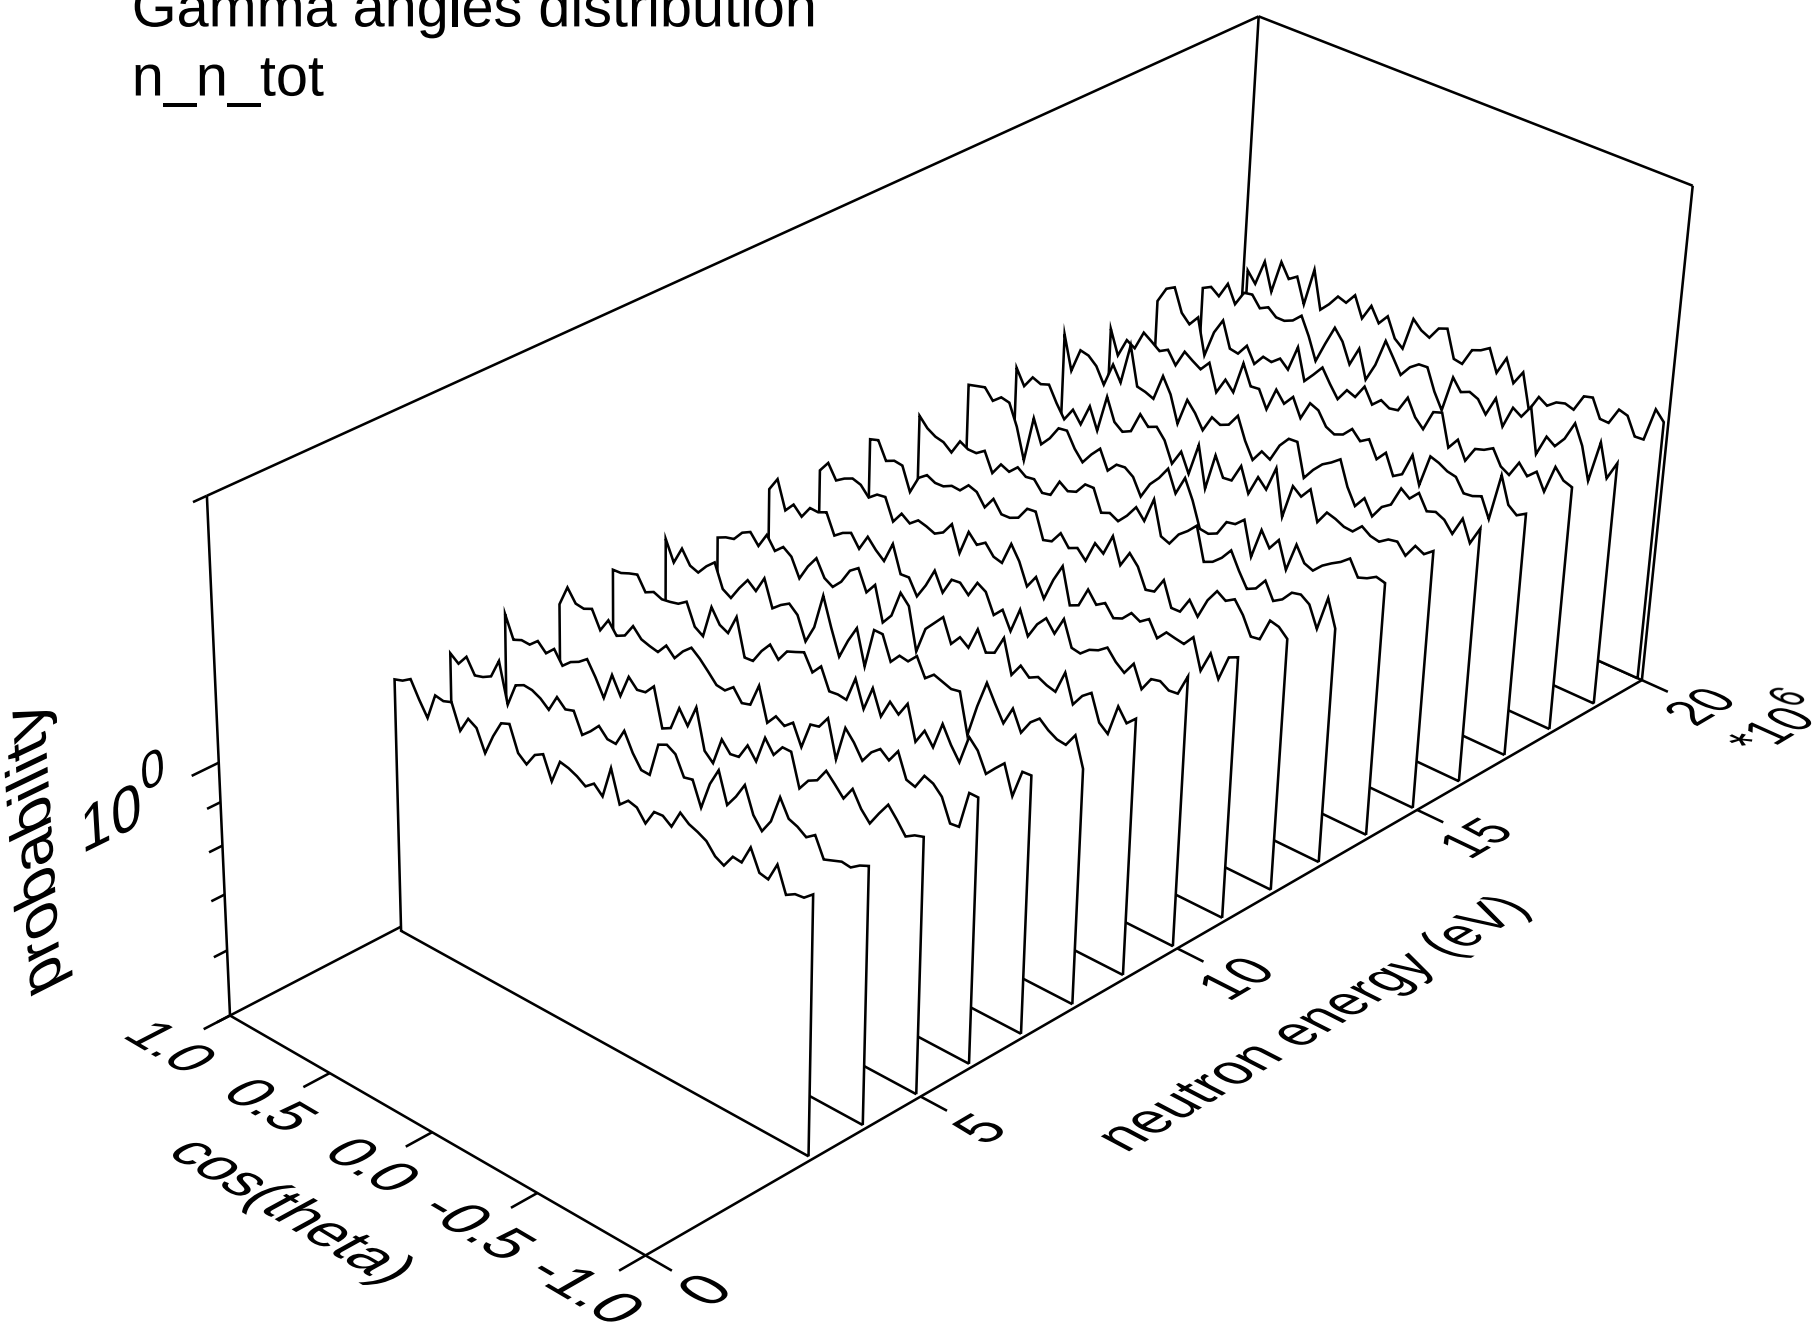
Gamma angles distribution
n_n_tot
probability
10^0
1.0
0.5
0.0
-0.5
-1.0
cos(theta)
0
5
10
15
20
*10^6
neutron energy (eV)
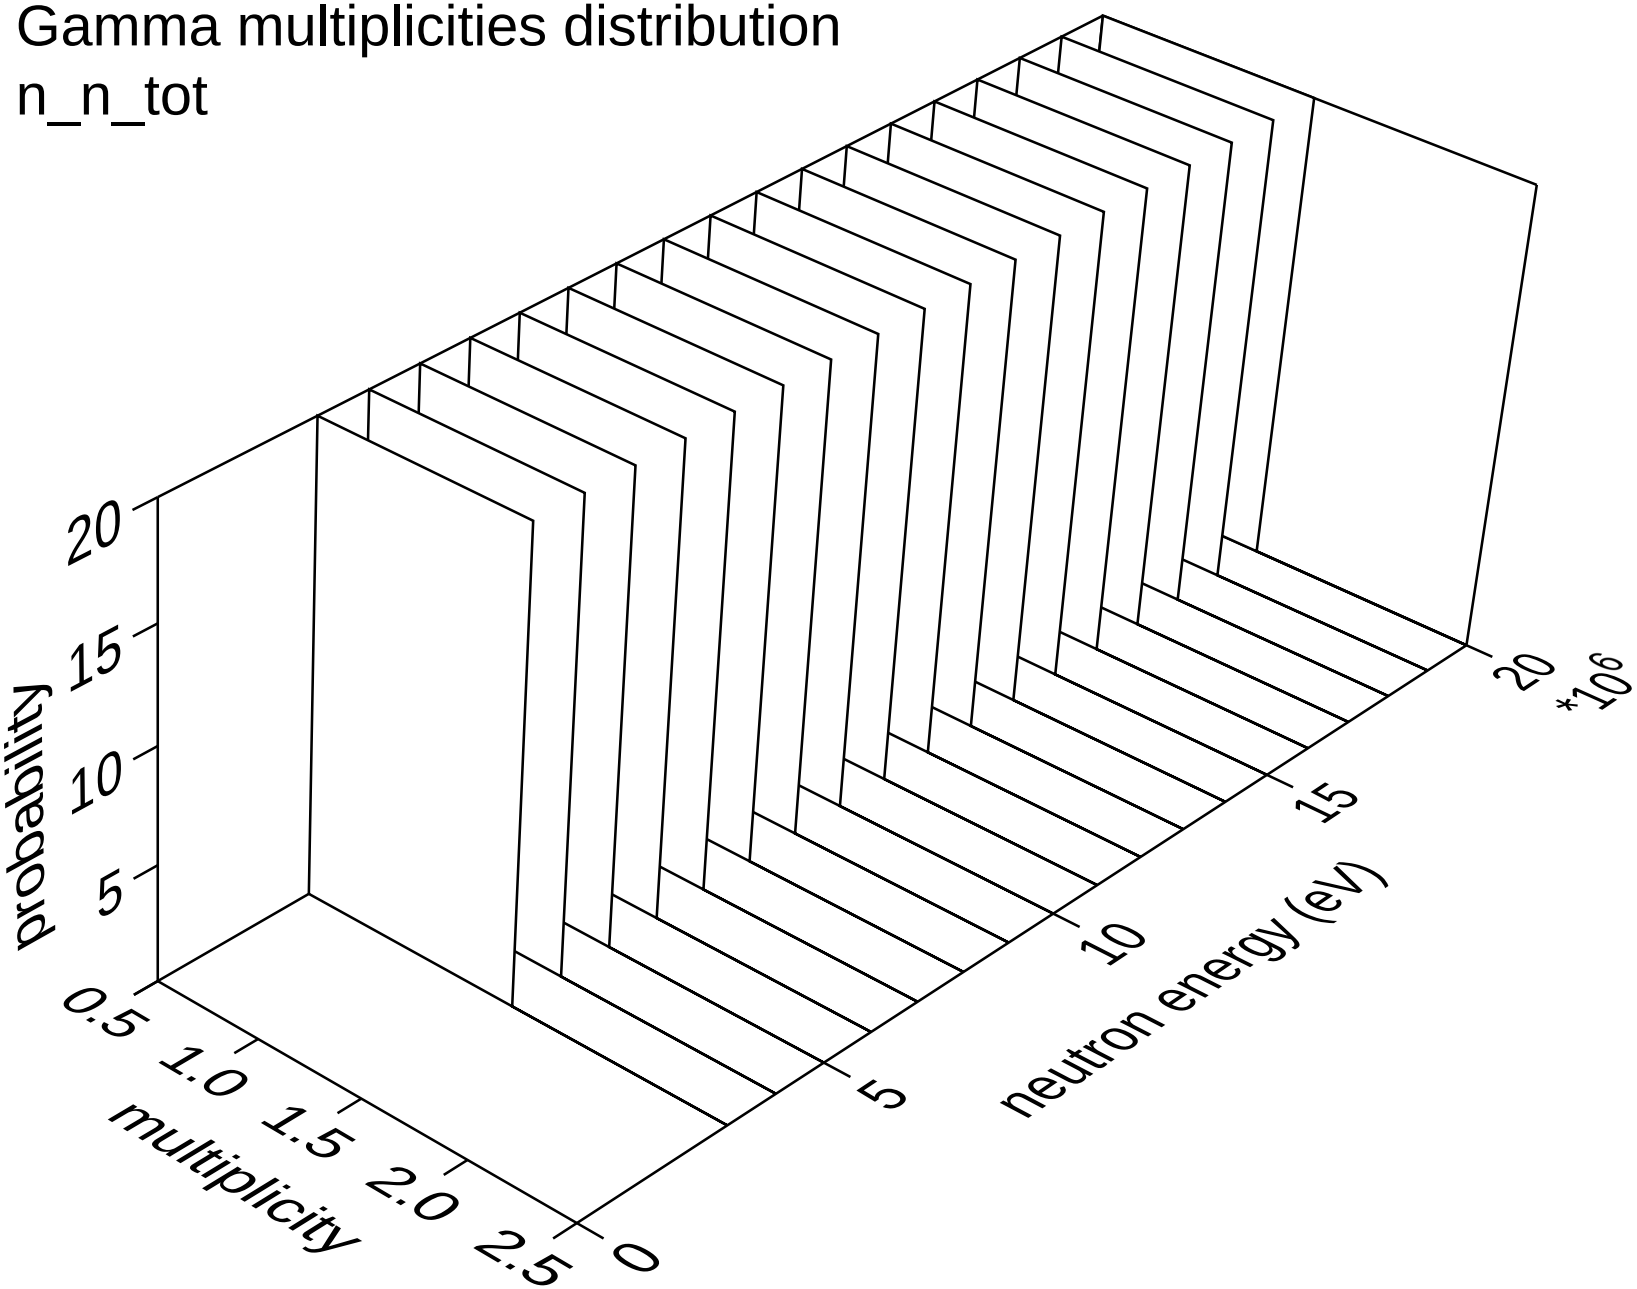
Gamma multiplicities distribution
n_n_tot